HOUSTON METROPOLITAN INSPECTIONS UNLIMITED, LLC

PHONE: 713 828 0310 713-829-2484 OR PROPERTY INSPECTION REPORT

Prepared For: RAY LYONS

(Name of Client)

Concerning: 4423 VANDERMERE CT, KINGWOOD TEXAS

LYO6-100520

(Address or Other Identification of Inspected Property)

By: LINDA MCCRACKEN TREC License #709

OCT. 5, 2020

(Name and License Number of Inspector)

(Date)

PURPOSE, LIMITATIONS AND INSPECTOR/CLIENT RESPONSIBILITIES

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at www.trec.texas.gov.

The TREC Standards of Practice (Sections 535.227-535.233 of the Rules) are the minimum standards for inspections by TREC-licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is NOT required to turn on decommissioned equipment, systems, utility services or apply an open flame or light a pilot to operate any appliance. The inspector is NOT required to climb over obstacles, move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer's installation instructions. The inspection does NOT imply insurability or warrant ability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector shall indicate, by checking the appropriate boxes on the form, whether each item was inspected, not inspected, not present or deficient and explain the findings in the corresponding section in the body of the report form. The inspector must check the Deficient (D) box if a condition exists that adversely and materially affects the performance of a system or component or constitutes a hazard to life, limb or property as specified by the TREC Standards of Practice. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing components, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards or Deficiencies below.

THIS PROPERTY INSPECTION IS NOT A TECHNICALLY EXHAUSTIVE INSPECTION OF THE STRUCTURE, SYSTEMS OR COMPONENTS. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It's not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with opinions expressed in previous or future reports.

ITEMS IDENTIFIED IN THE REPORT DO NOT OBLIGATE ANY PARTY TO MAKE REPAIRS OR TAKE OTHER ACTIONS, NOR IS THE PURCHASER REQUIRED TO REQUEST THAT THE SELLER TAKE ANY ACTION. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods.

Promulgated by the Texas Real Estate Commission (TREC) P.O. Box 12188, Austin, TX 78711-2188 (512) 936-3000 (http://www.trec.texas.gov).

REI 7-5 (05/4/2015)

Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property

TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES

Each year, Texans sustain property damage and are injured by accidents in the home. While some accidents may not be avoidable, many other accidents, injuries, and deaths may be avoided through the identification and repair of certain hazardous conditions. Examples of such hazards include

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices for electrical receptacles in garages, bathrooms, kitchens, and exterior areas;
- malfunctioning arc fault protection (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning of carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST)

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.

These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions. While the TREC Standards of Practice do not require inspectors to perform a code compliance inspection, TREC considers the potential for injury or property loss from the hazards addressed in the Standards of Practice to be significant enough to warrant this notice.

Contract forms developed by TREC for use by its real estate licensees also inform the buyer of the right to have the home inspected and can provide an option clause permitting the buyer to terminate the contract within a specified time. Neither the Standards of Practice nor the TREC contract forms require a seller to remedy conditions revealed by an inspection. The decision to correct a hazard or any deficiency identified in an inspection report is left to the parties to the contract for the sale or purchase of the home.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

REI 7-5 (05/4/2015)

Report Identification: _	4423 VANDERMERE CT, KINGWOOD TEXAS	LYO6-100520

I=Ins _l	pected	NI=1	Not Inspected	NP=Not Present	D=Deficient
I	NI	NP	D		

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

THE BUYER WAS PRESENT AT THE TIME OF THE INSPECTION.. PHOTOS ARE NOT INTENDED TO SHOW ALL THE LOCATIONS THAT MAY BE IN NEED OF REPAIR OR OF CONCERN, BUT TO HELP IDENTIFY AND/OR UNDERSTAND CONDITIONS. THIS HOUSE WAS NOT INSPECTED FOR AND NOT TESTED FOR THE PRESENCE OR ABSENCE OF FUNGAL GROWTH (TOXIC MOLD), mVOC'S POLLUTANTS, BIOHAZARDS OR ENVIRONMENTAL HAZARDS IN ANY WAY WHATSOEVER. ABSOLUTELY NO OPINIONS, NO REPRESENTATIONS, NO WARRANTIES AND NO IMPLIED WARRANTIES ARE MADE OR GIVEN AS TO THE PRESENSE OF ABSENCE OF FUNGAL GROWTH (TOXIC MOLDS). BY ACCEPTANCE OF THIS INSTRUMENT, THE CUSTOMER WAIVES ANY AND ALL CLAIMS FOR DAMAGES, COSTS, EXPENSES, REPAIR OR OTHER LIABILITIES AGAINST THE INSPECTOR RISING OUT OF OR IN ANY WAY RELATED TO THIS INSPECTION AND THE FAILURE TO REPORT DEFECTS IN THE ITEMS INSPECTED UNLESS CAUSED BY GROSS AND WILLFUL NEGLIGENCE OF THE INSPECTOR.

IDENTIFICATION OF RECALLED ITEMS IS NOT WITHIN THE SCOPE OF THIS INSPECTION. CHINESE DRYWALL IS NOT INSPECTED.

PARTICULAR ATTENTION SHOULD BE GIVEN TO THE FACT THAT THIS REPORT DOES NOT AND CANNOT REFLECT AN INDEPTH PERSPECTIVE OF THE VARIOUS INCLUDED ITEMS. IT CAN ONLY REFLECT WHAT THE INSPECTOR WAS ABLE TO ACTUALLY SEE WITHOUT REMOVING OBSTRUCTIONS TO VISION OR PHYSICALLY TAKING ANYTHING APART.(BOXES ARE NOT MOVED OUT OF CLOSETS OR STORAGE AREAS). CARS ARE NOT MOVED OUT OF GARAGES OR OTHER ITEMS STORED IN THE GARAGE. , SHOULD YOU REQUIRE ADDITIONAL OR MORE DETAILED INFORMATION REGARDING ANY OF THESE ITEMS, CONTACT A REPUTABLE, LICENSED EXPERT IN THAT PARTICULAR FIELD.

UNLESS THE HOME BEING INSPECTED IS BRAND NEW IT WILL UNDOUBTEDLY SHOW A FEW SIGNS OF WEAR AND TEAR. VIRTUALLY EVERY PRE-OWNED HOME DOES, AND THE OLDER THE HOME THE MORE PREVALENT THESE SIGNS TEND TO BECOME. PLEASE REMEMBER THAT THIS IS CONSIDERED NORMAL, AND THESE ITEMS WILL NOT BE NOTED. IF THIS HOME IS OCCUPIED AT THE TIME OF INSPECTION, NO FURNITURE OR RUGS ARE MOVED. CARPET IS NOT INSPECTED FOR WEAR OF STAINS. BEFORE CLOSING, WE RECOMMEND VISUALLY RECHECKING INTERIOR AND EXTERIOR WALLS FOR DEFECTS OR DEFICIENCIES WHEN HOME IS VACATED AND OBSTRUCTIONS ARE REMOVED. COUNTER TOPS AND CABINETS ARE NOT INSPECTED. STRUCTURAL & MECHANICAL INSPECTIONS DO NOT INCLUDE THE FOLLOWING: GAS LINES, OUTDOOR COOKING EQUIPMENT, YARD LIGHTING, FRENCH DRAIN SYSTEMS, OR UNGROUND DRAINS CONNECTED TO GUTTERS, WATER WELL SYSTEMS, SEPTIC SEWAGE SYSTEMS, SELF CLEANING CYCLE ON OVENS, AND RADIATION LEAKAGE FROM MICROWAVE OVENS, CHINESE DRYWALL OR ANY PROBLEMS RESULTING FROM CHINESE

LINK TO NOTICE "TEXAS REAL ETATE COMMISSION CONSUMER NOTICE" (please go to this page for information) https://www.trec.texas.gov/public/consumer-information

1. 2. DRYWALL.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D



I. STRUCTURAL SYSTEMS

 \square \square \square A. Foundations

Type of Foundation(s): Slab on Grade Comments

At the time of the inspection the foundation of the home was considered to be adequately performing the function for which intended. In my opinion, the foundation is performing in an average manner taking into consideration normal wear and tear, the age, repair history, and location of the house. Doors and windows generally fit properly in their frames and opened and closed freely. There were no visible signs of racking or twisting in the visible roof framing and the fascia corners were tight. This home is a slab-on-grade foundation. Since the variation of the moisture content of the foundation soil is probably the most significant factor contributing to continuing foundation movement, a proper lawn maintenance program will aid in minimizing foundation problems in the future. No warranty against future movement can be made.

The inspector can only provide an opinion of foundation conditions based on visible findings at the time of the inspection. Detailed evaluation of foundation performance requires special knowledge, research and tools, which beyond the scope of my inspection. At the time of the inspection, we had not been informed of any prior foundation repairs.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

 \boxtimes

Comments: Sub-surface drains are not inspected.

C. Roof Covering Materials

Types of Roof Covering: Asphalt Shingles

Viewed From: THE INSPECTOR WALKED ON THE ROOF.

Comments: I do not lift the shingles to inspect for fasteners as this could damage the shingles or/and void the warranty.

There are signs of normal aggregate loss, deterioration, shrinkage & curling of shingles due to age of roof. There were no visible signs of active water penetration on the (accessible) roof decking or sheetrock. Note: If the home has been recently painted, this limits my visibility of water stains.



D. Roof Structures and Attics

Viewed From: View from attic access and from the walkways.

Approximate Average Dept of Insulation: 5 - 9 inches

Comments: Only areas in the attic deemed accessible by the inspector are inspected (only areas that are accessible with a solid stable walkway). The inspector does not move storage items, duct work, or insulation. If there are items stored in the attic, this limited access and visibility, too.

The garage attic stairs are not fire rated. These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions

 \bowtie

Keport Identi	incation: <u>4425 VAN</u>	DERMERE CI, KI	NGWOOD IEAAS	L 1 O0-100520	
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient		
I NI	NP D				

The attic door does not fit flush to the ceiling.



The purlins are not sized to the rafters and the rafters are not full-bearing to the ridge board. Current code requires the purlins to be the same board depth as the rafters they support. The rafters were $2" \times 6"$ and the purlins were $2" \times 4"$. The. The purlin struts requires a strut every four feet to support the load.

T 3707 100530

There is a slight deflection in the roof line above the garage

Additional attic insulation is needed.

Note: This is not a code specific inspection; therefore, no comment is made with respect to adherence to span, material grades, nailing or other miscellaneous code specifications.

Comments: Only areas free of furniture and all other obstructions are inspected. IF THE HOME HAS BEEN FRESHLY PAINTED, ANY WATER INTRUSION WILL NOT BE VISIBLE AT THE TIME OF THE INSPECTION.

The home flooded during hurricane Harvey. We always recommend the buyers consult their own mold remediation consultant for clearance certificates and air quality tests. We do not give any warranties against future problems that may occur because of the flood. It is beyond scope of our inspection to determine what was replaced, etc

Report Identification: 4423 VANDERMERE CT, KINGWOOD TEXAS LYO6-100520

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

All exterior wall penetrations should be sealed with an approved material to prevent water penetration into the wall cavities (i.e. expansion joints, windows, electrical boxes, etc).



		F. Ceiling and Floors Comments:
\boxtimes		G. Doors (Interior and Exterior) Comments: Self-closing hinges need installed on the door that enters the house from the garage
		this door is considered a fire separation door. The back door threshold is loose.
\boxtimes		H. Windows Comments:
		There are missing window screens at various windows around the home.

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a hungr or caller, if they can be reasonably determined

There is ordinary glass in locations where modern construction techniques call for safety glass: (windows above tubs 5 feet; glass on showers (I did not find a marking

buyer or seller, if they can be reasonably determined

on the middle glass in master bedroom).

	I=Inspected		NI=Not Inspected		NP=Not Present	D=Deficient	
Ī	I	NI	NP	D			

The security contacts in the window frame need sealed.



Note: The home has single pane windows.

	\boxtimes	I. Stairways (Interior & Exterior)
		Comments:

$oxed{oxed}$ $oxed{oxed}$ J. Fireplaces and Chimneys

Comments:

Adequacy of draft or condition of inaccessible flue tiles or pipe is not determined.

I lit the fireplace. It does not appear the fireplace firebox was replaced after the home flooded.

Observed absence of damper stop clip which is required when there are gas logs.

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined



There have been visible repairs made to the bricks.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D





K. Porches, Balconies, Decks and Carports

Comments

Comments:

L. Other

I=Ins	pected	NI=Not Inspected		NP=Not Present	D=Deficient	
I	NI	NP	D			

II. ELECTRICAL SYSTEMS

A. Service Entrance and Panels

Comments:

150 AMP

The main breaker is 150 AMPS; however, the service wires were 1/0 AL which is only rated for 125 AMPS.

I recommend replacement of the electrical box. It appears it may have been under the flood waters. Also, the box is a challenger, which some insurance companies will not insure. Check with your insurance company.

Rust on bottom section of box.



The handle ties are missing on the 220 circuits.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D



The breakers are not all properly labeled.

Anti-oxidant grease is needed where the aluminum service wires connect to the lugs.



There were "white wires" attached to breakers. White wires are deemed neutral and must be identified as hot wires by tape or red or black paint at breaker end.



Report Identification:	4423 VANDERMERE CT. KINGWOOD TEXAS	LYO6-100520
Report Identification:	4425 VANDERWIERE CI, KINGWOOD IEAAS	L100-100520

I=Inspected		NI=Not Inspected		NP=Not Present	D=Deficient
I	NI	NP	D		

The breaker for the AC compressor is too large according to the manufacture's spec plate.

Today's breaker panels have a neutral bar on one side and a grounding wire bus bar on the other – all neutral wiring and all grounding wires should be attached only to the appropriate bar – on the neutral side, each wire should be connected to a separate lug.



The grommet is missing around the metal knock-outs. Most of the supply wires are bundled where they go out of the main panel, this is common on most older homes but is not proper per current electrical standards.



Also, there were breakers which appeared to serve a single conductor, indicating conductors may be connected to 240-volt circuits (red and black); trip ties are needed.



When the box is replaced; it should be brought up to code.

I=Ins	pected	NI=	Not Inspected	NP=Not Present	D=Deficient
I	NI	NP	D		

☑ ☐ ☐ ☐ B. Branch Circuits - Connected Devices and Fixtures

Type of Wiring: Copper

Comments:

Ancillary wiring items not inspected include but are not limited to: telephone, cable, speaker, computer, photocells, low voltage, hard wiring on smoke detectors, electric gates and doors, or landscape lighting and intercom systems are not inspected. If any repairs are noted, the repairs should be done by a licensed electrician and the electrician should inspect for other problems, etc.

Note; It does not appear an electrical permit was pulled when the repairs were made after the flood

The GFCI, located on the right side of the kitchen sink is incorrectly wired; hot neutral reverse.

Ground Fault Circuit Interrupters(s) GFCI protection were present: at all kitchen countertop areas; bathrooms; some of the garage; and exterior receptacles.

Ground Fault Circuit Interrupters(s) GFCI protection were missing in the garage and laundry room receptacles. While this may not have been a code requirement when the home was built it is now a requirement for all TREC Licensed inspectors to call this item to the buyers attention and mark as deficient.

A cover is needed on the junction box.



There were working smoke detectors.

Note: Smoke detectors, which are older than 10 years need replaced.

Report Identification:	4423 VANDERMERE CT.	KINGWOOD TEXAS	LYO6-100520
Kepor i luchuncation.	TTES I ANDERWIERE CI,	KING WOOD TEAAS	L100-100320

I=Ins	pected	NI=Not Inspected		NP=Not Present	D=Deficient
I	NI	NP	D		

Current building standards require smoke detectors in the bedrooms, in the hall to the bedrooms and they must be hard wired together with battery back-up. There was one carbon monoxide (CO) detectors.

Current building standards require arc fault protection (AFCI) in the family rooms, dining rooms, living rooms, parlors, libraries, dens, bedrooms, sunrooms, recreations rooms, closets, hallways, or similar rooms or areas.

While this may not have been a code requirement when the home was built it is now a requirement for all TREC Licensed inspectors to call this item to the buyers attention.

Newer dryers use a 4 prong connection while older dryers use the 3-prong type which is out of code.

Extension cords cannot be used as permanent wiring.



The insulation was in contact with recessed light canisters. The insulation needs moved away from the canisters to prevent heat build-up.



III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

Type of Systems: Central Air


Energy Sources: Gas

Comments: Complete evaluation of gas fired furnace heat exchangers

require dismantling and is beyond the scope of this inspector. The system fan, burner, and heat exchanger are not readily available for inspection without disassembly of unit

The heater worked. No dismantling of the unit was preformed. There were no visible signs of rust or corrosion.

There is no sediment trap/drip leg on gas line.

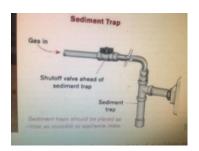

□ □ □ B. Cooling Equipment

Type of Systems: Central Air

Comments: The inspector does not measure airflow or determine the adequacy of the system. Humidifiers, motorized dampers, electronic filters, and programmable thermostats are not inspected. The air conditioner system is not tested when outside ambient temperature is below 65 degrees Fahrenheit to avoid damage to the system.

Note: Inspector is not required to program digital controls, check pressure or type of refrigerant, verify compatibility of components, verify accuracy of thermostats, determine adequacy of the system, or to determine uniformity of conditioned air to various parts of the home.

The AC unit is a 5 ton, dated 2020. This unit was cooling sufficiently. There was a 20 degree differential between the supply and return air.

Report Identification: 4423 VANDERMERE CT, KINGWOOD TEXAS LYO6-100520

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D



The AC drain line is located under the bathroom sink; therefore, bleach should be put in the drain a couple times a year to prevent algae from developing in the sink drain.

Note: A measure of how well an air conditioning system is operating is called "Delta T" and is the difference in temperature between the air going into the system and the air coming out. The acceptable range is 17 to 21 degrees.

TREC Standards, Installation Standards of Safety Issues

- Oversized breaker at panel
- Electrical receptacle missing at exterior and/or interior unit
- C. Duct Systems, Chases, and Vents

Comments:

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D

IV. PLUMBING SYSTEMS

☐ ☐ A. Plumbing Supply, Distribution Systems and Fixtures

Location of water meter: Front Yard
Location of main water supply valve: laundry room



Static water pressure reading: 61 psi

Comments: The water supply valves under all bathroom sinks and commodes are not tested. The plumbing is tested by flushing the commodes and running water in the sinks and tub. If the home is vacant at the time of the inspection, the drain pipe will be empty and water may appear to flow properly.

The home has copper plumbing pipes.

Master Bathroom: There were no visible signs of plumbing leaks.

Hall Bathroom: There were no visible signs of plumbing leaks. The AC drain line is located under this sink; therefore, bleach should be put in the drain a couple times a year to prevent algae from developing in the sink drain.

1/2 Bathroom: There were no visible signs of plumbing leaks

Kitchen Sink: The drain pipes are incorrectly installed.



Outside spigots: The anti-siphon devices were on the outside spigots.

There is not a "visible" bonding wire attached at the exterior gas meter "metal gas supply pipe", at the water heater equipment and furnace equipment.

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.



A cap is needed on the laundry room gas valve.

	B. Drains, Wastes, and Vents Comments:
	Underground plumbing and drain clean-outs are not within the scope of this inspection.
	There were no visible problems.
	I opened the main drain clean-out and there was no visible standing water in the pipe or visible debris in the pipe.
	C. Water Heating Equipment Energy Sources: GAS Capacity: 50 Gal. Comments: Note: The temperature/pressure relief valves are not tripped at the time of the inspection. The valves do not reseat properly many times when they are operated which causes the valve to leak. Manufactures recommend valves older than three years be removed cleaned and inspected or replaced.
	Detail 2007

The water heater does not work. Dated 200

 \boxtimes

Repor	rt Iden	tificatio	on: <u>4</u> 4	123 VANDERMERE CT, KINGWOO	D TEXAS LYO6-100520
I=Ins	pected	NI	=Not Ins	pected NP=Not Present D=Def	icient
I	NI	NP	D		
		\boxtimes		D. Hydro-Massage Therapy Equipo	nent
				E. Other Comments:	

керо	rt 1aent	incation:	4423 VAN	<u>DERMERE CI, KI</u>	NGWOOD TEXAS	LYO6-100520	
I=Ins	spected	NI=N	Not Inspected	NP=Not Present	D=Deficient		
I	NI	NP	D				

V. APPLIANCES

\boxtimes			A. Dishwashers Comments:
			The dishwasher worked. The unit was performing its intended purpose at the time of the inspection.
\boxtimes			B. Food Waste Disposers Comments:
			The garbage disposal worked.
\boxtimes		\boxtimes	C. Range Hood and Exhaust Systems Comments:

The exhaust fan did not work.


The unit was not replaced after it was in flood waters The vent pipe is supposed to be hard pipe.







Repor	t Ident	ificatio	on: <u>4423 VA</u>	NDERMERE CT, KINGWOOD TEXAS LY06-100520
I=Ins	pected	NI	=Not Inspected	NP=Not Present D=Deficient
I	NI	NP	D	
\boxtimes				. Ranges, Cooktops, and Ovens Comments: The self cleaning function is not tested on the oven.
				The electric cook-top needs replaced. It was under the flood waters.
				Oven temperature was checked at the 350 degree bake setting; temperature was 352 degrees, which is within industry standard of 25 degrees difference.
				C. Microwave Ovens Comments:
				There were no visible or operational problems. The unit was performing its intended purpose at the time of the inspection.
\boxtimes				F. Mechanical Exhaust Vents & Bathroom Heaters Comments:
				The exhaust fans work.
				All bathroom exhaust fans vents should terminate to the exterior of the dwelling. These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions.
\boxtimes				G. Garage Door Operators Comments:
				The safety sensor eyes worked. The door reversed when encountering resistance. The safety sensor eyes are not supposed to be higher than 6 inches from the floor.

 

H. Dryer Exhaust Systems

Comments:

The dryer vent needs cleaned.

The dryer vent terminates within a roof jack in the attic and does not appear to incorporate a back draft damper.





I. Other

Comments:

I=Ins	spected	N	I=Not Inspect	red NP=Not Present D=Deficient
I	NI	NP	D	
				VI. OPTIONAL SYSTEMS
\boxtimes				A. Landscape Irrigation (Sprinkler) Systems Comments:
				The sprinkler system was inspected in the manual mode.
				There is the absence of a back-flow prevention device
				There is the absence of a rain sensor.
		\boxtimes		B. Swimming Pools, Spas, Hot Tubs, and Equipment Type of Construction: Comments:
				C. Outbuildings Comments:
				D. Private Water Wells (A coliform analysis is recommended) Type of Pump: Type of Storage Equipment: Comments:
				E Private Sewage Disposal (Septic) Systems Type of System: Location of Drain Field: Comments:
				F. Other Comments: