



HEDDERMAN SERVICES

281-355-9911

office@hedderman.com

<https://hedderman.com/>



STRUCTURAL INSPECTION

16230 Jersey Dr
Jersey Village TX 77040

David Mladenka & c/o Sandy Mladenka

FEBRUARY 8, 2021



Inspector

Javier Almodovar

Engineer

281-355-9911

office@hedderman.com

TABLE OF CONTENTS

1: Cover Letter	3
2: Purpose/Scope	4
3: Site Conditions	6
4: Foundation	7
5: Roof	17
6: Structural Framing	23
7: Water Penetration	27
8: Fireplace/Chimney	31
9: Attic	35
10: Exterior Items	39
11: Interior Items	44
12: Close	54
13: Receipt Page	55
14: Service Agreement	56

1: COVER LETTER

Information



HEDDERMAN ENGINEERING, INC.

www.heddermanengineering.com Office 281-355-9911 Fax 281-355-9903 office@heddermanengineering.com

02/08/2021

TO: David Mladenka & c/o Sandy Mladenka

REF: CONDITION OF PROPERTY SURVEY

Dear David Mladenka & c/o Sandy Mladenka:

At your request, a visual survey of the house located at 16230 Jersey Dr, Jersey Village TX 77040 was performed by Javier Almodovar. Transmitted herewith is the inspection report stating our professional opinions on whether the items of construction included in the survey are functional on the day of the inspection, or are in need of repair.

The scope of our inspection and other important information, particularly in the area of dispute resolution should a question arise, is contained in our Service Agreement, which has been included at the end of this report.

Thank you for asking HEDDERMAN ENGINEERING, INC. to perform this important inspection work for you. If you have any questions after reviewing this report, please feel free to call me at my office.

At your service,

HEDDERMAN ENGINEERING, INC.

Tim Hedderman, President

2: PURPOSE/SCOPE

Information

INTRODUCTION

The purpose and scope of the inspection are detailed below, as well as in the executed Service Agreement at the end of this report. Also included are the limitations of the inspection.

PURPOSE

The purpose of the inspection was to view the components of the house included in the inspection and to give our opinions on whether or not these specific items were functioning at the time of the inspection, or were in need of repair. Although this report may include observations of some building code violations, total compliance with structural, mechanical, plumbing, electrical codes, specifications, and/or legal requirements is specifically excluded.

This also applies to all non-code making bodies, including but not limited to, the Brick Institute of America and the Texas Lathing and Plastering Contractors Association and their respective recommendations of building construction details. We do not perform "code" inspections, and since building codes change every few years, our inspections are not done with the intention of bringing every item in the house into compliance with current code requirements.

Rather, the standard of our inspections is a performance standard to determine if the items inspected are functioning at the time of the inspection, or if they are in need of repair. This is particularly applicable to Home Warranty policies, where the standards of the Home Warranty service company may differ than the scope of our stated performance standard for judging whether a piece of equipment is functional or in need of repair. If you intend to rely on a Home Warranty policy, then it is recommended that you contact the Home Warranty company of your choice for a more in-depth analysis of what may be required to meet their standards should a claim be made against their policy. It has been our experience that Home Warranty companies may require the equipment to be in total compliance with current code (even if it was installed before the current code was adopted) to be covered under their policy, and if so, it is recommended that you contact the appropriate service companies for a code compliance certification inspection. This report is provided solely for the use of the person to whom this report is addressed, and is in no way intended or authorized to be used by a third party, who may have different requirements, and to whom we have not contracted to perform the inspection. If a third party chooses to use this inspection report, they do so without HEDDERMAN ENGINEERING, INC. permission or authorization, and they do so at their own risk. It is our purpose to provide information on the condition of the house on the day of the inspection. It is not our purpose to provide discussions or recommendations concerning the future maintenance of any part of the house, or to verify the adequacy and/or design of any component of the house. It is pointed out that other engineers/inspectors may have contrasting opinions to those given in this report. Items that we find that in our opinion are in need of repair will typically include the recommendation to Obtain a Cost Estimate from qualified contractors. The scope and cost of the actual repairs can vary significantly from company to company, and it is your responsibility to see that the scope of work needed and actual cost of repairs is confirmed by contacting one or more qualified service companies before your option period ends or before closing on the property. This report may also contain informational items which are included as a courtesy to help you become more aware of the condition of the house. In the performance of this inspection, HEDDERMAN ENGINEERING, INC. has acted as an engineering consultant subject to the standards of the State Board for Professional Engineers.

SCOPE

The scope of the inspection included limited, visual observations at the interior and exterior of the structure. Only those items readily visible and accessible at the time of the inspection were viewed and are included in this report. Any items causing visual obstruction, including, but not limited to furniture, furnishings, floor or wall coverings, pictures, foliage, registers and grills on HVAC ductwork, soil, appliances, insulation, etc., were not moved. The basis of our opinions will be the apparent performance of that portion of the house readily visible at the time of the inspection.

Disassembly or removal of any portion of the structure, mechanical equipment, plumbing equipment, or electrical equipment is beyond the scope of this inspection. There is no warranty or guarantee, either expressed or implied, regarding the habitability, future performance, life, insurability, merchantability, workmanship, and/or need for repair of any item inspected. The components of the house included in scope of the inspection, if present and applicable, include:

Structural: Foundation, primary load-carrying framing members, roof surface, water penetration, and miscellaneous items related to the house.

Mechanical: Air conditioning and heating systems, water heaters, built-in kitchen appliances, and garage door openers.

Plumbing: Water and gas supply lines, sinks, toilets, tubs, showers, visible drain lines inside the house, and vents.

Electrical: Service entrance conductors, electric meter, distribution panel, visible wiring, light fixtures, switches, and receptacle outlets.

Items specifically excluded from our inspection include:

- Tainted and Corrosive sheetrock (Chinese Sheetrock).
- All pests, wood destroying insects, conducive conditions, ants, or rodents.
- All equipment related to mosquito control.
- All items related to major geological conditions such as faults or subsidence.
- All underground piping, including water, sewer, and gas piping.
- Water softening and water treatment systems.
- Identifying products that have been recalled.
- Pressure testing of gas system.
- All low voltage lighting systems and/or photocells.
- All low voltage data systems such as telephone, cable TV or data lines.
- All fire detection, carbon monoxide, smoke alarms and/or security alarm systems.
- All environmental hazards, or any toxic/hazardous materials including, but not limited to: radon gas, lead, formaldehyde, electromagnetic, any and all items related to asbestos.
- A backup generator and transfer switch panel.
- Any electrical load analysis on the electrical system to determine adequacy of the service or any branch circuit.

If you desire information or inspections concerning the items listed above, or any other items, then it is recommended that you contact the appropriate service companies. Also excluded from the scope of the inspection are any and all items related to mold and/or all microbial substances. Due to the current limitations of coverage on most homes by the insurance industry in Texas, where damages due to mold and/or other microbial substances may not be covered, we routinely recommend that you have a mold inspection by a qualified professional before you close on the house. Built-in appliances and mechanical equipment were operated in at least one, but not all, of their operating modes, where possible. If you desire for every operating mode of each piece of equipment to be operationally checked, then it is recommended that you contact a service company. Equipment and materials that are not visible, including structural components, underground plumbing and gas lines, and all other items not normally available for ready viewing, are excluded from the scope of this inspection. If you desire an inspection on the underground plumbing pipes or a hydrostatic test to determine if the plumbing pipes are leaking under the house, then it is recommended that you contact a plumber. No electrical circuit or load analysis will be performed on the electrical system. We make no representation regarding the condition of this house other than as contained in this written report. Any verbal discussions concerning this house that were made at the time of the inspection, and not contained in this written report, are not to be relied upon. Although the structural portion of this inspection was made by an engineer, it cannot be considered to be a formal engineering study since no calculations, structural analysis, or physical material testing were performed. If engineering drawings/specifications have been made available during this inspection and, if they have been viewed, it is pointed out that all such viewing is strictly cursory, and in no way should our cursory examination be construed as providing engineering judgments concerning the adequacy or acceptability of the drawings/specifications. It is pointed out that it is possible for latent defects to exist in the structure and its related equipment, underground piping, and systems that are not visible at the time of the inspection, and may not be able to be viewed during a limited visual inspection. This is particularly applicable in items relating to water, such as roof leaks, water penetration conditions, etc., where the condition may exist, but not be visible at the time of the inspection (e.g. where it has not rained for a period of time, allowing materials time to dry out). HEDDERMAN ENGINEERING, INC. does not claim or warrant that the observations listed in this report represent every condition that may exist. In using the information supplied by this inspection, one must recognize the limitations of a limited, visual inspection conducted at a single point in time, and accept the inherent risk involved. It is recommended that you obtain as much history as is available concerning this house. This historical information may include copies of any seller's disclosures, previous inspection or engineering reports, building drawings and/or specifications, bids to perform repair work on the house, knowledge of any drainage problems, receipts from repair work that has been performed, reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should attempt to determine whether repairs, renovation, remodeling, additions or other such activities have taken place at this house.

3: SITE CONDITIONS

Information

Occupancy

Occupied

Weather

Dry, Cloudy, Temperature - 60-70 degrees

Age of Home - HAR

According to HAR, the house was built in 1972.

North-Rear

For the purpose of the inspection and report, NORTH will be assumed to be from the front of the house towards the rear.

4: FOUNDATION

Information

Description: FOUNDATION OBSERVATIONS AND CONCLUSIONS:

The following items were inspected, with our Observations and Conclusions noted.

Description: Concrete Rebar slab

The foundation was a concrete slab on grade, and appeared to be reinforced with steel reinforcing rods (rebar).

Differential Movement: Reference point

See our field sketch below showing the elevation readings for this structure. Note that the "R" on the sketch is our randomly chosen starting reference point, where the elevation is 0, and all other elevation readings are taken relative to the reference point, and are measured in inches to the nearest 1/10 inch. Height adjustments were made for variations in the height or thickness of the various floor coverings. If there is a step up or a step down into an area such as a garage, sunken room, balcony/patio area, or raised rooms, the elevation readings will have larger numbers due to the amount of the step.

We typically point out that foundations are rarely constructed perfectly level, so most properties have some unlevelness (typically $\frac{3}{4}$ to 1-1/2 inches) built into the foundation as part of original construction. We have no knowledge as to how much unlevelness was built into this house foundation during original construction.

Note that it is not HEI's purpose to exhaustively document each and every evidence that may be related to foundation movement, but rather to document a representative sample and/or the most significant evidences of movement upon which we base our opinion on the condition of the foundation.


Differential Movement: Levelness - More than normal

The floors were checked with an electronic level, and were observed to be sloping a more than normal degree from the master bathroom towards the front east area of the house. The difference in elevation between the high point and low point was 3.6 inches. The high point was located at the master bathroom, and the low points were located at the living room and the front bedroom. The unlevelness takes place over a horizontal distance of approximately 60 feet.

2.8.21

HEI


Mladenka

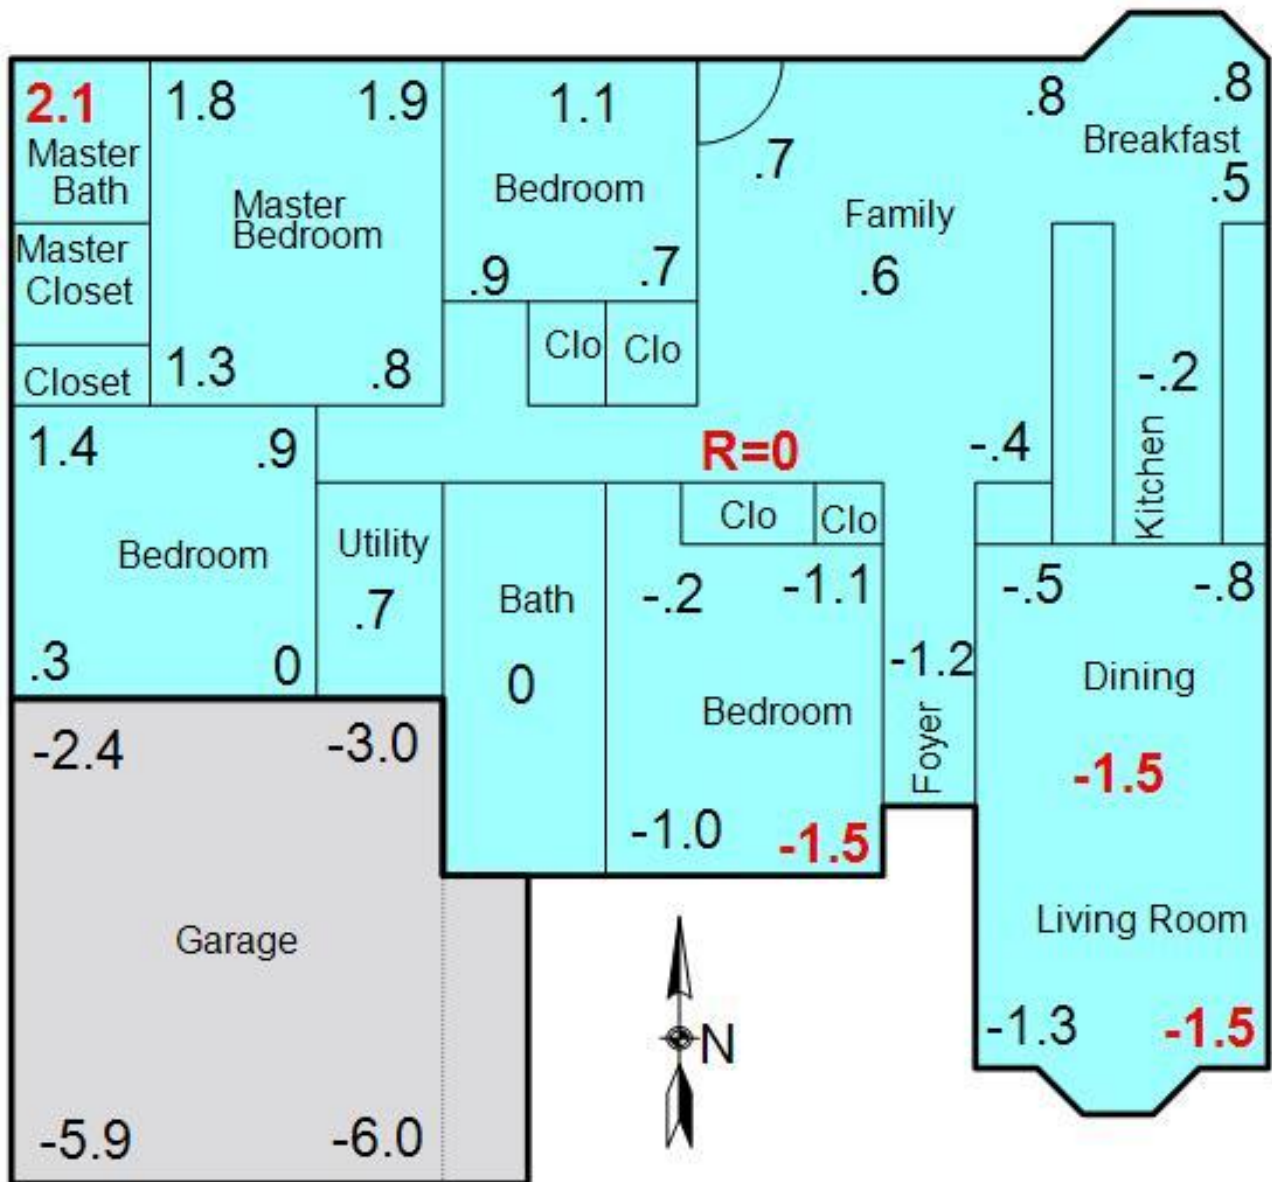

Elevation Readings
16230 Jersey Drive

Differential Movement: Veneer - Cracks/Patches

Cracks and/or patches were observed in the exterior veneer at the time of the inspection.

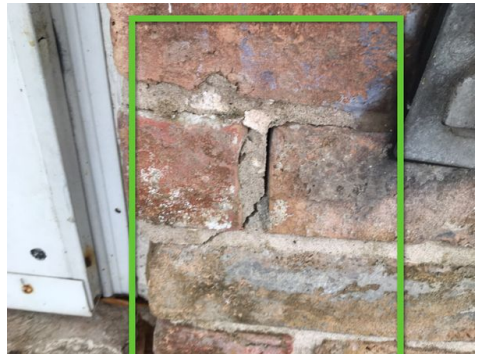




Differential Movement: Sheetrock Cracks/Patches/Compression ridges

Living room, west bedroom, hallway, south bedroom, north bedroom, master bedroom, west bedroom, and the garage.

Sheetrock cracks, patches, and/or compression ridges were observed in the house during the inspection, including at the above locations.

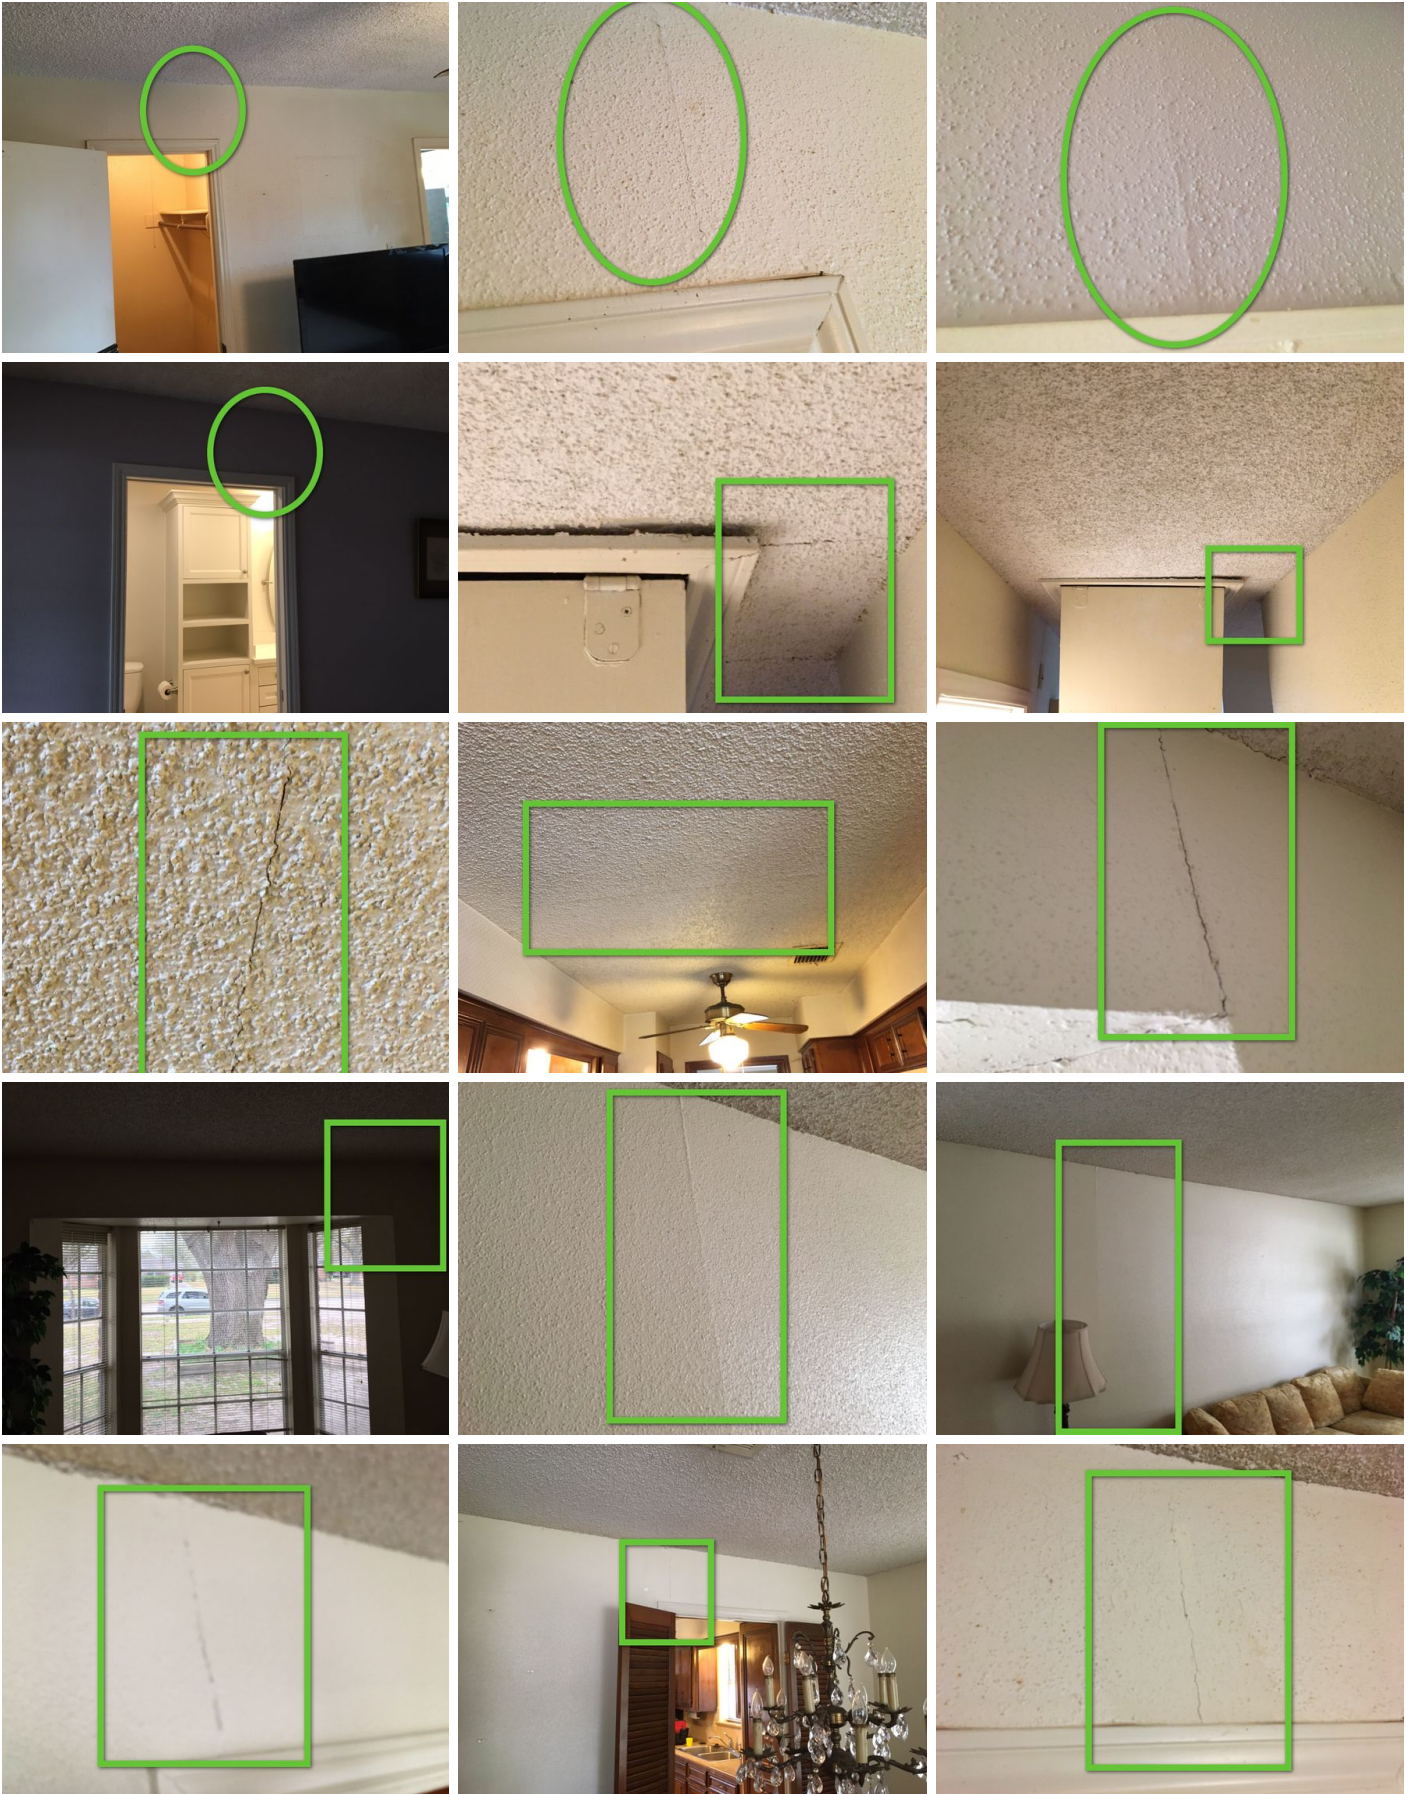




Differential Movement: Sheetrock - Nail pops

Master bedroom

Nail pops were observed in the surface of the sheetrock at the time of the inspection including at the above locations.

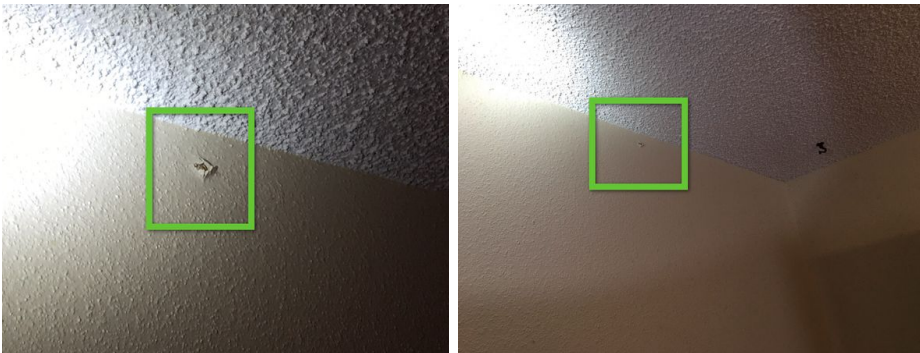

Differential Movement: Concrete cracks - None Observed

Cracking of the foundation concrete exists in virtually all foundations. Although no cracks were observed in this foundation, it is probably not an exception. It is pointed out that cracking is a normal property of concrete and other brittle materials, and Hedderman Engineering, Inc. assumes no responsibility should cracks be found that are not mentioned in this report.

Differential Movement: Slab Not visible - High Soil

It is pointed out that a portion of the foundation concrete could not be viewed due to soil that was graded near or above the top of the foundation and/or heavy foliage growing against the house. The soil and/or foliage should be removed, and 3-4 inches of foundation concrete exposed.



Differential Movement: Slab not visible - Wood Deck

It is pointed out that a portion of the foundation concrete could not be viewed at the rear of the house due to the wood deck that adjoined the foundation.



Separation of Materials: Sticking doors

South bedroom

Doors that were sticking due to movement of the house were observed at the time of the inspection.

Separation of Materials: Non latching doors

South bedroom closet, and the master bedroom.

Doors that would not latch due to misalignment of the striker plate and the locking mechanism were observed.

Separation of Materials: Door triangles at top

Master bedroom



Door frames that were out of square, leaving a triangular separation between the door and the door frame at the top of the door were observed where a separation was visible at the top of the door.



Separation of Materials: Cracked floor tile

Kitchen

We observed that the floor tile was cracked at one or more locations which can be an evidence of foundation movement.

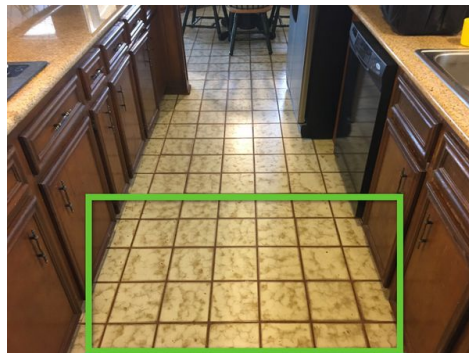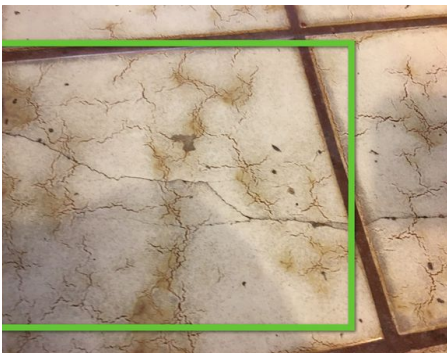

FOUNDATION CONCLUSIONS: REPAIR RECOMMENDED

Most of the structures previously inspected by this firm have experienced some degree of differential foundation movement, and this structure was no exception. After careful examination, it is our opinion that the degree of the foundation movement is more than what is acceptable.

Due to the more than acceptable amount of movement of the foundation of this structure, it is our opinion that releveling of the foundation is needed at this time. It is recommended that at least three foundation repair contractors be contacted in order that they may make their own assessment of the scope and cost of the work needed to bring

this foundation back to an acceptable degree of levelness.

Obtain Cost Estimate

FOUNDATION CONCLUSIONS: Recommend sewer leak test


It is recommended that a plumber be contacted to perform camera observation or leak testing on the underground sewer piping to determine if the underground piping is leaking. A leaking sewer pipe can contribute significantly to the instability of the supporting soils by introducing excessive moisture into the soils, thus weakening them, resulting in foundation settlement.

Obtain Cost Estimate

Perimeter Grading/Drainage: FLOOD PLAIN

100 Year Floor Plain

This inspection does not include determining if the property is in the 100 year flood plain. For further information regarding the elevation of this lot, check with your survey and/or a land surveyor.

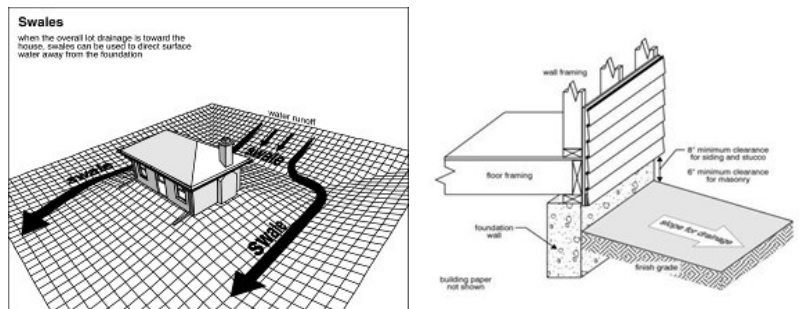

Perimeter Grading/Drainage: Wood Deck

We could not determine if any provision has been made at the rear of the house for drainage under the wood deck. It is recommended that you check with the owner to determine if there are any drainage problems at the deck area, and if any provision for drainage has been made.



Recommendations/repair

4.4.1 Other Observations

TREES AND/OR FOLIAGE

Trees and/or foliage were observed in the vicinity of the house which can contribute significantly to differential movement of the house foundation. Care should be taken to prevent the trees and foliage from removing an excessive amount of water from near the foundation of the house.

Recommendation

Contact a qualified professional.

4.7.1 Perimeter Grading/Drainage

HIGH GRADING/FLOWER BED

The perimeter grading and/or flower beds was too high at some areas, and was graded near or above the top of the foundation. It is recommended that the beds/soil be regraded as needed to prevent water penetration into the house, and to allow for proper drainage.

R401.3**Obtain Cost Estimate**

Recommendation

Contact a qualified landscaping contractor



4.7.2 Perimeter Grading/Drainage

GRADING POOR

FRONT OF THE HOUSE, SIDES OF THE HOUSE AND THE REAR OF THE HOUSE.

The perimeter drainage was observed to be poor at some areas where the lot is not sloped away from the house (6 inch drop in the first 10 feet) and water will pond. Poor drainage conditions near the foundation can contribute to foundation movement. It is recommended that a company specializing in drainage solutions be contacted to provide a recommended solution, along with a cost estimate to provide proper drainage.

R401.3

Obtain Cost Estimate

Recommendation

Contact a qualified landscaping contractor



5: ROOF

Information

Roof Descriptions: ROOF OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Roof Descriptions: Composition Shingles

House

The pitched roof surface was constructed of composition shingles. The life expectancy of a composition shingle roof has been observed to vary from 15 to 20 years, with most requiring replacement at about 17-20 years.



Roof Descriptions: Modified Bitumen

Porch

The roof surface was a low sloped roof that was covered by a modified bitumen roofing material. The life expectancy of the roof is estimated to be approximately 15 years.



Roof Descriptions: Roof Decking - Description

OSB, Plywood

The roof decking was observed from the attic space to be as described above.

Age of Roof: 1-2 years

Back porch

The age of the roof was unknown at the time of the inspection, but the roof appeared to the inspector to be approximately 1-2 years.

Age of Roof: 4-5 years

House

The age of the roof was unknown at the time of the inspection, but the roof appeared to the inspector to be approximately 4-5 years.

Roof viewed from: Surface

The roof was viewed from the surface of the roof at the time of the inspection.

Ventilation: Roof Vents


Continuous Ridge Vent, Screened Soffit Vents, Static Roof Vents

The ventilation for the attic space was observed to include the following vents listed above.

Wear and Deterioration: Composition - Some

Discolored

The composition roof surface was showing evidences of some deterioration of the roof surface as described above and shown below.

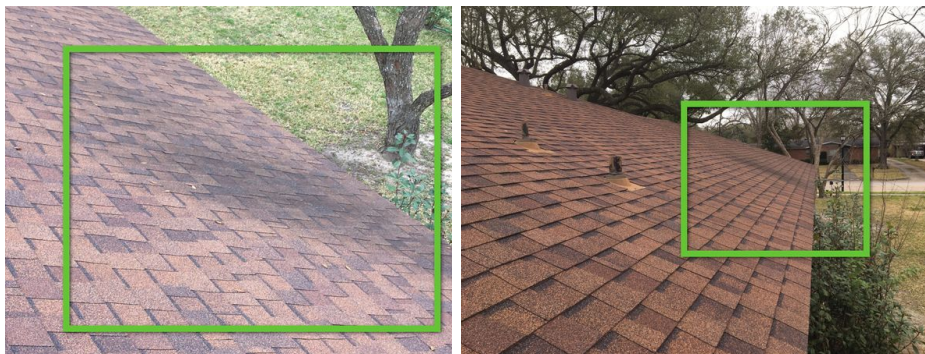

Roof Leaks: Attic stains appear to be from previous leaks

Near the rear static roof vent

Some stains were visible in the attic, but the stains appeared to be related to previous roof leaks. It is recommended that you check with the owner and/or a service company concerning the stains.



ROOF CONCLUSION: Serviceable Condition - Some Repairs needed

The roof is in generally serviceable condition at this time with some repairs needed for the item(s) shown below under Recommendations/Repair. Have a roofing contractor provide a cost estimate to make all necessary repairs to bring the roof into a completely serviceable condition.

Obtain Cost Estimate

Limitations

Roof viewed from

LIMITATIONS OF ROOF INSPECTION

It is pointed out that our roof inspection is limited to viewing the surface of the roof from only those areas determined by the inspector to be safely accessible at the time and conditions of the inspection. If the height of the roof, steepness of the pitch, or surface conditions due to wear or weather are such that the inspector determines that he cannot safely access some or all of the roof, then we will use a drone if possible (subject to weather limitations and/or No Fly Zones) to take photos of the surface of the roof. The roof will also be viewed from the underside of the roof, from the readily accessible attic access decking. For areas of the attic/roof that are not readily accessible from the safety of secure access decking, the inspector is not required to walk off the decking across the attic framing members to access all portions of the attic. Therefore, it is pointed out that there may be deficient roof conditions present in the attic that are not visible on the day of the inspection due to the limitations imposed on the inspector. This emphasizes the need and responsibility of the client to do further investigations with a roofing contractor to determine all deficiencies with the roof before any option period ends.

Recommendations/repair

5.5.1 Roof Details

ROOF: MISCELLANEOUS

Debris on Roof, Tree limbs on Roof

We observed some miscellaneous items related to the surface of the roof, including the items listed above. Have a roofing contractor provide a cost estimate to make any needed repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



5.5.2 Roof Details

FLASHING/COUNTER FLASHING

Flashing not secure at roof jack, Flashing not secure at the chimney, Lifting flashing- static roof vent

We observed one or more conditions with the roof flashing as pointed out above. Have a roofing contractor provide a cost estimate to make all needed repairs

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



5.5.3 Roof Details

ROOF JACKS

Neoprene - Inverted at vent pipe

The roof jacks at the plumbing vent pipes were observed to have the conditions as described above. Further investigation with a roofing contractor is recommended to make all needed repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.




5.5.4 Roof Details

NO CRICKET

No cricket has been installed behind the chimney to divert the roof runoff around the chimney. Since the chimney is more than 30 inches wide, it is recommended that a cricket be installed.

Obtain Cost Estimate

903.2.2

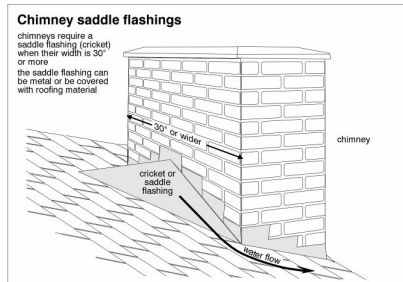

Recommendation

Contact a qualified professional.

5.6.1 Roof Leaks

OBSERVED ON CEILING

AROUND THE CHIMNEY, AND NEAR THE WATER HEATER FLUE PIPE.

After observing the interior of the structure, evidences of roof leaks were visible, where the ceiling was water stained. It is recommended that a roofing contractor be contacted to find the source of the leaks, and to make any needed repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



5.6.2 Roof Leaks

ATTIC ROOF DECKING AND/OR FRAMING MEMBERS

After observing the interior of the structure, evidences of roof leaks were visible in the attic, where the roof decking and/or roof framing members were water stained. It is recommended that a roofing contractor be contacted to find the source of the leaks, and to make any needed repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



Chimney




Chimney



Sewer vent at the west side of the attic




Sewer vent at the west side of the attic

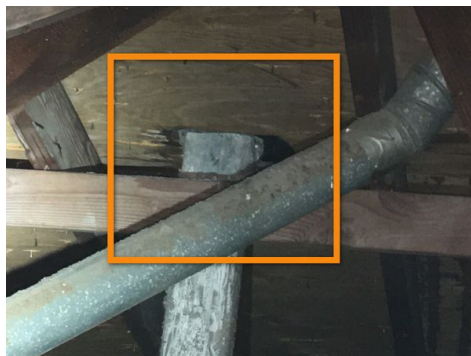

Vent at the west side of the attic



Vent at the west side of the attic

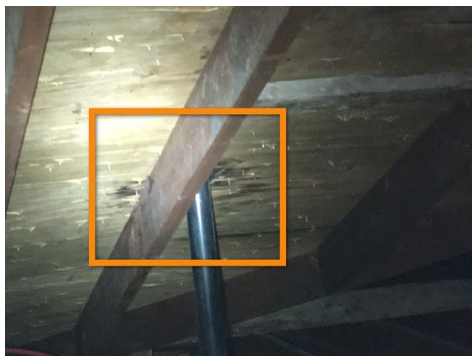

Sewer vent over the hallway bathroom



Sewer vent over the hallway bathroom



Furnace flue pipe



Furnace flue pipe

6: STRUCTURAL FRAMING

Information

Framing Description: OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Framing Description: One story house wood frame

The house was observed to be a one story wood frame structure that includes the standard major framing components, including wall framing and ceiling joists, and roof framing.



Attic Framing: Viewed from attic access walkway

The attic space was viewed only from the areas determined by the inspector to be safely accessible from the access walkway.

Attic Framing: Roof Framing Less than Current Standards - Functional

The roof framing in the attic was observed to be less than the current construction standards for roof framing. Typical differences between older structures and current code requirements can include purlins that are not the same size as the rafters; the vertical bracing for the purlins being spaced more than four feet apart; ridge beams not sized large enough for the miter cuts on the rafters, etc. However, the framing was adequate when the house/garage was constructed, and has performed satisfactorily these many years. Houses/garages that are built to previous code requirements are grandfathered, and are not required by the building code to be updated every time the code is revised.

Miscellaneous Framing: Previous Heat Damage - Minor

The framing members and roof decking in the attic were darkened near the furnace flue pipe. This appeared to be related to a previous heat damage from the furnace flue that was not venting properly. The degree of the damage was minor, and consisted of slight scorching of the outer layer of the wood. The cross sectional area of the framing

members has not been significantly reduced and, therefore, their load carrying capability has not been significantly affected. No repairs or replacement of materials is recommended at this time.



Recommendations/repair

6.6.1 Vertical Braces


REPAIR - BUCKLING

One of the vertical bracers was buckled and needs to be reinforced or replaced.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

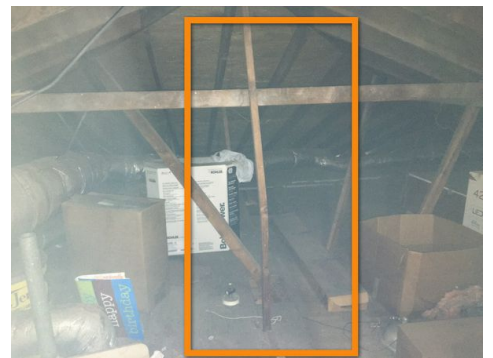

6.6.2 Vertical Braces

REPAIR - BRACE LOOSE

EAST SIDE OF THE ATTIC

Two of the vertical braces were loose and need to be secured.

Obtain cost estimate

Recommendation

Contact a qualified professional.



6.8.1 Hip Rafter

REPAIRS - SEPARATED

NORTH EAST CORNER OF THE ATTIC

The hip rafter was spliced and the joints have separated. It is recommended that the joint be reinforced/ supported.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



6.19.1 STRUCTURAL FRAMING CONCLUSION

REPAIRS NEEDED

The primary load carrying members of the structural framing that were accessible and viewed at the time of the inspection were generally functional with the exception of the item(s) listed above as in need of repair. Have a contractor confirm the scope of repairs needed, along with a cost estimate for all repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

7: WATER PENETRATION

Information

Water Penetration: OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Water Penetration: Moisture Meter - No High Readings

We checked around window and door openings and other locations with a moisture meter, and found no evidence of elevated moisture at the time of the inspection.

Recommendations/repair

7.1.1 Water Penetration

VULNERABILITY TO WATER PENETRATION

Deteriorated Sealants, Light Fixtures, Hose Bibb, Vent Caps, Brick Veneer, Piping, Grading, Lack of Gutters, Window sealants, Caulking Cracked/Missing, Sealants deteriorated/missing, Joints around the doors

A substantial vulnerability to water penetration was observed at penetrations/openings through the exterior building envelope, and it is recommended that all penetrations/openings be sealed against water penetration. Typical examples on a structure may include light fixtures, air conditioning refrigerant lines, water piping, gas piping, vent caps, windows, doors, expansion joints, etc. Below is a representative sample of locations and/or photographs showing some, but not necessarily all, locations where there is a vulnerability to water penetration. Have a contractor provide a cost estimate to seal all vulnerable areas on the exterior building envelope against water penetration.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.





7.1.2 Water Penetration

WATER STAINS/WATER DAMAGE

FOYER


Evidences of water penetration to the interior of the structure were observed, including water stains/water damaged materials. Further investigation is recommended with service companies to determine the source(s) of the water penetration along with any secondary damages, and also to provide a cost estimate for any needed repairs.

Water damage was observed on the wall near the front entry door. The source of the water penetration appeared to be related to a lack of proper sealant around the exterior joints of the door. Further investigation and repairs are recommended.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

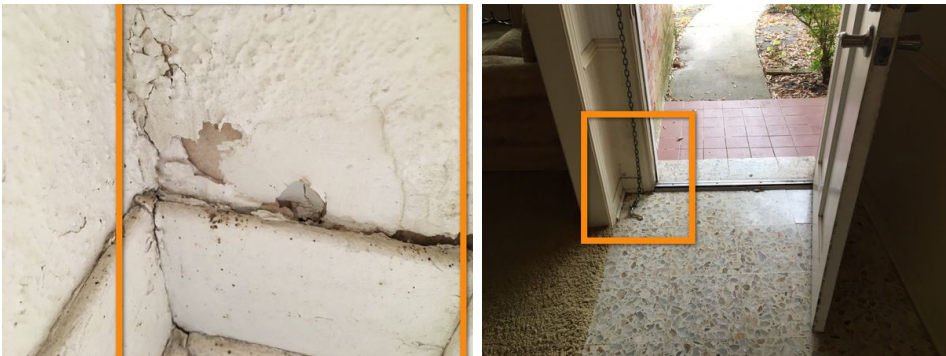

7.1.3 Water Penetration

WATER STAINS/WATER DAMAGE

GARAGE PATIO DOOR

Evidences of water penetration to the interior of the structure were observed, including water stains/water damaged materials. Further investigation is recommended with service companies to determine the source(s) of the water penetration along with any secondary damages, and also to provide a cost estimate for any needed repairs.

Water damage was observed on the wall and door trims near the front garage patio door. The source of the water penetration appeared to be related to a lack of proper sealant around the exterior joints of the door. Further investigation and repairs are recommended.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



8: FIREPLACE/CHIMNEY

Information

FIREPLACE OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Masonry fireplace: Location

Family Room



Masonry fireplace: Description-Masonry Fireplace

A damaged gas log lighter was present

The fireplace was a masonry fireplace that vented up a chimney through the roof.

Masonry fireplace: Burner control

Manual gas shut-off valve

The gas to ignite the burner in the fireplace was controlled as shown above.

Masonry fireplace: Chimney flue not visible for entire flue

It should be noted that the inside of the chimney flue is not visible due to the construction of the chimney, and was not inspected. The chimney flue extends from just above the fireplace opening inside the house to the top of the chimney. If this a concern to you, we recommend that a fireplace service company be contacted.

Obtain Cost Estimate

Masonry fireplace: Damper Functional

The damper was operationally checked at the time of the inspection, and opened and closed properly, with no repairs needed to the operation of the damper.

Recommendations/repair

8.2.1 Masonry fireplace

REPAIRS

Some repairs were observed to be needed to the fireplace. Further Investigation is recommended with a service company to provide a cost estimate for all needed repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

8.2.2 Masonry fireplace

FIREBRICKS LOOSE

Some of the firebricks were loose and starting to fall out, and need to be repaired. Have a fireplace service company provide a cost estimate to make the needed repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



8.2.3 Masonry fireplace

DAMPER - C CLAMP MISSING

The fireplace was equipped with a ceramic gas log. The smoke chamber and flue pipe were free from built-up soot, the damper was operational, and the firebox was properly sealed. While the draw of the chimney was not able to be checked, no evidences of poor draw were visible, and no repairs were needed to the fireplace. It is pointed out that the damper was not equipped with a spacer device to prevent the damper from closing completely. This device keeps the damper open slightly, even when it is in the closed position, to prevent combustion gases from building up in the living space should the gas log be operated when the damper is closed. It is recommended that the clamp be installed for safety purposes.

Obtain Cost Estimate

HEI file photo showing c-clamp in masonry fireplace



HEI file photo showing c-clamp in metal fireplace

Recommendation
Contact a qualified professional.

8.2.4 Masonry fireplace

SOOT - SOME - CLEAN

The firebox and/or flue pipe was observed to be coated with soot. This can be a fire hazard, and it is recommended that the soot be removed before using the fireplace again. Contact a fireplace service company to remove the soot.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

8.2.5 Masonry fireplace

WEATHER CAP - MISSING

The top of the chimney flue did not have a spark arrester/weather cap installed in the flue to prevent water penetration down the chimney and bird entry into the chimney. Evidences of water penetration were visible at the firebox, where the firebrick was stained.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



8.2.6 Masonry fireplace


GAS VALVE - KEY MISSING

The key for the gas log lighter valve was missing, and should be replaced. The gas could not be turned on at the time of the inspection, and was not operationally checked.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

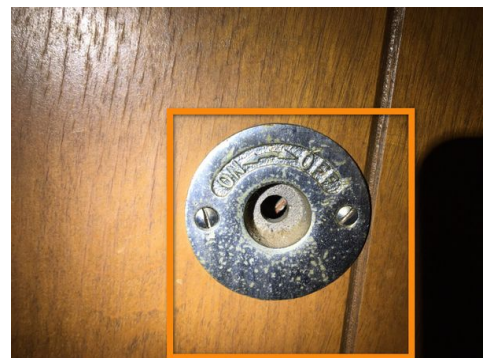

8.2.7 Masonry fireplace

DAMAGED BURNER

The burner or gas log lighter was damaged and needs to be replaced.

Recommendation

Contact a qualified professional.



9: ATTIC

Information

OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Ladder: Original ladder - Not rated

The access ladder into the attic appeared to be the original installation ladder, and the ladder was not labeled to indicate the rated capacity of the ladder. The ladder does not meet current code requirements for ladders into attics. Consideration should be given to replacing the ladder with a ladder that meets current code requirements.



Viewed from attic decking

The attic was entered and was viewed from the access decking provided in the attic. It is pointed out that the inspector is not required to access areas of the attic without the safety of adequate walkway decking.

Service decking/platform decking: Adequate decking

The attic had adequate service decking to the equipment, with a walkway that was a minimum of 24 inches wide. In addition, the attic had adequate platform decking at the equipment, with a working platform that was a minimum of 30 inches wide.

Insulation: Blown-in 10"-12"

The insulation in the attic was average for the age of the house. The blown-in insulation appeared to be approximately 10-12" thick, which would be approximately an R30 energy rating. It is pointed out that the insulation requirements according to the latest standard for new houses in this area is an R38 energy rating.

Table 1102.1.1



Limitations

Attic Viewed From

ATTIC NOT ALL ACCESSIBLE

The entire attic space was not accessible from the decking provided, and if remote areas were viewed at all, it would be from the safety of the access decking. Note that it is our policy to not walk off the access decking nor climb over equipment to walk across framing members due to safety hazards and the potential for damaging equipment/ductwork and/or slipping off the framing members and falling through the ceiling. It is pointed out that there may be deficiencies in the attic and/or for the roof that were not viewed at the time of the inspection due to a lack of access walkway decking.

Recommendations/repair

9.1.1 Ladder

LADDER ATTACHMENT IMPROPER

Missing nuts/bolts, Loose nuts/ bolts, Less than sixteen 16d nails or 1/4 X 3" lag screws

The stair assembly was not properly installed or secured to the framing members, and repair is needed for safety purposes. The condition(s) can be a safety hazard, and repair is needed, as an improperly installed stair assembly can possibly collapse.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



9.1.2 Ladder


LADDER NOT CLOSING PROPERLY

The pull down access ladder does not close properly, and can allow unconditioned air from the attic into the living space. The assembly needs to be adjusted to fit the opening properly.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

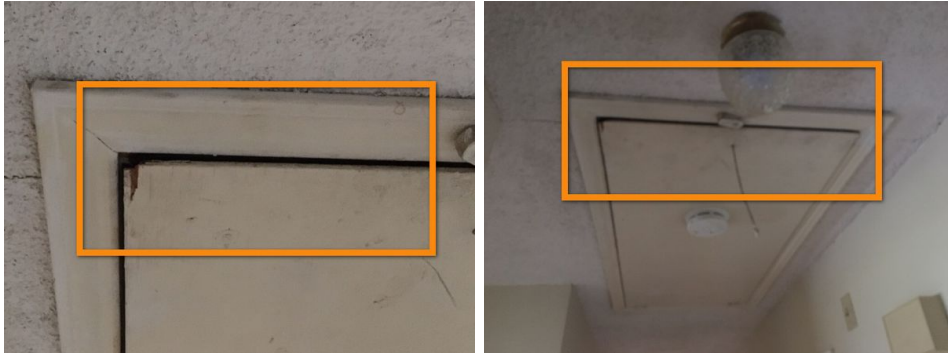

9.2.1 Service decking/platform decking

DECKING FLIMSY

STORAGE DECKING

The attic decking was flimsy and deflected easily when walked upon. It is recommended that thicker decking be added for safety reasons.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

9.7.1 Miscellaneous

RODENTS, BIRDS, BEES, OR OTHER PESTS

OVER THE FURNACE

Rodent droppings

We observed evidence of rodent infestation in the attic. Although HEI disclaims inspections for rodents and other pests, it is recommended that further investigation be done to find the source of entry of the pests into the attic, and to make all needed repairs to remove the pests, clean and sanitize the attic from any fecal/urine material and nesting materials. It is recommended that you contact a pest control company concerning this condition.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



10: EXTERIOR ITEMS

Information

OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Flatwork Concrete/Patios/Walkways: Flatwork Concrete OK

Patio

The flatwork concrete listed above was in generally good condition at the time of the inspection with no significant repairs needed. Note that there may be some small cracks in the concrete, but in the opinion of the inspector, the concrete is still functional.



Flatwork Concrete/Patios/Walkways: Cracks Driveway

Cracks and some separations were observed in the driveway concrete. In our opinion, the driveway is still in serviceable condition at this time.



Recommendations/repair

10.2.1 Gutters and Downspouts

NONE

No gutters have been installed on this house, and it is recommended that they be installed to help control differential foundation movement and prevent wood rot and water entry.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

10.3.1 Gates and Fences

WOOD GATE

WEST SIDE OF THE HOUSE

Non latching

The wood gate was in need of some repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

10.3.2 Gates and Fences

WOOD FENCE


Leaning, Starting to rot, Damaged boards, Loose boards

The wood fence was in need of some repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

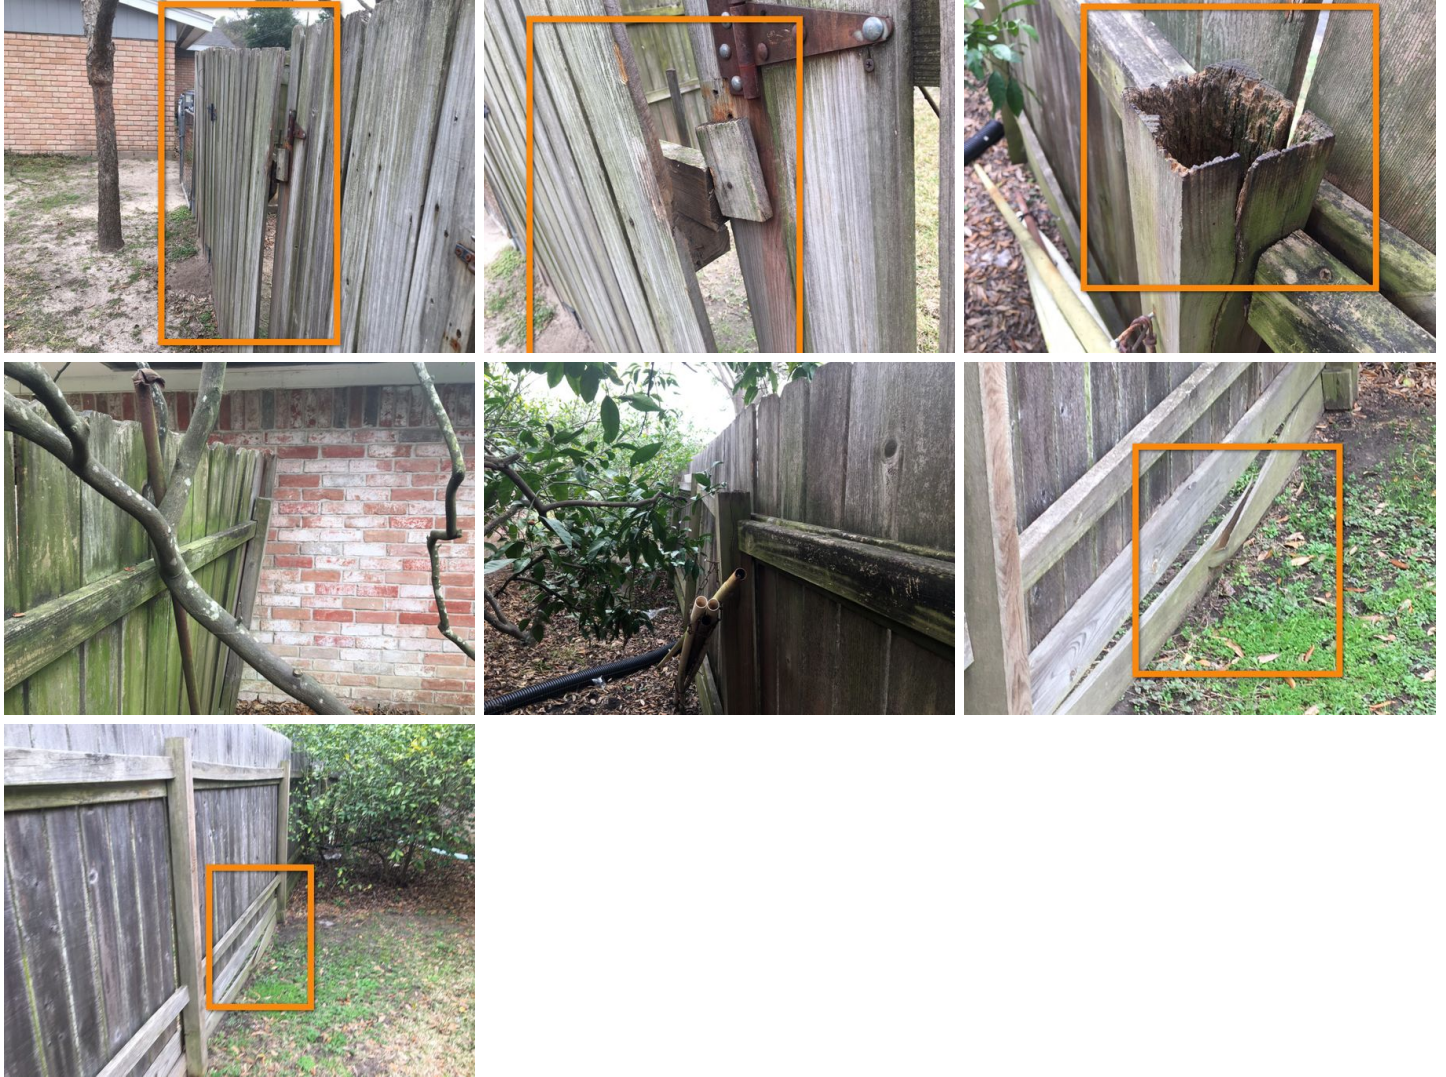

10.4.1 Wood Rot

WOOD ROT




Door trim, Columns, Wood decking boards, Door Trim at Garage, Fascia

Wood rot was observed and needs to be replaced. Have a contractor provide a cost estimate to determine the entire scope of the wood rot, and provide a cost estimate to replace all rotted wood in the house.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

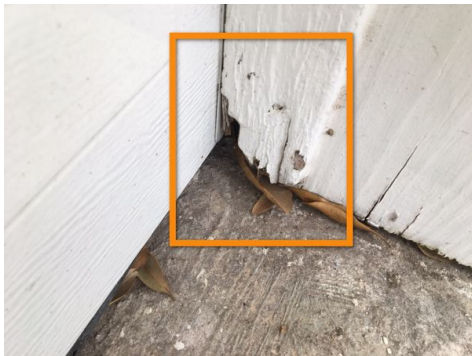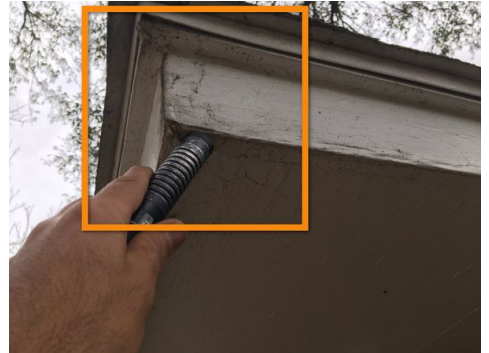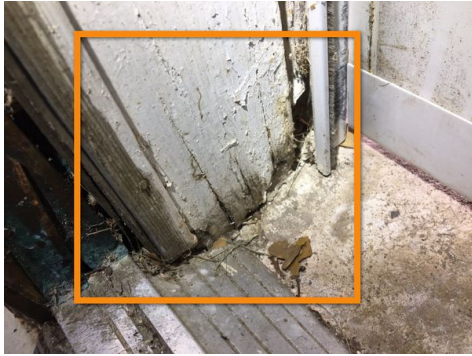

10.9.1 Miscellaneous Exteriors

FOLIAGE TOUCHING HOUSE

Trees limbs and/or bush foliage were touching the house and the limbs need to be trimmed.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

10.9.2 Miscellaneous Exteriors

WOOD DECKING

The decking of the back porch have loose boards, rotted boards and the paint was deteriorated. The wood decking was in need of repairs.

Recommendation

Contact a qualified professional.



11: INTERIOR ITEMS

Information

OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Smoke alarms: Installed at some locations

Smoke alarms were observed to be installed at some of the required locations in the house as set forth in the 2012 International Residential Code. The current code gives the Locations required, the Power Source, and the Interconnectivity requirements.

R314.3 Location.

Smoke alarms shall be installed in the following locations:

1. In each sleeping room.
2. Outside each separate sleeping area in the immediate vicinity of the bedrooms.
3. On each additional story of the dwelling, including basements and habitable attics but not including crawl spaces and uninhabitable attics. In dwellings or dwelling units with split levels and without an intervening door between the adjacent levels, a smoke alarm installed on the upper level shall suffice for the adjacent lower level provided that the lower level is less than one full story below the upper level.

R314.4 Power source.

Smoke alarms shall receive their primary power from the building wiring when such wiring is served from a commercial source, and when primary power is interrupted, shall receive power from a battery. Wiring shall be permanent and without a disconnecting switch other than those required for overcurrent protection.

R314.5 Interconnection.

Where more than one smoke alarm is required to be installed within an individual dwelling unit in accordance with Section R314.3, the alarm devices shall be interconnected in such a manner that the actuation of one alarm will activate all of the alarms in the individual unit. Physical interconnection of smoke alarms shall not be required where listed wireless alarms are installed and all alarms sound upon activation of one alarm.

Limitations

Smoke alarms

SMOKE ALARMS NOT OPERATIONALLY CHECKED

We could not determine if the smoke alarms are connected to a security alarm system as is common practice, therefore, to avoid possibly triggering a security alarm we did not operationally check each device, nor did we check the interconnectivity of the alarms. For safety purposes, it is recommended that smoke detectors and carbon monoxide detectors be replaced every ten years.

Recommendations/repair

11.1.1 Doors

NON-LATCHING

SOUTH BEDROOM CLOSET, REAR SCREEN DOOR, AND THE MASTER BEDROOM.

We observed non-latching doors that were in need of adjustment to the striker plate on the door frame.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

11.1.2 Doors

STICKING DOORS

SOUTH BEDROOM

Doors were observed that were sticking and are in need of adjustment. Contact a service company to make the needed repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

11.1.3 Doors

GARAGE DOOR NO SELF-CLOSING HINGES

The door to the attached garage did not have self-closing hinges, and the hinges need to be installed.

Obtain Cost Estimate

R302.5.1

Recommendation

Contact a qualified professional.

11.1.4 Doors

SCREEN DOOR - TORN

The screen door(s) was torn at the patio door. Contact a service company to make the needed repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

11.2.1 Windows

PLASTIC SEALANT STRIPS LOOSE/DAMAGED/MISSING

DINING ROOM

The plastic sealant strips were loose/missing/damaged at the windows.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

11.2.2 Windows

ROCK CHIP/HOLE

DINING ROOM

A window with a small hole and chip in the window from what appears to be a rock was observed.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

11.2.3 Windows

LOOSE/DAMAGED SPRING

LIVING ROOM

Windows with loose/damaged springs were observed, and the spring(s) need to be repaired.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



11.2.4 Windows

DAMAGED LOCK

LIVING ROOM

We observed windows with a damaged lock that needs to be replaced.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

11.2.5 Windows

WINDOW SCREENS DAMAGED

FAMILY ROOM AND THE SOUTH BEDROOM.

Window screens were observed to be damaged.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

11.2.6 Windows

DAMAGED WINDOW

The top pane of the dining room window was bent. It is recommended to replace the window.

Recommendation

Contact a qualified professional.

11.3.1 Floor coverings

FLOOR TILES CRACKED

KITCHEN

Floor tiles were cracked and it is recommended they be replaced.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



11.3.2 Floor coverings

TILES GROUT CRACKED/MISSING

KITCHEN BACKSPLASH

The grout was cracked/missing and needs to be repaired.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



11.3.3 Floor coverings

WOOD FLOOR DISCOLORED

The wood floor where the chair for the computer desk was located was observed to be a slightly different color than the surrounding. Normally, this is considered a cosmetic item (wear and tear), but you may want to consult a wood floor specialist for further information.

Recommendation

Contact a qualified professional.



11.4.1 Sheetrock

DAMAGED

GARAGE

The sheetrock was damaged and needs to be repaired.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



11.4.2 Sheetrock

DAMAGED BY DOORKNOB

NORTH BEDROOM

The sheetrock was damaged from the doorknob, and needs to be repaired behind the door.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

11.6.1 Carbon monoxide detector

MISSING

The house does not meet the current code concerning carbon monoxide alarms which can be a safety issue. If bringing the house up to current code standards is desired, the section below from the 2012 International Residential Code is the current requirements for carbon monoxide alarms in a home.

Obtain Cost Estimate**R315.1 Carbon monoxide alarms.**

For new construction, an approved carbon monoxide alarm shall be installed outside of each separate sleeping area in the immediate vicinity of the bedrooms in dwelling units within which fuel-fired appliances are installed and in dwelling units that have attached garages.

Recommendation

Contact a qualified professional.

11.9.1 Miscellaneous interiors

WATER DAMAGE - KITCHEN CABINET

The bottom of the cabinet was rotted and water damaged from a leak at the dishwasher and the damaged materials need to be replaced along with all the secondary damages. Further investigation and repairs are recommended.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



11.9.2 Miscellaneous interiors

WATER DAMAGE - MASTER SHOWER

The wood floors on the master closet and the master bedroom were water damaged apparently from a shower leak. Also, water damage was observed on the wall near the master shower. The damaged materials need to be replaced along with all the secondary damages. Further investigation and repairs are recommended with a plumber and a contractor.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.



11.9.3 Miscellaneous interiors

MICROBIAL GROWTH


FRONT BEDROOM CLOSET AND THE GARAGE

A microbial growth was observed, and further investigation is recommended with a service company to determine the cause of the growth, and to provide a cost estimate for any needed repairs.

Obtain Cost Estimate

Recommendation

Contact a qualified professional.

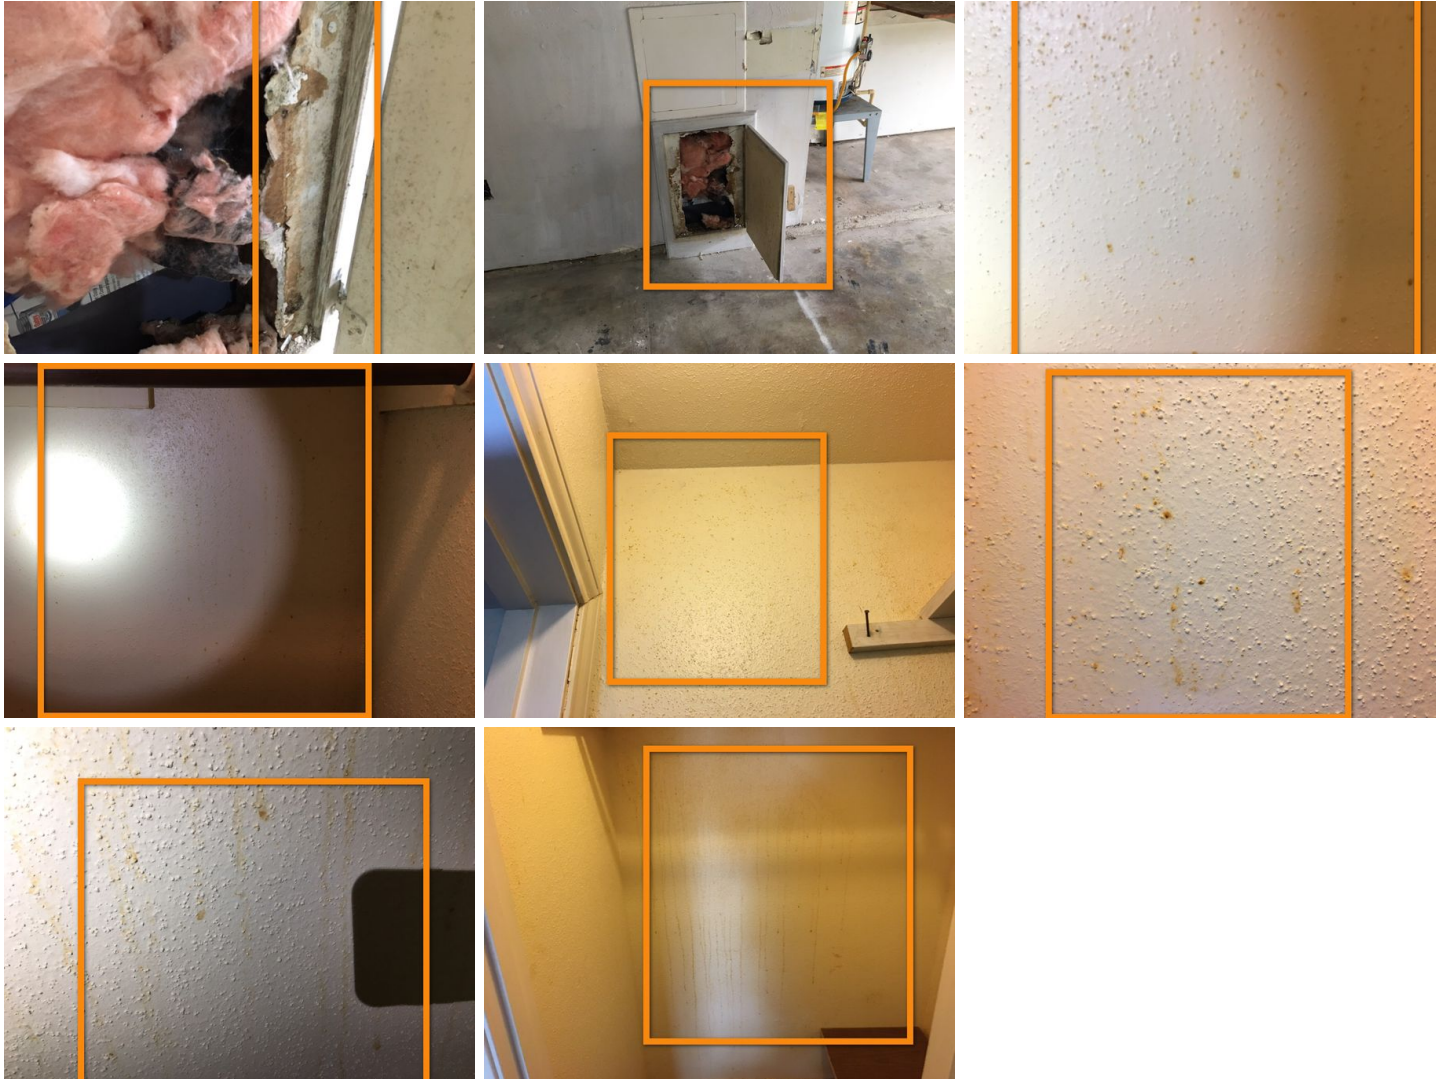

11.9.4 Miscellaneous interiors

WATER STAINS- UNKNOWN

Water stains were visible on the utility wall near the cabinet. The source of the stains was not determined at the time of the inspection. However, the stains start from the cabinet and they appeared to be related to some liquid spill on the cabinet. Further investigation and repairs are recommended.

Recommendation

Contact a qualified professional.



11.9.5 Miscellaneous interiors

WALL PAPER

KITCHEN

Some of the wall paper was loose and damaged.

Recommendation

Contact a qualified professional.



12: CLOSE

Information

CLOSE

Opinions and comments stated in this report are based on the apparent performance of the items included within the scope of the inspection, at the time of the inspection. Performance standards are based on the knowledge gained through the experience and professional studies of the inspector. There is no warranty or guarantee, either expressed or implied, regarding the habitability, future performance, life, merchantability, and/or need for repair of any item inspected. It is suggested that it would be a prudent thing to purchase a Home Warranty Policy to protect the appliances and equipment against unforeseen breakdowns during the first year and for preexisting conditions. It is recommended that you research the various options available and protect yourself with a policy. Check with your agent for details and please read our comments concerning Home Warranty policies on page 2 of this report.

Items identified as being deficient and in need of repair along with our Recommendations are provided in the above report. Many, but not all, recommendations are highlighted in bold red text. It is our intention, and your responsibility, that you follow up on these deficiencies and recommendations as part of your due diligence by contacting the appropriate service contractor for **Further Investigation** and to **Obtain a cost estimate**. It is pointed out that other related and/or underlying conditions may be present, and which may not be apparent without further investigation.

We also recommend that you review the Service Agreement at the end of this report regarding any complaint concerning the inspection services provided pursuant to the service agreement, As agreed to, Client must notify HEI in writing of such complaint within ten (10) business days of the date of Client's actual discovery and thereafter allow a prompt reinspection of the item relating to the claimed condition. Client further agrees that client and he/she/it's agents, employees or independent contractors **will make no alterations, repairs or replacements to the item complained about prior to a reinspection by HEI as agreed above.**

As an additional service, we recommend using a new tool we have on our website that can quickly turn your inspection report into an easy-to-read estimate of repairs for a nominal fee. These pricing reports from a third party company called **RepairPricer** not only make the inspection report easy to understand in terms of dollars and cents, but they are also useful negotiation tools. Just visit the page below on our website and upload your report into **RepairPricer**. If you have any questions when you receive your report, you can contact them at info@repairpricer.com

<http://www.heddermanengineering.com/repair-cost-estimates>

Thank you again for asking HEDDERMAN ENGINEERING, INC. to perform this inspection for you. If you have any questions after reviewing this report, please feel free to call the office. It is emphasized that the executed Service Agreement contract, which has been included at the end of this report, contains a provision under "Dispute Resolution" for you to contact HEI to resolve any disputes.

At your service,

Tim Hedderman

Registered Professional Engineer #51501

Texas Firm Number: 7942



13: RECEIPT PAGE

Information



HEDDERMAN ENGINEERING, INC.

www.heddermanengineering.com Office 281-355-9911 Fax 281-355-9903 office@heddermanengineering.com

02/08/2021

TO: David Mladenka & c/o Sandy Mladenka

REF: Inspection of the property at 16230 Jersey Dr, Jersey Village TX 77040.

Total cost of inspection: \$625.00

Total Paid: \$625.00

Total Due: - 0 -

14: SERVICE AGREEMENT

Information

For your records, following is the Service Agreement that you executed for this inspection.

HEDDERMAN ENGINEERING, INC.

Office: 281-355-9911 Fax: 281-355-9903

office@heddermanengineering.com www.heddermanengineering.com

Real Estate Inspection Service Agreement

NOTICE: THIS AGREEMENT IS INTENDED TO BE A LEGALLY BINDING CONTRACT - PLEASE READ IT CAREFULLY

NAME OF CLIENT(S): David Mladenka & c/o Sandy Mladenka

DATE OF INSPECTION: 02/08/2021

PROPERTY ADDRESS: 16230 Jersey Dr, Jersey Village TX 77040

Purpose of inspection

The purpose of the inspection is to view selected accessible components and/or systems, and to inform you, our client, of our observations and professional opinions from a NON-INVASIVE VISUAL SURVEY on whether or not those selected components and/or systems appear to be functioning on the day of the inspection, or appear to be in need of repair. Although this report may include observations of some building code violations, total compliance with structural, mechanical, plumbing, electrical codes, specifications, and/or legal requirements is specifically excluded. HEI does not perform Code inspections. Since building codes change every few years, our inspections are not done with the intention of bringing every item in the house into compliance with current code requirements. Rather, the standard of our inspections is a **PERFORMANCE STANDARD** to determine if the items inspected in the opinion of HEI appear to be functioning at the time of the inspection, or appear to be in need of repair. It is pointed out that other engineers/inspectors may have different opinions to those given in this report. It is also not our purpose to verify the adequacy and/or design of any component of the house.

It is also not within the purpose and/or scope of this report to determine the insurability, habitability, merchantability, future performance, suitability of use, economic life span, or deferred maintenance issues, and/or issues unnamed in this report. This report is not an insurance policy, neither is it an express or implied warranty or guarantee as to future life and/or continued performance of the items inspected. Our inspection and report are intended to express HEI's perceived impression of the apparent performance of the inspected components and systems viewed on the date of the inspection. HEI's intent is to reduce your risk associated with this transaction, however we cannot eliminate all risk, nor assume your risk. Any items pointed out as in need of repair or further investigation should be evaluated by a qualified repair specialist or service company who should provide estimated repair costs **PRIOR TO CLOSING ON THE PROPERTY**. By accepting this agreement, the Client understands that the services provided by HEI are the types of services described in the Professional Services Exemption of the Texas Deceptive Trade Practices-Consumer Protection Act ("DTPA") and agrees that no cause of action exists under the DTPA related to the services provided.

It is recommended that you obtain as much history as is available concerning this property. This historical information may include copies of any seller's disclosures, previous inspection or engineering reports, building drawings and/or specifications, bids to perform repair work on the property, receipts from repair work that has been performed, reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should attempt to determine whether repairs, renovations, remodeling, additions or other such activities have taken place at this property.

Scope of inspection

The scope of the inspection includes limited, visual observations at the interior and exterior of the structure, the attic (if applicable) as viewed only from the areas determined by the inspector to be safely accessible, the underside of the house (if applicable) as viewed only from the crawlspace areas determined by the inspector to be safely accessible, and the roof as viewed from the ground and/or only from the locations on the roof **if the roof is determined by the inspector to be safely accessible**. Only those items **readily** accessible and visible at the time of the inspection will be viewed and included in this report. Any items causing visual obstruction, including, but not limited to, furniture, furnishings, floor or wall coverings, registers and grills on HVAC ductwork,, foliage, soil, appliances, stored items, insulation, etc., will not be moved or removed. Only those electrical outlets that are readily accessible will be operationally checked. Disassembly or removal of any portion of the structure, mechanical equipment, plumbing equipment, or electrical equipment is beyond the scope of this inspection.

The components of the property included, if applicable, in the scope of the inspection:

Structural:

Foundation, elevation survey including sketch of house and level readings, primary load-carrying framing members, roof surface, water penetration, grading and drainage, fireplace/chimney, and miscellaneous items related to the house.

Mechanical:

Air conditioning and heating systems, water heater, built-in appliances, and garage door opener.

Plumbing:

Water and gas supply lines that are visible, sinks, toilets, tubs, showers, visible drain lines, and vents.

Electrical:

Service entrance conductors, electric meter, distribution panel, visible wiring, light fixtures, switches, and accessible receptacle outlets.

Lawn Sprinkler:

Control panel, solenoid valves, backflow prevention device, visible piping, and sprayer heads.

Pool:

Basin, deck, waterline tiles, pumps, filters, piping, heater, timer, and electrical.

The following items, even if present in the subject property, are not inspected and do not constitute any part of the inspection services to be performed hereunder unless a specific notation is made on this report stating its condition:

Tainted and Corrosive drywall (Chinese Drywall), Clock Timers, Landscape Lighting, Sump Pumps, Wood Destroying Insects/Pests, Antennas, Environmental Hazards, Laundry Equipment, Water Filters, Geological faults/subsidence, Automatic Oven Cleaners, Fire Sprinklers System, Mold/Microbial, Water Wells, Mosquito Misting Systems, Buried/Concealed Plumbing, Fire/Smoke Alarm Systems, Septic Systems, Indoor Air Quality, Asbestos, Low Voltage and data Systems, Lights on Photo-cell/timers, Carbon Monoxide Alarms, and Water Softeners/Water Treatment systems/Reverse Osmosis systems with all related piping.

Reinspections:

HEI typically does not perform reinspections on the property. However, if we agree to return to the property, it is with the understanding that we are not certifying the adequacy of any repair work that has been done, and there will be an additional fee charged. This is also true for conditions that are beyond the control of the inspector and hinder the inspector during the inspection, such as inclement weather, lack of adequate access to attics, crawlspaces, or other areas, utilities that are off, non-functional equipment, etc. If a return trip to the house is requested to finish items that were not able to completed at the time of the originally scheduled inspection, then an additional fee will be charged.

Limitations of Inspection

A visual inspection method will generally produce a competent first impression assessment of the apparent performance of the structural, mechanical, plumbing, and electrical components, provided repairs have not been performed which would cover distress patterns normally produced by problems. Because the inspection procedure is visual only, and is not intended to be diagnostic and/or technically exhaustive, an inherent residual risk remains that undiscovered problems exist and/or future problems will develop.

This report is provided solely for the use of the person to whom this report is addressed, and is in no way intended or authorized to be used by a third party, who may have different requirements, and to whom we have not contracted with to perform an inspection. If a third party chooses to use this inspection report, they do so without HEI's permission or authorization, and they do so at their own risk.

Dispute Resolution

In the event of a complaint concerning the inspection services provided pursuant to this agreement, Client must notify HEI in writing of such complaint within ten (10) business days of the date of Client's actual discovery and thereafter allow a prompt re-inspection of the item relating to the claimed condition. Client further agrees that client and he/she/it's agents, employees or independent contractors **will make no alterations, repairs or replacements to the item complained about prior to a reinspection by HEI as agreed above**. You agree that failure to comply with

this procedure shall result in your express release of all claims Client may have against HEI, known and unknown, related to the item complained about and any related alleged act or omission by HEI.

LIMITATION OF LIABILITY: In any event the inspector fails to fulll the obligations under this agreement, CLIENTS EXCLUSIVE REMEDY AT LAW OR IN EQUITY AGAINST INSPECTOR IS LIMITED TO A MAXIMUM RECOVERY OF DAMAGES EQUAL TO THE INSPECTION FEE PAID HEREIN. CLIENT VOLUNTARILY AGREES TO WAIVE THEIR RIGHTS UNDER THE DECEPTIVE TRADE PRACTICES-CONSUMER PROTECTION ACT, SECTION 17.41 ET SEQ. BUSINESS & COMMERCE CODE. This limitation of liability applies to anyone, including client, who is damaged or has to pay expenses of any kind, including attorney fees and costs. Client assumes the risk of losses greater than the refund of the fee paid herein. Client acknowledges that this limitation of liability is reasonable in view of the relatively small fee that inspector charges for making the inspections when compared with the potential of exposure that inspector might otherwise incur in the absence of such limitation of liability, and that a much higher fee would be charged if the inspector were subject to greater liability.

Statute of Limitations

The parties agree that no claim, demand, or action, whether sounding in contract or in tort, may be brought to recover damages against HEI, or its officers, agents, or employees MORE THAN TWO YEARS AND ONE DAY AFTER THE DATE OF THE INSPECTION OR THE DATE ANY PURPORTED CAUSE OF ACTION ARISING OUT OF THE INSPECTION ACCRUES. TIME IS EXPRESSLY OF THE ESSENCE HEREIN. Client understands that this time period may be shorter that otherwise provided by law.

Acceptance of Report

By signing I confirm that I have read, understood, and agree to the above pre-inspection service agreement, and that I agree to be bound by these terms and conditions. In the absence of Client signing this service agreement prior to or at the time of the inspection, then acceptance of the report and/or payment for the inspection shall constitute agreement with all of the terms of this agreement. The report to be prepared by HEI shall be considered the final and exclusive findings of HEI regarding the inspection of the property which is the subject of this agreement. Client shall not rely on any oral statements made by HEI or its representatives prior to issuance of the printed report.

NOTE: IF THE INSPECTION IS CANCELLED LESS THAN ONE FULL BUSINESS DAY BEFORE THE SCHEDULED TIME, INCLUDING SATURDAYS, SUNDAYS, AND/OR HOLIDAYS, THE CLIENT WILL BE CHARGED ½ OF THE ORIGINAL INSPECTION FEE AND AGREES TO PAY SUCH PENALTY FEE. IF THE INSPECTION IS CANCELLED LESS THAN ONE HOUR BEFORE THE SCHEDULED TIME OF THE INSPECTION, THE CLIENT WILL BE CHARGED THE FULL INSPECTION FEE.

I HAVE READ AND ACCEPT THIS AGREEMENT