



**CHAMPIONS ENGINEERING**

Engineering Designs & Inspections  
281.537.5522  
9595 Six Pines Dr, Suite 8210  
The Woodlands, Tx 77380

May 14, 2021

Wedgewood Inc.  
4403 Sarong Drive  
Houston, Texas 77096

RE: Foundation Inspection  
Job #19679

Dear Mr. Conar Cabucio:

Enclosed is the report of the foundation inspection performed at 4403 Sarong Drive in Houston, Texas. This inspection was conducted for you on May 13, 2021, at the agreed-upon fee.

We appreciate the opportunity to assist you in performing the inspection on your potential purchase. If we can be of any further service, please let us know.

Respectively Submitted,

A handwritten signature in red ink that reads "Jeff Burkman". The signature is written in a cursive, flowing style.

Jeff Burkman, P.E. 63505  
Champions Engineering & Inspections  
Registered Engineering Firm - 5832

## INTRODUCTION

The purpose of this report is to document the results of a visual inspection that was conducted on the residential building described below and to document our agreement regarding the services provided to you. The information contained in this report takes precedence over any information or understandings that may have occurred during verbal communications.

This inspection was conducted for you, as our Client, to provide you with opinions regarding the performance of the primary load-bearing structural components of the foundation and to assess if these components are performing the function for which they were intended or need immediate repair. No assessments were made for driveways, patios, sidewalks, fences, gutters, insulation, carpeting, toxic materials, paint, outbuildings, cosmetic damage, etc. An investigation was not conducted to determine the existence of geological faults relative to the structure inspected.

This inspection was limited, in accordance with our agreements, to a visual examination of those portions of the structure that were accessible. Thus, hidden items such as damaged wood inside of walls, leak paths through ceilings and walls, interior slab cracks, etc., that are not amenable to visual inspection cannot be reported. Champions Engineering assumes no responsibility should such defects be discovered in the future.

Compliance with any government or industry code or standard or with any legal requirements is not within the scope of this inspection. By law, inspections to determine the presence of and the extent of the damage created by wood infesting organisms, which includes all rotted wood, can only be performed by individuals who are so licensed by the state for that purpose and will not, therefore, be considered to be part of this inspection.

In the conduct of this work, Champions Engineering has acted as an engineering consultant to provide visual observations and opinions with regard to the visible condition of the load-bearing structure of this building. Recognizing that latent defects could exist which inherently may not be detected during an inspection of this type, Champions Engineering does not represent that the observations described herein, and their analysis thereof, represent every structural condition that may exist. You, as the Client, should not conclude that all of the repairs that may be needed are described herein. Any recommendations for repair that may be contained in this report should be completed, since such repairs may result in the discovery of additional defects that may not have been discovered during the original inspection.

To protect the foundation, it is advised to maintain a consistent moisture level at all points around the perimeter of the foundation, especially during dry weather periods.

Champions Engineering does not assume responsibility whatsoever for any action that may or may not be done as the result of the information provided during this inspection. The involvement of Champions Engineering in any activities associated with this inspection will terminate at the time this report has been submitted. Finally, this report was written to satisfy the specific objectives of you, as the Client. Neither the author of this report nor Champions Engineering authorizes or assumes any responsibility whatsoever for the use of this report by any third person, except the Veterans Administration (V.A.) and/or the Federal Housing Administration (F.H.A.) and/or mortgage company.

**DESCRIPTION:**

The residence inspected was located at 4403 Sarong Drive in Houston, Texas.

This was a foundation inspection, based on physical observation. The following are the results obtained from the visual structural evaluation. This residence is a sixty-four-year, one-story, single-family wood frame dwelling with a brick veneer. The structure has what appears to be a poured concrete rebar-reinforced slab foundation.

**FOUNDATION INSPECTION:**

The foundation inspection includes a physical non-destructive observation of the existing foundation condition and functionality.

This report intends to inform you of the foundation's current status, i.e. whether it is performing as intended or in need of repair. The scope of this evaluation is limited to structural components that are readily observable and does not include damage in inaccessible areas, such as between walls. It also does not predict potential performance after the inspection or damage detected after inaccessible areas are uncovered.

The Greater Houston and surrounding areas, soils are active (expansive and/or compressible) type clay soils and structures with slabs on grade have experienced significant differential movement or settlement. More often than not, this movement has resulted in little if any serious structural damage. However, some unsightly sheetrock and brick veneer cracks do appear along with annoying sticky doors and cabinets. It should be noted that more than 70% of the houses in Houston have some differential movement including minor cracks in the slab.

FYI: Previous foundation repair per breaks at front porch.

**There were areas of construction debris that could not be measured. Doors and frames were removed. Measured from headers as well as possible and sills were measured with a bubble level.**

The floor elevations were measured using an electronic manometer level. The locations of the measurements are noted on the floor plan attached.

The observable framing rafters in the attic were construction tight at the ridge board.

**The foundation inspection did reveal the existence of a non-functioning slab, as evidenced by sloping floors, elevation differentials, door frame separation, sheetrock cracks everywhere, bubble levels and numerous brick veneer cracks.**

**Foundation movement was documented by measuring the surface of the floor coverings (compensating for covering as necessary). Movement whether it be settlement or heaving is documented with the elevations on the floor-plan attached. Spreadsheet calculations were performed utilizing the FPA (Foundation Performance Association's SC-13-1 Calculation Spreadsheet) resulting in a deflection ratio of L/209 which is excessive and will require foundation repair with piers. Tilt ratio of 0.90% which is just within the 1% tolerance. This spreadsheet and report were reviewed and this engineer has taken into consideration the recommendations and guidelines of the TBPE (Texas Board of Professional Engineers), ASCE (American Society of Civil Engineers), ACI (American Concrete Institute), and TRCC (Texas Residential Construction Commission).**

**FYI: Leaks in water and sewer lines will change the soil equilibrium under a**

foundation and can lead to differential movement/damage. Therefore, it is recommended to have a Hydro-Static plumbing test prior to foundation repairs and after completion of foundation repairs.

#### **RECOMMENDATION FOR PIERS:**

Approximately 22 exterior piers and 14 interior piers need to be installed with steel I-beams will need to be installed, as depicted on the attached diagram the reasonable placement is based on the opinions and engineering judgment of this engineer. The pier placements are approximate and can be altered as necessary to be placed exactly under interior bearing walls and under interior slab beams.

Areas of the slab that do not have structural beams and adjacent areas that are to be lifted should be piers with 3 foot I-Beams to spread the load and prevent sagging of the slab. The piers should be of either driven piles or a bell bottom design and described as follows:

- set on approximately 7-foot centers
- drilled to load-bearing soils between 16 and 22 feet
- shaft diameters 8 to 10 inches, using 3 #3 steel rebar tied in a triangle
- bell diameter 20 to 24 inches, 8" shaft diameter minimum
- pier top reinforced with 6 #3 rebar, minimum dimensions are 20" x 24" and 12" deep
- minimum 5 sx mix or at least 3000 psi compressive strength
- shim with 3000 psi compressive strength precast blocks and steel.

This report is to assist our client with soliciting bids for repairs from a qualified foundation contractor. Qualified contractor's arrangement of piers may vary due to their specific experience and the fact that they provide the warranty for their work. This house may not be able to be completely restored to original elevation, however, significant elevation differentials can be reduced and the slab stabilized.

Exposed sections of rebar (steel) were observed on the front grade beam of the house, the exposed steel needs to be cleaned, treated to prevent rusting and covered with an epoxy mortar or hydraulic cement to seal and prevent deterioration.

Note: To protect the integrity of the structure it is essential to maintain a consistent moisture level (not too wet or too dry in any areas) at all points around the perimeter of the foundation. Maintain proper drainage and grading around the perimeter of the structure (no water accumulation areas), and during dry weather periods, consistent watering of perimeter soils is essential even after piers are installed. Foundation movement/damage can occur when soils are too wet or too dry in areas on the perimeter.

#### **CERTIFICATION:**

I hereby certify that I performed the inspection of the residence located at 4403 Sarong Drive in Houston, Texas and that I have reported my opinions and findings based upon my observations. I further certify that the information contained in this report is based upon visible evidence and is a level "B" engineering inspection, as per the Texas Board of Professional Engineers, and that no attempt was made to investigate those latent

defects not readily detectable from visual observations. No responsibility is assumed for events that occur subsequent to this inspection and no warranty, either expressed or implied, is hereby made. The inspector and inspection company's liability is limited to twice the amount of the inspection fee paid, which also includes consequential damages. A second opinion is always a prudent and a recommended course of action. Foundation Inspection - 4403 Sarong Drive in Houston, Texas. May 13, 2021.



A handwritten signature in red ink that reads "Jeff Burkman". The signature is written in a cursive, flowing style.

Jeffrey C. Burkman P.E.  
Registered Professional Engineer – 63505  
Champions Engineering & Inspections  
Registered Engineering Firm – F-5832

# 4403 Sarong Drive




## CHAMPIONS ENGINEERING

Engineering Designs & Inspections

281.537.5522


9595 Six Pines Dr, Suite 8210

The Woodlands, Tx 77380

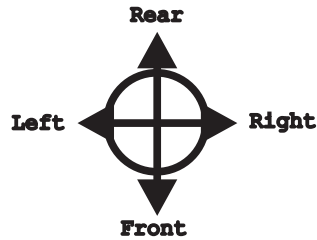

● Pier

⊙ Pier on I-Beam

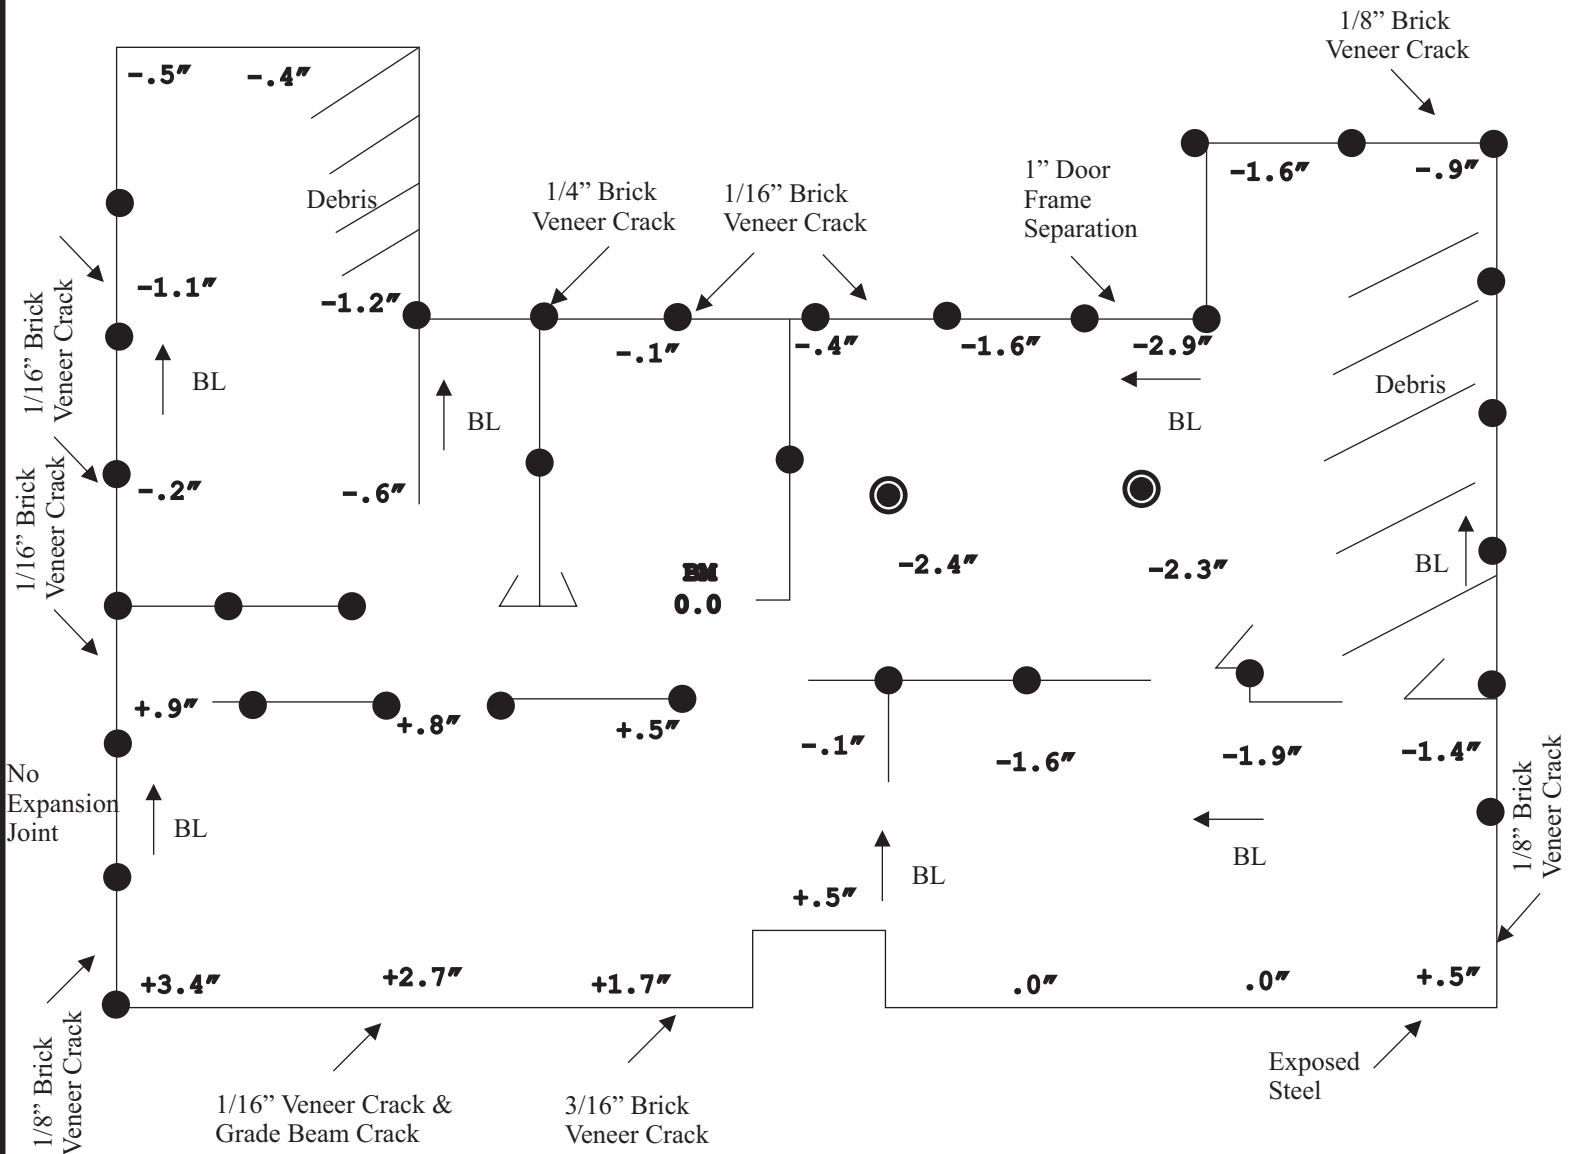

Elevation Differential 6.3"  
Instrument Repeatability Error 0.2"

BL-Bubble Levels

BM-Benchmark

THIS SKETCH IS TO BE USED ONLY AS A REFERENCE OF THE FLOOR PLAN REPRESENTING AREAS THAT WERE MEASURED. APPROXIMATE SCALE 1" = 10'



**Champions Engineering & Inspections**  
**Registered Engineering Firm #5832**