FRANCIS HOME INSPECTIONS, PLLC TREC #24926

832-402-0003



david@francishomeinspections.com https://www.francishomeinspections.com



TREC REI 7-6

3107 Snug Harbour Ct Katy, TX 77449



Inspector
David Francis
InterNachi Certified Inspector
832-402-0003
david@francishomeinspections.com



PROPERTY INSPECTION REPORT FORM

Taji Henley Name of Client 3107 Snug Harbour Ct, Katy, TX 77449	06/30/2022 9:00 am Date of Inspection
Address of Inspected Property	
David Francis	InterNachi Certified Inspector
Name of Inspector	TREC License #
Name of Sponsor (if applicable)	TREC License #

PURPOSE OF INSPECTION

A real estate inspection is a visual survey of a structure and a basic performance evaluation of the systems and components of a building. It provides information regarding the general condition of a residence at the time the inspection was conducted. *It is important* that you carefully read ALL of this information. Ask the inspector to clarify any items or comments that are unclear.

RESPONSIBILITY OF THE INSPECTOR

This inspection is governed by the Texas Real Estate Commission (TREC) Standards of Practice (SOPs), which dictates the minimum requirements for a real estate inspection.

The inspector IS required to:

- use this Property Inspection Report form for the inspection;
- inspect only those components and conditions that are present, visible, and accessible at the time of the inspection;
- indicate whether each item was inspected, not inspected, or not present;
- indicate an item as Deficient (D) if a condition exists that adversely and materially affects the performance of a system or component **OR** constitutes a hazard to life, limb or property as specified by the SOPs; and
- explain the inspector's findings in the corresponding section in the body of the report form.

The inspector IS NOT required to:

- identify all potential hazards;
- turn on decommissioned equipment, systems, utilities, or apply an open flame or light a pilot to operate any appliance;
- climb over obstacles, move furnishings or stored items;
- prioritize or emphasize the importance of one deficiency over another;
- provide follow-up services to verify that proper repairs have been made; or
- inspect system or component listed under the optional section of the SOPs (22 TAC 535.233).

RESPONSIBILTY OF THE CLIENT

While items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions, in the event that any further evaluations are needed, it is the responsibility of the client to obtain further evaluations and/or cost estimates from qualified service professionals regarding any items reported as Deficient (D). It is recommended that any further evaluations and/or cost estimates take place prior to the expiration of any contractual time limitations, such as option periods.

Please Note: Evaluations performed by service professionals in response to items reported as Deficient (D) on the report may lead to the discovery of additional deficiencies that were not present, visible, or accessible at the time of the inspection. Any repairs made after the date of the inspection may render information contained in this report obsolete or invalid.

REPORT LIMITATIONS

This report is provided for the benefit of the named client and is based on observations made by the named inspector on the date the inspection was performed (indicated above).

ONLY those items specifically noted as being inspected on the report were inspected.

This inspection IS NOT:

- a technically exhaustive inspection of the structure, its systems, or its components and may not reveal all deficiencies;
- an inspection to verify compliance with any building codes;
- an inspection to verify compliance with manufacturer's installation instructions for any system or component and DOES NOT imply insurability or warrantability of the structure or its components.

NOTICE CONCERNING HAZARDOUS CONDITIONS, DEFICIENCIES, AND CONTRACTUAL AGREEMENTS

Conditions may be present in your home that did not violate building codes or common practices in effect when the home was constructed but are considered hazardous by today's standards. Such conditions that were part of the home prior to the adoption of any current codes prohibiting them may not be required to be updated to meet current code requirements. However, if it can be reasonably determined that they are present at the time of the inspection, the potential for injury or property loss from these conditions is significant enough to require inspectors to report them as Deficient (D). Examples of such hazardous conditions include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices and arc-fault (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

Please Note: items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions. The decision to correct a hazard or any deficiency identified in an inspection report is left up to the parties to the contract for the sale or purchase of the home.

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR


Access Provided By:: Supra-Key or Key Code

In Attendance: Buyer *Occupancy:* Furnished







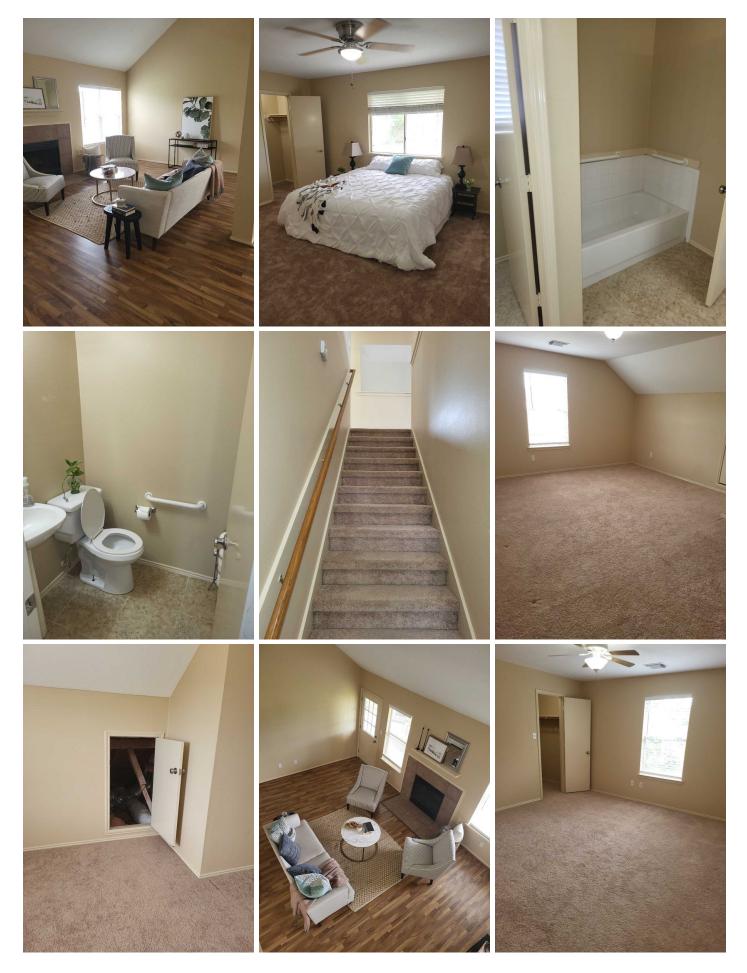

Page 3 of 48



Weather Conditions: Cloudy, Dry, Hot, Humid Temperature (approximate): 81 Fahrenheit (F)



Type of Building: Single Family

Style: Traditional

Property Occupied/Furnished:

Property was furnished and occupied so a 100% inspection was not done. Only a representative number of electrical outlets were tested.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

I. STRUCTURAL SYSTEMS

☒ ☐ **☒** A. Foundations

Type of Foundation(s): Slab on Grade

Comments:

An opinion on performance is mandatory. The inspector is not a structural engineer. If any concerns about the potential for future movement exist, the client should have an engineer give an evaluation. There was no evidence of excessive movement or structural observed at the time of inspection.

Note:

Foundations on clay-based soils require adequate and evenly-distributed moisture around the perimeter of the foundation to prevent excessive movement. Trees and shrubbery can cause foundation damage when growing too close. Water should not be permitted to erode the soil or to pond alongside or under any part of the foundation. Depending on the design and construction of a pier and beam foundation, periodic leveling may be required.

1: Foundation Cracks - Minor

Recommendation

Minor cracking was noted at the foundation. This is common as concrete ages and shrinkage surface cracks are normal. Recommend monitoring for more serious shifting/displacement.

Here is an informational article on foundation cracks.

Recommendation: Recommend monitoring.



Front entry





2: EXPOSED POST-TENSION CABLES

Maintenance Item

Post-tensioned cables exposed due to missing mortar. As cables are exposed to moisture they will rust which causes expansion and eventual corrosion to the cable. Recommend a handyman or DIY

Recommendation: Contact a handyman or DIY project

NI NP D



South exterior foundation

3: FOUNDATION CRACKS-CORNER POPS

✓ Maintenance Item

Foundation corner crack(s) observed. Recommend monitoring cracks for future movement as foundation settles.

Here is an informational article on corner cracks

Recommendation: Recommend monitoring.







North corner of home

North corner of home

East side(garage) of home

I=Inspected


NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D



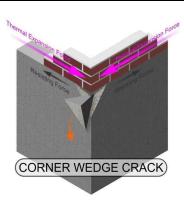

West corner/backyard

4: Spalling

Recommendation

Observed spalling in one or more areas of the foundation. Spalling occurs when water enters concrete and forces the surface of a foundation slab wall to pop off or flake exposing the gravel or pebbles in the concrete.

Recommendation: Contact a qualified professional.



South exterior foundation

🛛 🗆 🗖 🗷 B. Grading and Drainage

Comments:

Proper drainage is defined as landscaping in place to move water away from foundation and have no low spots to allow pooling next to the foundation.

Note:

Foundation area surface and/or subsurface drains are not inspected.

I=Inspected

NI=Not Inspected

NP=Not Present


D=Deficient

NI NP D

1: SPLASH BLOCK-BACKWARDS

Observed one or more splash blocks installed backwards at the gutter downspouts. The open end of the splash block should be pointed away from the home to help ensure drainage away from the foundation.

Recommendation: Contact a handyman or DIY project

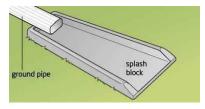



North side of home


2: SPLASH BLOCK-MISSING


Maintenance Item

Observed missing splash blocks at gutter downspouts. Recommend installing splash blocks to prevent possible localized erosion in soil under the foundation.

Recommendation: Contact a handyman or DIY project



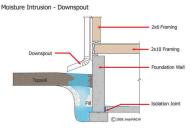

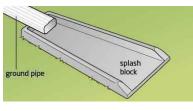

South corner/backyard

 \mathbf{X} \mathbf{X} C. Roof Covering Materials


Types of Roof Covering: Composition tile

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

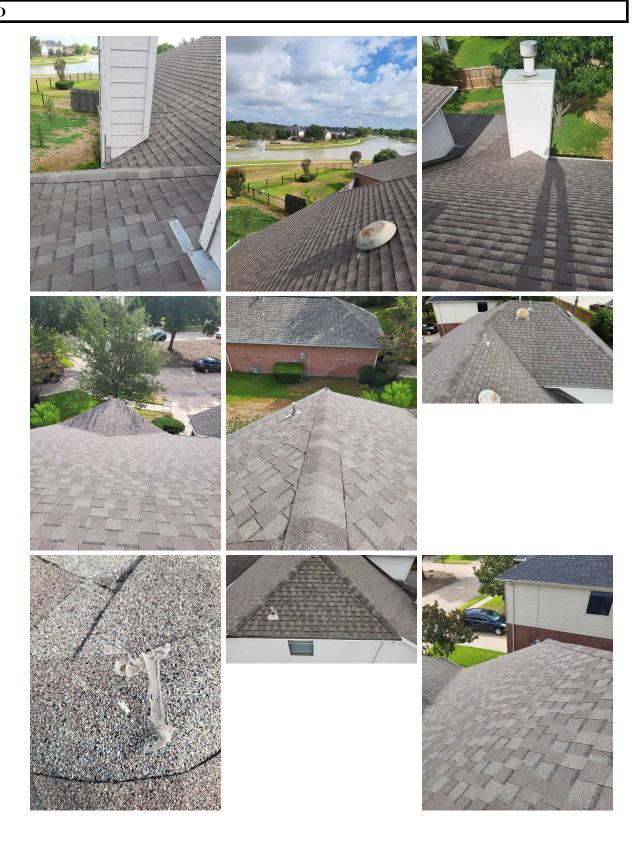


Page 9 of 48

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

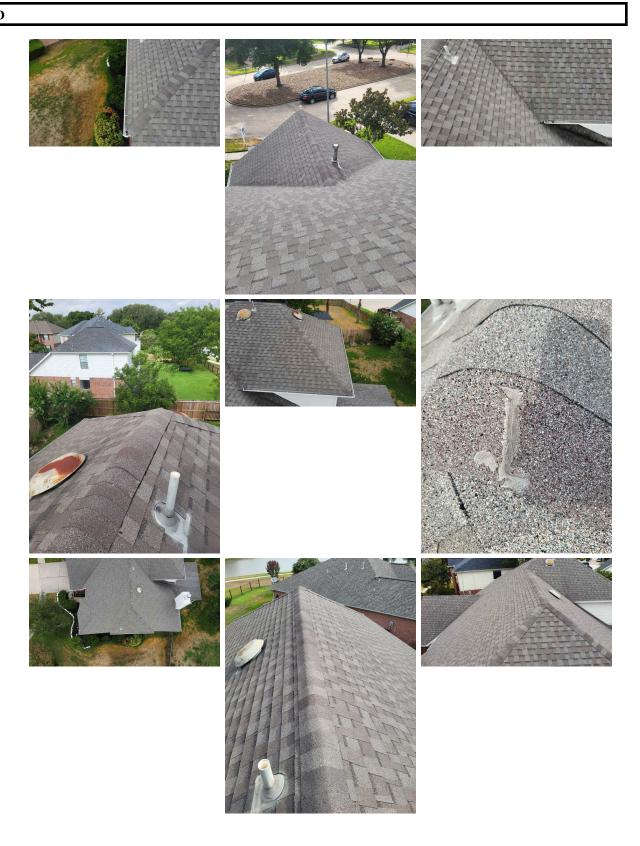

Page 10 of 48

I=Inspected NI=Not Inspected

NI NP D NP=Not Present **D=Deficient**

Viewed From: Ground, Roof, Drone

This inspection covers the roof coverings, flashings, skylights, gutters and roof penetrations. If any concern exists about the roof covering life expectancy or the potential of future problems, a roofing specialist should be consulted.

Note:

Not all roofs are walked on during the inspection due to height, slope of roof, type of roof covering material, weather and/or safety concerns. Weather conditions (wind, hail, extreme temperatures, etc) affect all roofing materials day to day. Periodic observation by the homeowner is recommended. Roofs are not checked for insurability due to the fact that different insurance companies have different standards for insuring homes.

Note:

We recommend that a professional roofing contractor evaluate all roof covering materials and inspect all roof penetrations to ensure no leakage is occurring and that proper sealing of all roof penetrations is achieved.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

1: Exposed Nails

Recommendation

Several exposed roofing nails were noted on the roof. Recommend all exposed nail heads are properly sealed to mitigate potential nail rust/corrosion and roof leaks.

Recommendation: Contact a qualified roofing professional.



2: Rusted Roof Vent/Caps

Maintenance Item

One or more roof vent covers showed signs of rusting at the time of inspection. Recommend monitoring and/or having further evaluated by roofing contractor.

Recommendation: Recommend monitoring.





☑ □ □ ☑ D. Roof Structures and Attics

Viewed From: Attic Insulation: N/A R-value

Approximate Average Depth of Insulation:

See chart below to determine the value of attic blown-in insulation.

Comments:

This inspection covers the roof structure and sheathing. The attic and attic space ventilation will be observed, if possible.

1: Insufficient Insulation

Recommendation

Insulation depth was inadequate. Recommend a qualified attic insulation contractor install additional insulation.


NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

Recommendation: Contact a qualified insulation contractor.

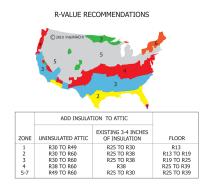



2: Evidence of rodent activity

▲Safety Hazard

Vermin and other pests are part of the natural habitat, but they often invade homes. Rats and mice have collapsible rib cages and can squeeze through even the tiniest crevices. And it is not uncommon for them to establish colonies within crawlspaces, attics, closets, and even the space inside walls, where they can breed and become a health-hazard. Therefore, it would be prudent to have an exterminator evaluate the residence to ensure that it is rodent-proof, and to periodically monitor those areas that are not readily accessible.

Recommendation: Contact a qualified pest control specialist.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP

D













E. Walls (Interior and Exterior) \mathbf{X} \mathbf{X}

I=Inspected

D=Deficient NI=Not Inspected NP=Not Present

NI NP D

Comments:

The inspection covers deficiencies of the interior and exterior wall surfaces related to structural performances and water penetration.

1: Cracks - Minor

Recommendation

Minor cracking was observed in wall structure. This is common in homes this age. Recommend monitoring and/or having cracks sealed or caulked.

Recommendation: Contact a qualified professional.



East side(front) of home

2: DAMAGED SIDING/TRIM

Recommendation

Observed damaged siding/trim on one or more exterior wall surfaces. Repairing will help prevent potential moisture and/or pest intrusion

Recommendation: Contact a qualified professional.



South corner/backyard

Above patio

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

3: MISSING CAULK

Maintenance Item

Observed missing caulk in one or more locations. Caulk helps prevent potential moisture penetration in and around windows, doors and walls.

Recommendation: Contact a qualified professional.







North side of home 2nd floor

Gas meter



4: RUSTED/EXPOSED LINTELS

Recommendation

Observed exposed and rust on lintels above windows/doors on exterior wall. Rusting of lintels cause expansion of the steel which may cause further damage to exterior wall structure.

Recommendation: Contact a qualified professional.

NI NP D

I=Inspected

D=Deficient NI=Not Inspected NP=Not Present



East side(front) of home

East side(front) of home

\mathbf{X} F. Ceilings and Floors

Comments:

This inspection covers deficiencies of the ceiling and floors related to structural performance or water penetration.

1: Flooring - Damaged

Recommendation

The home flooring had general moderate damage visible at the time of the inspection. Recommend evaluation by a qualified flooring contractor.

Recommendation: Contact a qualified professional.



2: MISSING CAULK - FLOOR/TILE AREA

Maintenance Item

Missing caulk between base trim and tile/vinyl flooring allowing cleaning water and normal spillage to wick into the unpainted bottom of trim.

I=Inspected NI=Not Inspected NP=N

NP=Not Present

D=Deficient

NI NP D

 \mathbf{X}

 \mathbf{X}

Recommendation: Contact a qualified professional.



G. Doors (Interior and Exterior)

Comments:

Where deteriorated caulk/mortar joints and/or moisture damage are noted as deficient, it should be assumed that moisture penetration may have occurred in that area and that some hidden damage may exist.

1: MISSING DOORSTOP

Maintenance Item

Observed missing doorstops in one or more locations.

Recommendation: Contact a handyman or DIY project



Page 18 of 48

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP

D



Bedroom #3


2: SELF CLOSING DOOR

Recommendation

Door between home and garage does not have self-closing capabilities or not functioning as such.

Here is a helpful article on self-closing doors: https://www.familyhandyman.com/project/self-closing-doormaking-an-existing-garage-service-door-automatic/

Recommendation: Contact a qualified professional.

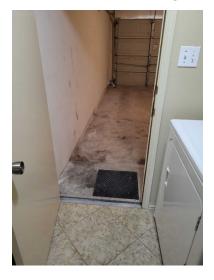

 \mathbf{X} \mathbf{X} H. Windows

This inspection covers the presence and condition of windows and screens.

1: CAULKING AROUND INTERIOR/EXTERIOR WINDOWS

Recommendation

Caulk shrinkage around window(s).

I=Inspected NI=Not Inspected **D=Deficient**

NI NP D NP=Not Present

Observation of caulk shrinkage on the exterior of windows allows for the possibility of water penetration. Recommend a qualified professional for further evaluation.

Recommendation: Contact a handyman or DIY project



South exterior window

2: MISSING/DAMAGED SCREEN(S)

Maintenance Item

Observed one or more windows with damaged or missing window screens.

Recommendation: Contact a qualified window repair/installation contractor.





North side of home

South bathroom window

3: WINDOWS DIFFICULT TO OPEN/CLOSE

Recommendation

Several windows in the home were difficult to open/close. This issue commonly happens when windows are not used and/or serviced on a regular basis. Recommend a window professional inspect, clean, lubricate & adjust/repair windows as necessary.

NI=Not Inspected

NP=Not Present

D=Deficient


NI NP D

Recommendation: Contact a qualified window repair/installation contractor.







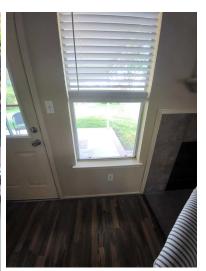



☑ □ □ I. Stairways (Interior and Exterior)

Comments:

This inspection will note the deficiencies in steps, stairways, landings, guardrails, and handrails. For proper spacing between balusters, spindles, or rails for steps, stairways, guards and railings.

☑ □ □ J. Fireplaces and Chimneys

Comments:

This inspection covers the VISIBLE components and structure of the fireplace and chimney.

I=Inspected

NI=Not Inspected NP=Not Present **D=Deficient**

NI NP D



Emergency gas shut off

K. Porches, Balconies, Decks, and Carports

Comments:

All cement slabs (garages, porches, patios, driveways, home under floor coverings) can have small surface cracks. Generally these cracks are less than 1/8 inch wide and are shrinkage cracks.

I=Inspected NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

II. ELECTRICAL SYSTEMS

☑ □ □ ■ A. Service Entrance and Panels

Electrical Service:
See comment(s) under photo(s).







100 amp service

GFCI Circuits: See comments under photos.



GFCI reset for half bath located in master bath

Comments:

This inspection covers the service entrance wiring, electrical panels and sub-panels.

1: DOUBLE TAPPED NEUTRALS

Recommendation

Electrical panel had several neutral wires that were "double-tapped" at the neutral bus bar. This is not allowable by national standards and could cause electrical issues, including overheating/fire. Recommend further evaluation by a qualified electrician.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

Recommendation: Contact a qualified electrical contractor.



2: IMPROPER SCREWS ON DEAD FRONT COVER

▲Safety Hazard

Dead front cover had an unapproved screw installed, which prevented removal of the dead front for further inspection. Recommend further evaluation by a qualified electrician. Sharp-pointed metal screws should not be used. These are a potential hazard as they may puncture wire insulation and electrify panel box, becoming a shock or electrocution hazard. These screws should be replaced with approved, flat-tipped screws.

Recommendation: Contact a qualified electrical contractor.



3: NO ANTI-OXIDANT

Recommendation

Observed missing anti-oxidant grease on aluminum service entrance conductors.

Recommendation: Contact a qualified electrical contractor.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D




4: UNIDENTIFIED CONDUCTOR

Recommendation

Observed white conductor wire without identifier marking label. White wires are typically used for neutrals but when used on breakers that are not GFCI/AFCI breakers they must be identified with black electrical tape to identify them as hot.

Recommendation: Contact a qualified professional.

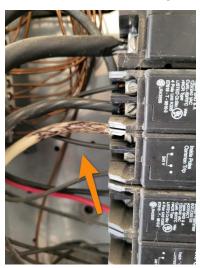

5: Improperly sized circuit breaker for AC condenser

Recommendation

A/C Condenser was being served by a 50 AMP circuit breaker. The data tag on the unit stated the breaker must be between 23.5 AMPS and 40 AMPS. These are manufacturer recommendations and should be followed. Recommend further evaluation by a qualified professional.

Recommendation: Contact a qualified professional.

Report Identification. 5107 Shug Harbour Ct, Raty, 174 77447 - June 30, 202

NI=Not Inspected

NI NP D

I=Inspected



NP=Not Present

B. Branch Circuits, Connected Devices, and Fixtures

Type of Wiring: Copper

Comments:

This inspection covers electrical receptacles, switches and fixtures.

Home Occupied:

Only accessible outlets were tested. Furniture was not moved to test outlets. Owner's personal equipment not unplugged to test outlets.

D=Deficient

1: LIGHT INOPERABLE

► Maintenance Item

One or more lights are not operating. This could be the result of a new light bulb being needed or a potential wiring problem.

Recommendation: Contact a handyman or DIY project



Front porch

2: LOOSE OUTLET

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

Recommendation

Observed loosely fastened outlets. Outlets loosen because they're attached to an electrical box that's installed too far back into the wall. Electrical boxes that are too far back aren't secure enough, which affects the stability of the entire fixture. That instability could bump or joist wires loose, creating even more major problems. Loose, damaged, or disconnected wires are shock hazards and could lead to sparks, fires and other electrical hazards.

Recommendation: Contact a qualified electrical contractor.



Kitchen counter

3: MISSING GFCI LABELS

Recommendation

Observed missing GFCI labels at one or more outlets at the time of inspection.

Recommendation: Contact a qualified professional.



Kitchen counter

4: No GFCI Protection

■ Recommendation

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

GFCI outlet not resetting

Here is a link to read about how GFCI receptacles keep you safe.

Recommendation: Contact a qualified electrical contractor.




Garage

5: Ceiling Fan noisy

Recommendation

Ceiling fan in master bedroom made more noise during operation than normal. Fan may not have been properly installed. Recommend further evaluation by a qualified professional.

Recommendation: Contact a handyman or DIY project

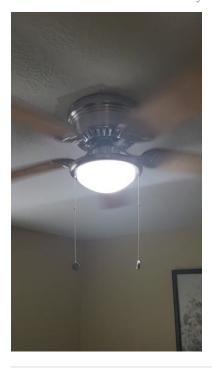

Page 28 of 48

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

6: OUTLET INOPERABLE

Recommendation

Outlet at bar was inoperable at the time of inspection

Recommendation: Contact a qualified professional.



Bar/behind sink

7: Ceiling fan inoperable/missing remote

Recommendation

Bedroom #2

One or more ceiling fans were inoperable missing remotes. This can can hinder operation of ceiling fans, sometimes requiring replacement. Recommend replacement of a compatible remote, and/or further evaluation by a qualified professional.

Recommendation: Contact a qualified professional.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D



□ □ **⊠** □ **C. Other**Comments:

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

lacktriangledown \Box \Box A. Heating Equipment

Type of Systems: Gas-Fired Heat, Central Heating







Supply vent







NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D





Energy Sources: Gas Comments:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

If deteriorated or missing sealant, missing refrigerant line insulation, or evidence or previous or current leaks are noted as deficient within HVAC systems, it should be assumed that moisture penetration may have occurred and hidden damages may exist.

Note:

We recommend the heating system be completely serviced before each heating season. Filters should be changed at regular intervals. Checking humidifiers, electronic air filters and proper airflow is NOT included in this inspection.

🛛 🗆 🗆 B. Cooling Equipment

Type of Systems: Electric, Central Air Conditioner, Whole House Fan - See comments under photos.



NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D



Comments:

The Texas Real Estate Commission(TREC) estimates the typical lifespan of HVAC systems to be 15-20 years of service. This may vary from system to system depending on the level of use and recommended maintenance performed during the life of the system.

Periodic Maintenance:

We recommend the cooling system be completely serviced before each cooling season and the primary condensate drain line be flushed with a chlorine bleach/water solution every 2 months during the cooling season to prevent clogging. Cooling equipment is not checked when the outside temperature is below 60 degrees F because of possible damage to compressor.

HVAC Manufacturer/Year: See comments under photo.

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D



Bryant July 2013

X	Ш	Ш	Ш	C. Duct Systems, Chases, and	Vents
				Commenter	

Comments:

This inspection covers the condition of the visible ducts, vents, fans, and filters. Supply and return air is checked with infrared thermometers at various registers for temperature consistency.

□ □ ■ □ D. Other

Comments:

I=Inspected NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

IV. PLUMBING SYSTEMS

△ A. Plumbing Supply, Distribution Systems, and Fixtures Location of Water Meter: Exterior



Location of Main Water Supply Valve: Garage



Static Water Pressure Reading: 50

I=Inspected NI=Not Inspected

NP=Not Present

D=Deficient





Type of Supply Piping Material: Stainless Steel, PEX, PVC

Note:

Pipes, plumbing equipment, and reservoirs concealed in enclosures or underground are not checked for leaks or defects. The pipes and plumbing in walls or under concrete slabs, or concealed by personal possessions are not included in this inspection. Water purification systems are not inspected. Laundry equipment is not operated to check drain system.

Comments:

This inspection covers the type and condition of all accessible and visible water supply components.

1: Improper Installation

Recommendation

Fixtures were installed improperly. Recommend a qualified handyman or plumber evaluate and repair.

Recommendation: Contact a qualified plumbing contractor.



Half bath

2: MISSING INSULATION

Maintenance Item

Observed missing insulation on one or more exterior plumbing fixtures.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

Recommendation: Contact a handyman or DIY project



South side of home

Back patio

3: SINK STOPPER

✗ Maintenance Item

Sink stopper not adequately seating or functioning properly in drain orifice.

Recommendation: Contact a handyman or DIY project



4: Missing backflow preventor

Recommendation

Backflow is the reversal of the normal and intended direction of water flow in a water system. Devices and assemblies known as backflow preventers are installed to prevent backflow, which can contaminate potable

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

water supplies.

Recommendation: Contact a qualified professional.



South side of home

Back patio

5: Sink leaking

Recommendation

At the time of inspection there was a leak at the 1st sink in master bathroom

Recommendation: Contact a qualified plumbing contractor.



X B. Drains, Wastes, and Vents

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D

Note:

Only visible and accessible waste lines are checked.

Type of Drain Piping Material: PVC



Comments:

This inspection covers the condition of all accessible and visible waste-water and vent pipes.

☑ □ □ C. Water Heating Equipment

Energy Sources: Gas Capacity: 40 Gallons Life Expectancy:

With regular maintenance, inspection, draining and flushing of a water heater the life expectancy of a gas water heater is anywhere from 8-12 years and an electric water heater from 10-15 years.

Comments:

This inspection covers the water heating equipment and its temperature and pressure relief system.

Temperature Pressure and Relief Valve: Not Tested

Type and Year Manufactured: See comments under photos.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D



□ □ **☑** □ D. Hydro-Massage Therapy Equipment

Comments:

This inspection covers BUILT-IN hydrotherapy and whirlpool equipment.

■ □ □ F. Gas Distribution Systems and Gas Appliances

Location of Gas Meter: EXTERIOR

South exterior wall

Type of Gas Distribution Piping Material: Stainless Steel, Black Iron

I=Inspected NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D



Comments:

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D

V. APPLIANCES

☑ □ □ ■ A. Dishwashers

Comments:

This inspection of the dishwasher covers the door gasket, control knobs, and interior parts; including the dish tray, rollers, spray arms and the soap dispenser.

1: DISHWASHER LEAKING

Recommendation

At the time of inspection, dishwasher leaked at water turn on valve.

Recommendation: Contact a qualified plumbing contractor.



Leaking at water shut off

2: Not secured

Recommendation

Dishwasher was not properly fastened/secured under the kitchen countertop. This caused the appliance to move unnecessarily. Recommend repairs/corrections.

Recommendation: Contact a qualified professional.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient


NI NP D



☑ □ □ ■ B. Food Waste Disposers

Comments:

This inspection covers the splash guard, grinding components and exterior.

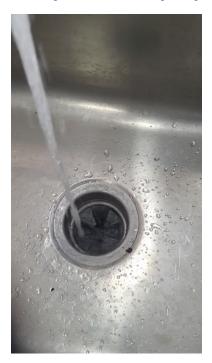

1: Leaking garbage disposal

Recommendation

There was a small leak noticed at the garbage disposal at the time of inspection.

D

I=Inspected

NI=Not Inspected NP=Not Present D=Deficient

NI NP


Recommendation: Contact a qualified plumbing contractor.



 X C. Range Hood and Exhaust Systems

Comments:

This inspection covers the filter, vent pipe, and switches as well as the operation of the blower.

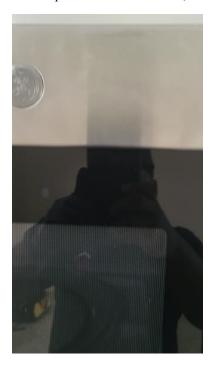

 \mathbf{X} D. Ranges, Cooktops, and Ovens

Comments:

This inspection of the range, oven, cooktops, covers, elements, drip pans, handles, gas panels, light covers and other parts

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D







Gas shut off located behind range



☒ □ □ E. Microwave Ovens

Note:

Microwave ovens are NOT checked for radiation leakage.

Comments:

This inspection of the microwave cooking equipment covers the knobs, handles, glass panels, doors and seals.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

NI NP D



X		F. Mechanical Exhaust Vents and Bathroom Heaters
		Commants

Comments:

This inspection will cover the operation of the unit, observing sound, speed and vibration level.

☑ □ □ ☑ G. Garage Door Operators

Comments:

This inspection will cover the condition of the main unit, operating the unit if possible and inspecting the safety features.

1: LOCKING MECHANISM

Recommendation

Garage door locking mechanism not disabled with the installation of automatic door operator.

Recommendation: Contact a handyman or DIY project

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

NI NP D



2: AUTOMATIC GARAGE OPENER INOPERABLE

Recommendation

Automatic garage door inoperable at the time of inspection. It's installed but not plugged in.

Recommendation: Contact a qualified garage door contractor.



🛛 🔲 🔲 H. Dryer Exhaus	t System:
-----------------------	-----------

Note:

Laundry equipment is NOT moved to check vents.

Comments:

This inspection will cover the condition and operation of the unit.