



HEDDERMAN SERVICES

281-355-9911

office@hedderman.com

<https://hedderman.com/>



STRUCTURAL INSPECTION

11511 Olympia dr
HOUSTON, TX 77077

June Chapman in C/O Debbie Cooper

OCTOBER 5, 2022



Inspector

Eddy Rodriguez

Engineer & TREC#23614

281-355-9911

office@hedderman.com

TABLE OF CONTENTS

1: Cover Letter	3
2: Purpose/Scope	4
3: Site Conditions	6
4: Foundation	7
5: Roof	18
6: Structural Framing	21
7: Water Penetration	23
8: Fireplace/Chimney	25
9: Attic	27
10: Exterior Cladding	30
11: Exterior Items	32
12: Interior Items	35
13: Close	39
14: Receipt Page	40
15: Service Agreement	41

1: COVER LETTER

Information



HEDDERMAN ENGINEERING, INC.

www.heddermanengineering.com Office 281-355-9911 Fax 281-355-9903 office@heddermanengineering.com

10/05/2022

TO: June Chapman in C/O Debbie Cooper

REF: CONDITION OF PROPERTY SURVEY

Dear June Chapman in C/O Debbie Cooper:

At your request, a visual survey of the house located at 11511 Olympia dr, HOUSTON, TX 77077 was performed by Eddy Rodriguez. Transmitted herewith is the inspection report stating our professional opinions on whether the items of construction included in the survey are functional on the day of the inspection, or are in need of repair.

The scope of our inspection and other important information, particularly in the area of dispute resolution should a question arise, is contained in our Service Agreement, which has been included at the end of this report.

Thank you for asking HEDDERMAN ENGINEERING, INC. to perform this important inspection work for you. If you have any questions after reviewing this report, please feel free to call me at my office.

At your service,

HEDDERMAN ENGINEERING, INC.

Tim Hedderman, President

2: PURPOSE/SCOPE

Information

INTRODUCTION

The purpose and scope of the inspection are detailed below, as well as in the executed Service Agreement at the end of this report. Also included are the limitations of the inspection.

PURPOSE

The purpose of the inspection was to view the components of the house included in the inspection and to give our opinions on whether or not these specific items were functioning at the time of the inspection, or appear to be in need of repair. Although this report may include observations of some building code violations, total compliance with structural, mechanical, plumbing, electrical codes, design specifications, and/or legal requirements is specifically excluded. This also applies to all non-code making bodies, including but not limited to, the Brick Institute of America and the Texas Lathing and Plastering Contractors Association and their respective recommendations of building construction details. We do not perform "code" inspections, and since building codes change every few years, our inspections are not done with the intention of bringing every item in the house into compliance with current code requirements. **Rather, the standard of our inspections is a performance standard to determine if the items inspected are functioning at the time of the inspection, or if they are in need of repair.** This is particularly applicable to Home Warranty policies, where the standards of the Home Warranty service company may differ than the scope of our stated performance standard for judging whether a piece of equipment is functional or in need of repair. If you intend to rely on a Home Warranty policy, then it is recommended that you contact the Home Warranty company of your choice for a more in-depth analysis of what may be required to meet their standards should a claim be made against their policy. It has been our experience that Home Warranty companies may require the equipment to be in total compliance with current code (even if it was installed before the current code was adopted) to be covered under their policy, and if so, it is recommended that you contact the appropriate service companies for a code compliance certification inspection. This report is provided solely for the use of the person to whom this report is addressed, and is in no way intended or authorized to be used by a third party, who may have different requirements, and to whom we have not contracted to perform the inspection. If a third party chooses to use this inspection report, they do so without HEDDERMAN ENGINEERING, INC. permission or authorization, and they do so at their own risk. It is our purpose to provide information on the condition of the house on the day of the inspection. It is not our purpose to provide discussions or recommendations concerning the future maintenance of any part of the house, or to verify the adequacy and/or design of any component of the house. It is pointed out that other engineers/inspectors may have contrasting opinions to those given in this report. Items that we find that in our opinion are in need of repair will typically include the recommendation to **Obtain a Cost Estimate** from qualified contractors. The scope and cost of the actual repairs can vary significantly from company to company, and it is **your responsibility** to see that the scope of work needed and actual cost of repairs is confirmed by contacting one or more qualified service companies before your option period ends or before closing on the property. This report may also contain informational items which are included as a courtesy to help you become more aware of the condition of the house. In the performance of this inspection, HEDDERMAN ENGINEERING, INC. has acted as an engineering consultant subject to the standards of the State Board for Professional Engineers.

SCOPE

The scope of the inspection included limited, visual observations at the interior and exterior of the structure. Only those items readily visible and accessible at the time of the inspection were viewed and are included in this report. Any items causing visual obstruction, including, but not limited to furniture, furnishings, floor or wall coverings, pictures, foliage, registers and grills on HVAC ductwork, soil, appliances, insulation, etc., were not moved. Due to COVID 19 restrictions, our inspectors are sometimes required to wear masks indoors. This restricts the inspector from using his full set of senses that are needed during the inspection process by inhibiting the inspector from possibly detecting odors that may be indicative of a problem, including but not limited to, mold, musty odors, natural or LP gas odors, pet odors, urine or fecal odors, etc. The basis of our opinions will be the apparent performance of that portion of the house readily visible at the time of the inspection. Disassembly or removal of any portion of the structure, mechanical equipment, plumbing equipment, or electrical equipment is beyond the scope of this inspection. There is no warranty or guarantee, either expressed or implied, regarding the habitability, future performance, life, insurability, merchantability, workmanship, and/or need for repair of any item inspected. The components of the house included in scope of the inspection, if present and applicable, include:

Structural: Foundation, primary load-carrying framing members, roof surface, water penetration, and miscellaneous items related to the house.

Mechanical: Air conditioning and heating systems, water heaters, built-in kitchen appliances, and garage door openers.

Plumbing: Water and gas supply lines, sinks, toilets, tubs, showers, visible drain lines inside the house, and vents.

Electrical: Service entrance conductors, electric meter, distribution panel, visible wiring, light fixtures, switches, and receptacle outlets.

Items specifically excluded from our inspection include:

Tainted and Corrosive sheetrock (Chinese Sheetrock).

All pests, wood destroying insects, conducive conditions, ants, or rodents.

All equipment related to mosquito control.

All items related to major geological conditions such as faults or subsidence.

All underground piping, including water, sewer, and gas piping.

Water softening and water treatment systems.

Identifying products that have been recalled.

Pressure testing of gas system.

All low voltage lighting systems and/or photocells.

All low voltage data systems such as telephone, cable TV or data lines.

All fire detection, carbon monoxide, smoke alarms and/or security alarm systems.

All environmental hazards, or any toxic/hazardous materials including, but not limited to: radon gas, lead, formaldehyde, electromagnetic, any and all items related to asbestos.

A backup generator and transfer switch panel.

Any electrical load analysis on the electrical system to determine adequacy of the service or any branch circuit.

If you desire information or inspections concerning the items listed above, or any other items, then it is recommended that you contact the appropriate service companies. Also excluded from the scope of the inspection are any and all items related to mold and/or all microbial substances. Due to the current limitations of coverage on most homes by the insurance industry in Texas, where damages due to mold and/or other microbial substances may not be covered, we routinely recommend that you have a mold inspection by a qualified professional before you close on the house. Built-in appliances and mechanical equipment were operated in at least one, but not all, of their operating modes, where possible. If you desire for every operating mode of each piece of equipment to be operationally checked, then it is recommended that you contact a service company. Equipment and materials that are not visible, including structural components, underground plumbing and gas lines, and all other items not normally available for ready viewing, are excluded from the scope of this inspection. If you desire an inspection on the underground plumbing pipes or a hydrostatic test to determine if the plumbing pipes are leaking under the house, then it is recommended that you contact a plumber. No electrical circuit or load analysis will be performed on the electrical system. We make no representation regarding the condition of this house other than as contained in this written report. Any verbal discussions concerning this house that were made at the time of the inspection, and not contained in this written report, are not to be relied upon. Although the structural portion of this inspection was made by an engineer, it cannot be considered to be a formal engineering study since no calculations, structural analysis, or physical material testing were performed. If engineering drawings/specifications have been made available during this inspection and, if they have been viewed, it is pointed out that all such viewing is strictly cursory, and in no way should our cursory examination be construed as providing engineering judgments concerning the adequacy or acceptability of the drawings/specifications. It is pointed out that it is possible for latent defects to exist in the structure and its related equipment, underground piping, and systems that are not visible at the time of the inspection, and may not be able to be viewed during a limited visual inspection. This is particularly applicable in items relating to water, such as roof leaks, water penetration conditions, etc., where the condition may exist, but not be visible at the time of the inspection (e.g. where it has not rained for a period of time, allowing materials time to dry out). HEDDERMAN ENGINEERING, INC. does not claim or warrant that the observations listed in this report represent every condition that may exist. In using the information supplied by this inspection, one must recognize the limitations of a limited, visual inspection conducted at a single point in time, and accept the inherent risk involved. It is recommended that you obtain as much history as is available concerning this house. This historical information may include copies of any seller's disclosures, previous inspection or engineering reports, building drawings and/or design specifications, bids to perform repair work on the house, knowledge of any drainage problems, receipts from repair work that has been performed, reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should attempt to determine whether repairs, renovation, remodeling, flood or discharge of water remediation, additions or other such activities have taken place at this house.

3: SITE CONDITIONS

Information

In Attendance

Structural Inspector, Mechanical
Inspector, Sellers Agent, Owner,
Appraiser

Weather

Clear, Temperature - 70-80
degrees

Occupancy

Occupied

Age of Home - Public Records

According to public records, the
house was built in 1978.

North-Front

For the purpose of the inspection and report, NORTH will be assumed to be from the rear of the house towards the front.

Sellers Disclosure Available

The Sellers Disclosure Statement was made available to the inspector(s) at the inspection.

Note when reviewing the report

It is pointed out that when reviewing the report, the reader should be aware that photos and comments regarding specific issues are typically a **REPRESENTATIVE SAMPLE** of what we observed at the time of the inspection, and are not necessarily an exhaustive list of all instances of that item/condition on the property.

4: FOUNDATION

Information

Description: FOUNDATION OBSERVATIONS AND CONCLUSIONS:

The following items were inspected, with our Observations and Conclusions noted.

Description: Concrete Rebar slab

The foundation was a concrete slab on grade, and appeared to be reinforced with steel reinforcing rods (rebar).

Reference point

See our field sketch below showing the elevation readings for this structure. Note that the "R" on the sketch is our randomly chosen starting reference point, where the elevation is 0, and all other elevation readings are taken relative to the reference point, and are measured in inches to the nearest 1/10 inch. Height adjustments were made for variations in the height or thickness of the various floor coverings. If there is a step up or a step down into an area such as a garage, sunken room, balcony/patio area, or raised rooms, the elevation readings will have larger numbers due to the amount of the step.

We typically point out that foundations are rarely constructed perfectly level, so most properties have some unlevelness (typically $\frac{3}{4}$ to 1-1/2 inches) built into the foundation as part of original construction. We have no knowledge as to how much unlevelness was built into this house foundation during original construction.

Note that it is not HEI's purpose to exhaustively document each and every evidence that may be related to foundation movement, but rather to document a representative sample and/or the most significant evidences of movement upon which we base our opinion on the condition of the foundation.

Levelness - More than normal-Multi Story

The floors were checked with an electronic level, and were observed to be sloping a more than normal degree towards the perimeter of the house.

First Floor:

The difference in elevation between the high point and low point was 4.1 inches. The high point was located at the family room, and the low point was located at the dining room. The unlevelness takes place over a horizontal distance of approximately 35 feet.



Second Floor:

The difference in elevation between the high point and low point was 2.4 inches. The high point was located at the hallway, and the low point was located at the west bedroom. The unlevelness takes place over a horizontal distance of approximately 35 feet.

10.5.22

HEI

Chapman

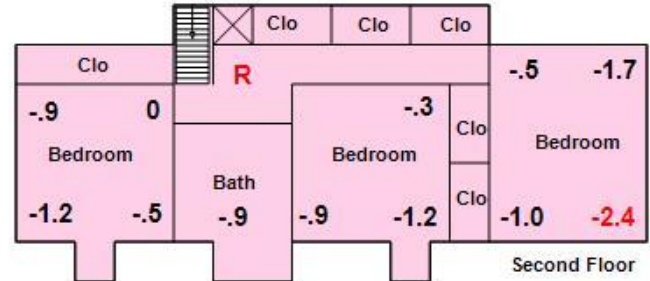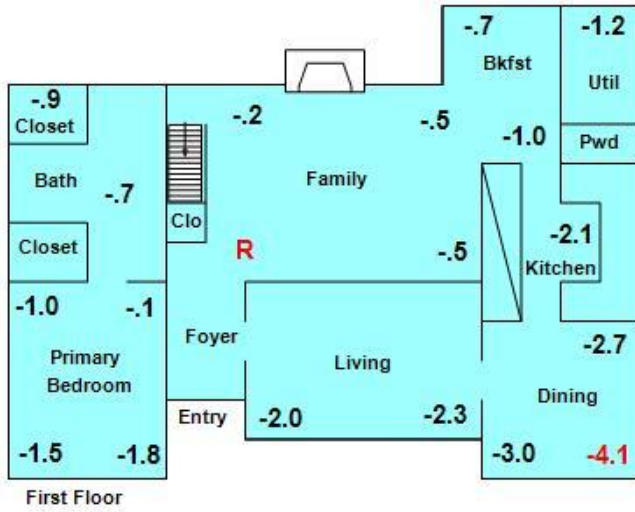


Elevation Readings
11511 Olympia Drive


Veneer - Cracks/Patches

East West Front

Cracks and/or patches were observed in the exterior veneer at the time of the inspection, including at the locations shown in the photos. It is recommended that the cracks be repaired for cosmetic purposes.

Obtain Cost Estimate

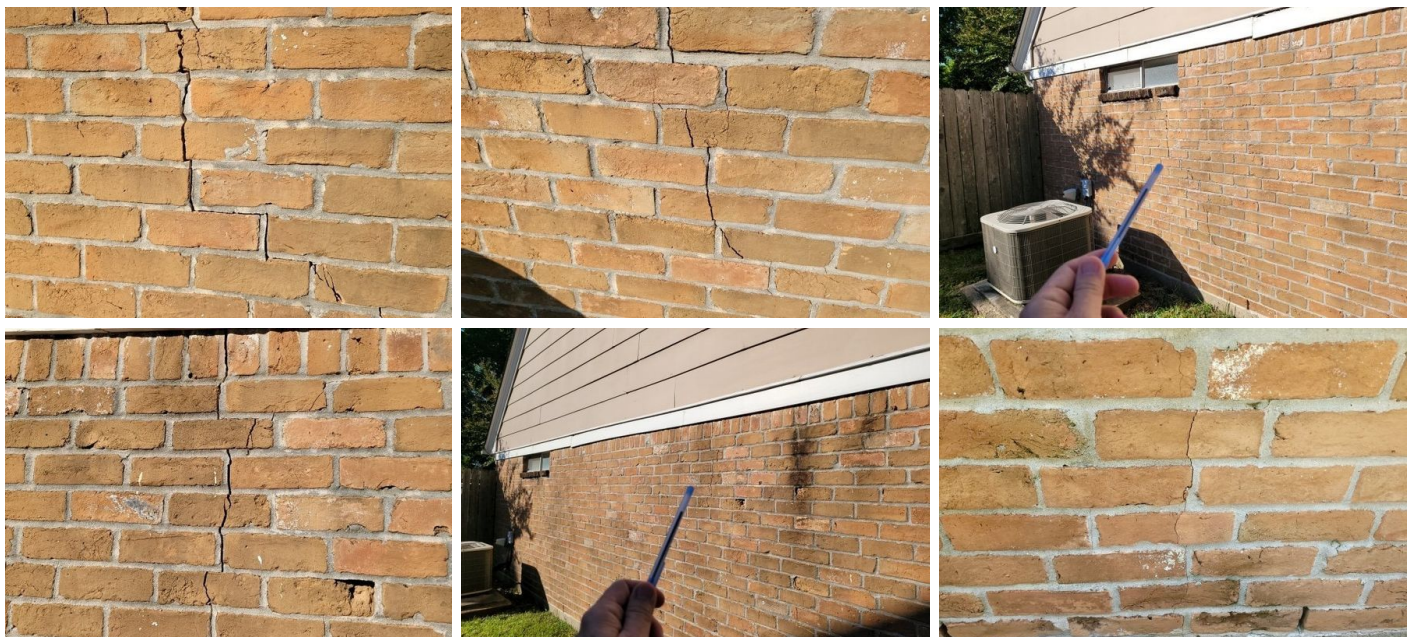


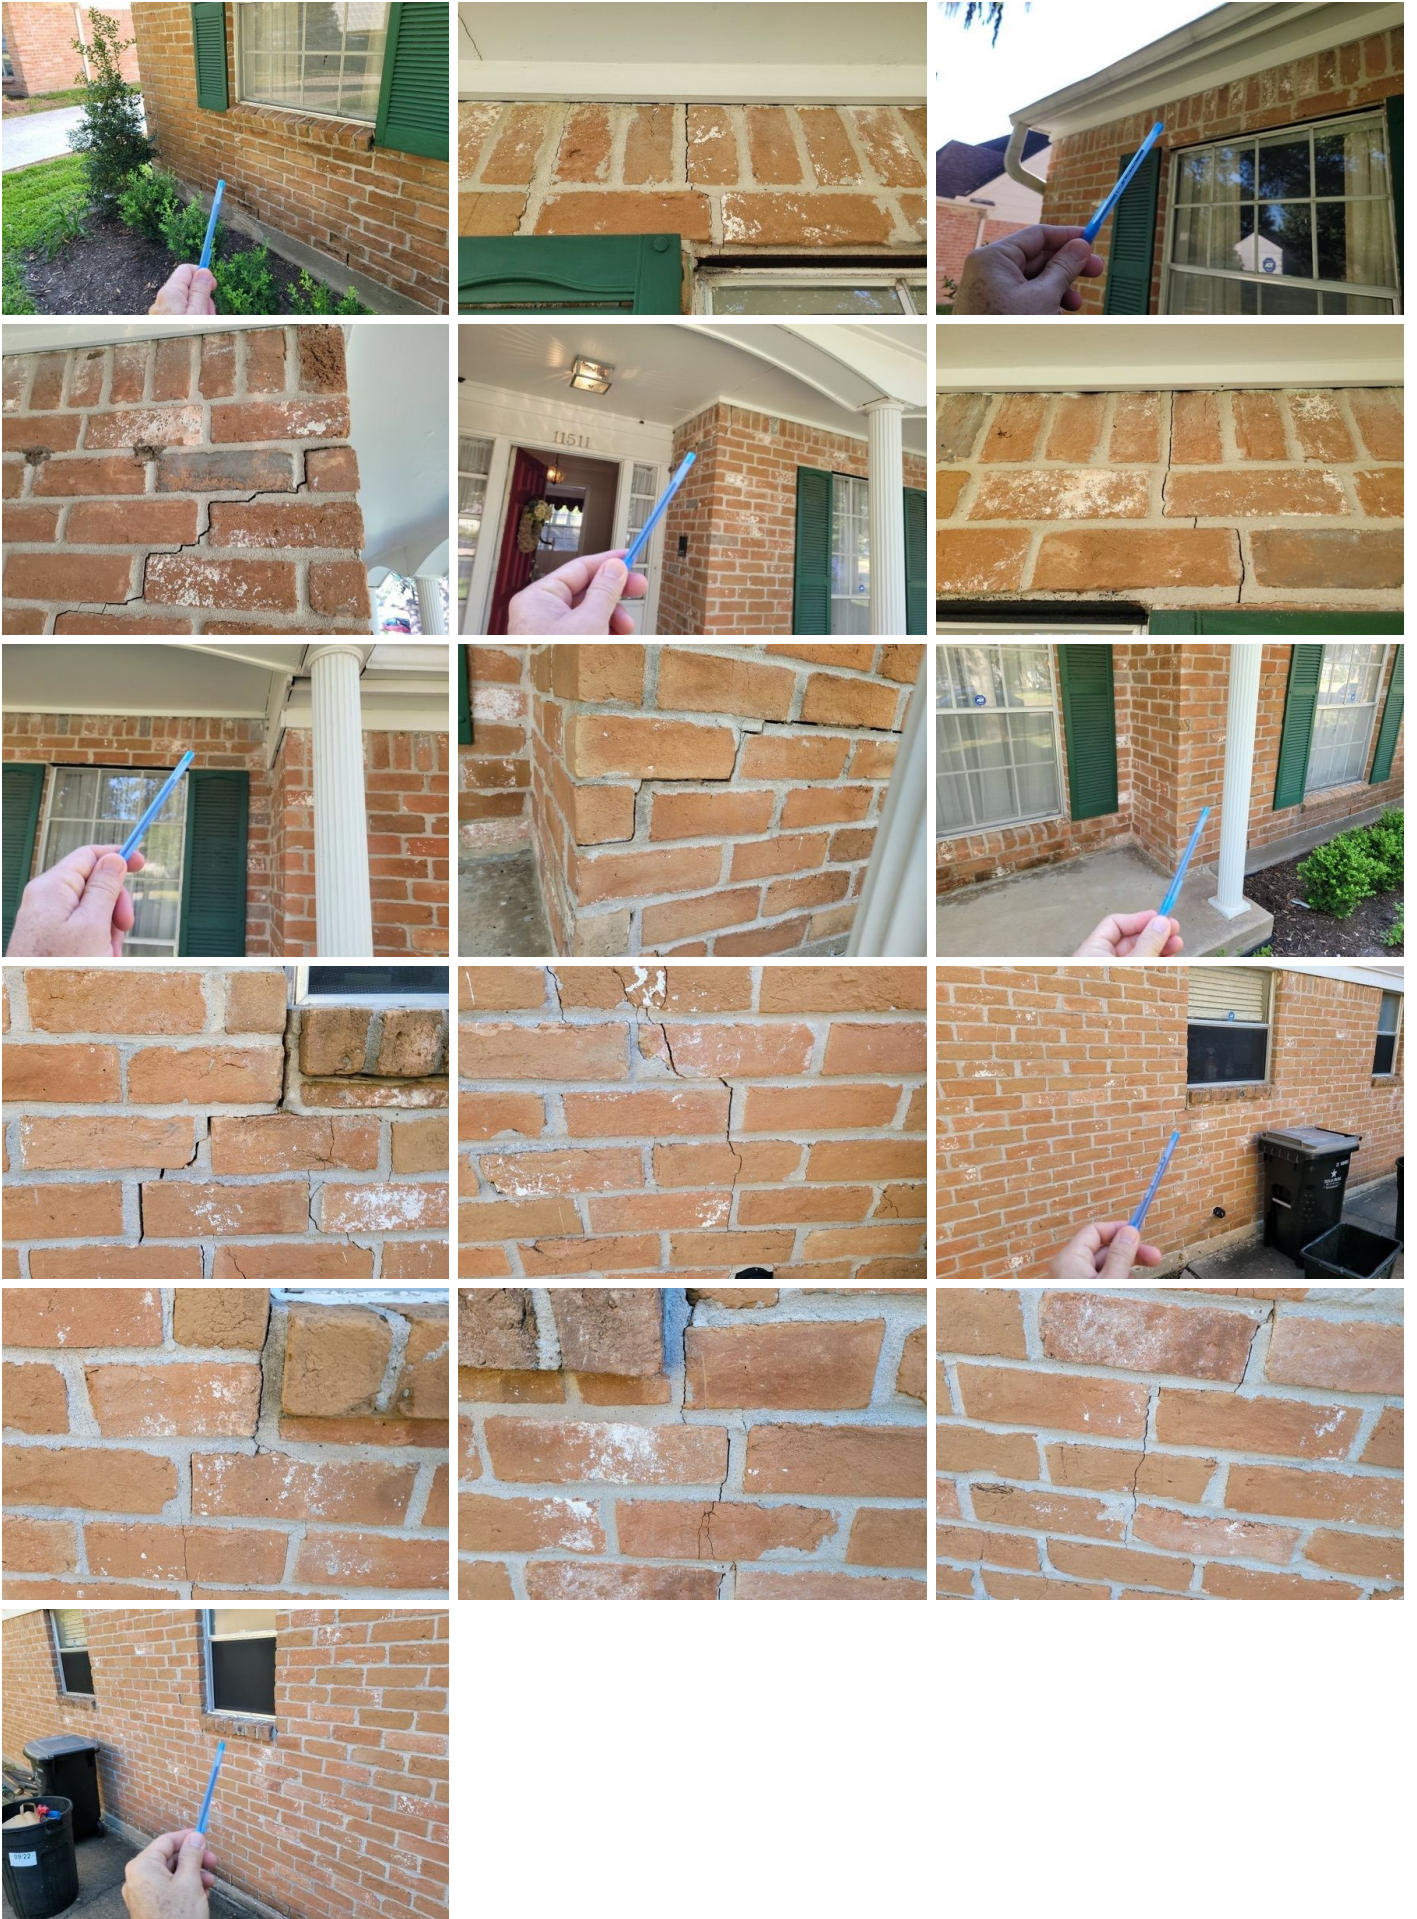



Sheetrock Cracks/Patches/Compression ridges
Throughout the house

Sheetrock cracks, patches, and/or compression ridges were observed in the house during the inspection, including at the specified locations. It is recommended that the cracks be repaired.

Obtain Cost Estimate

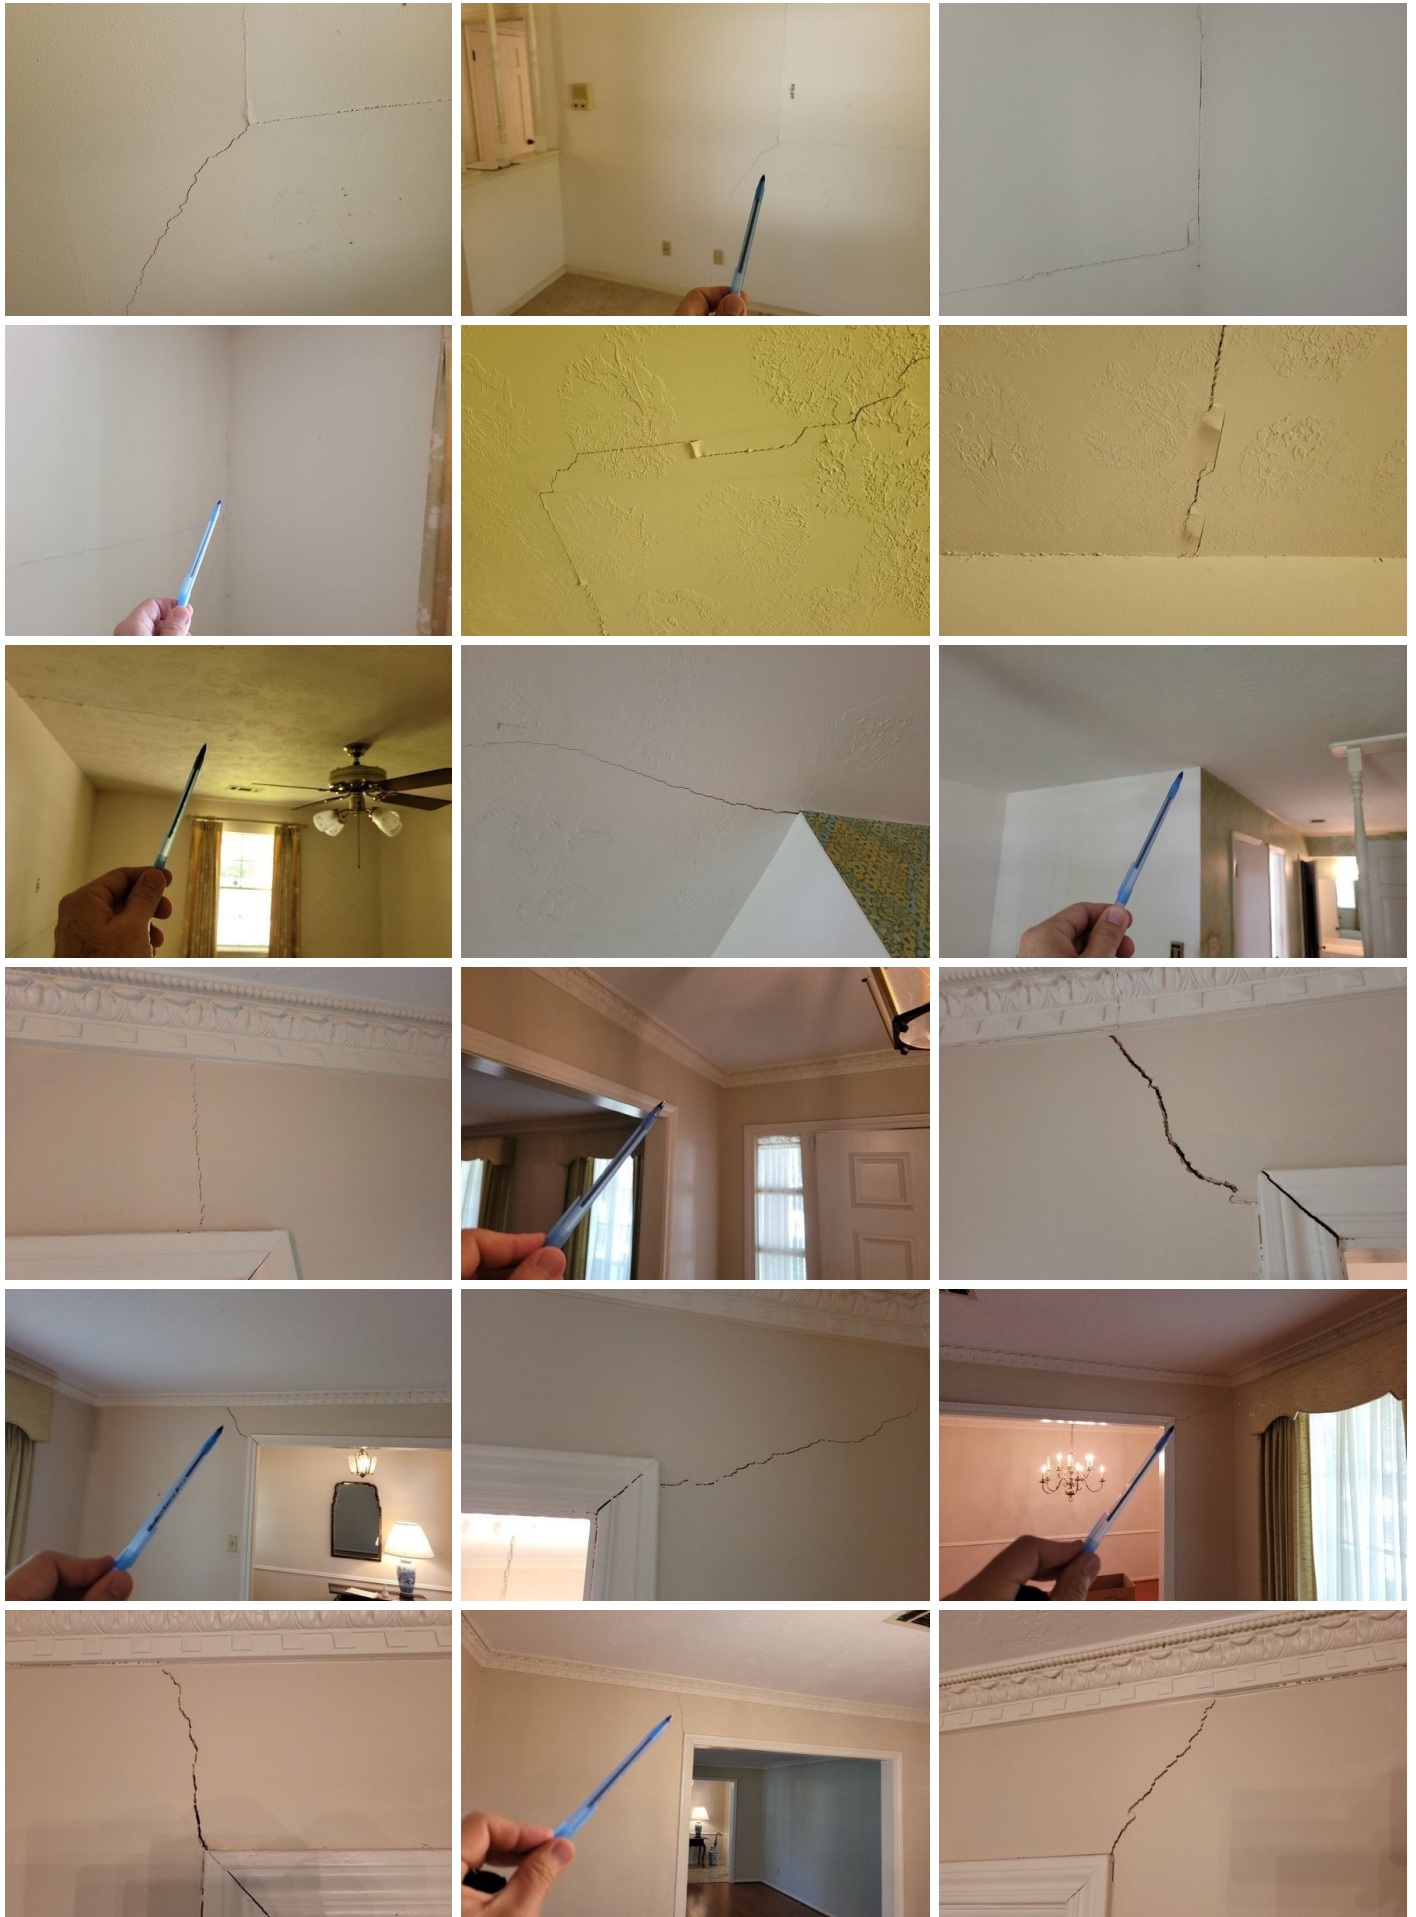

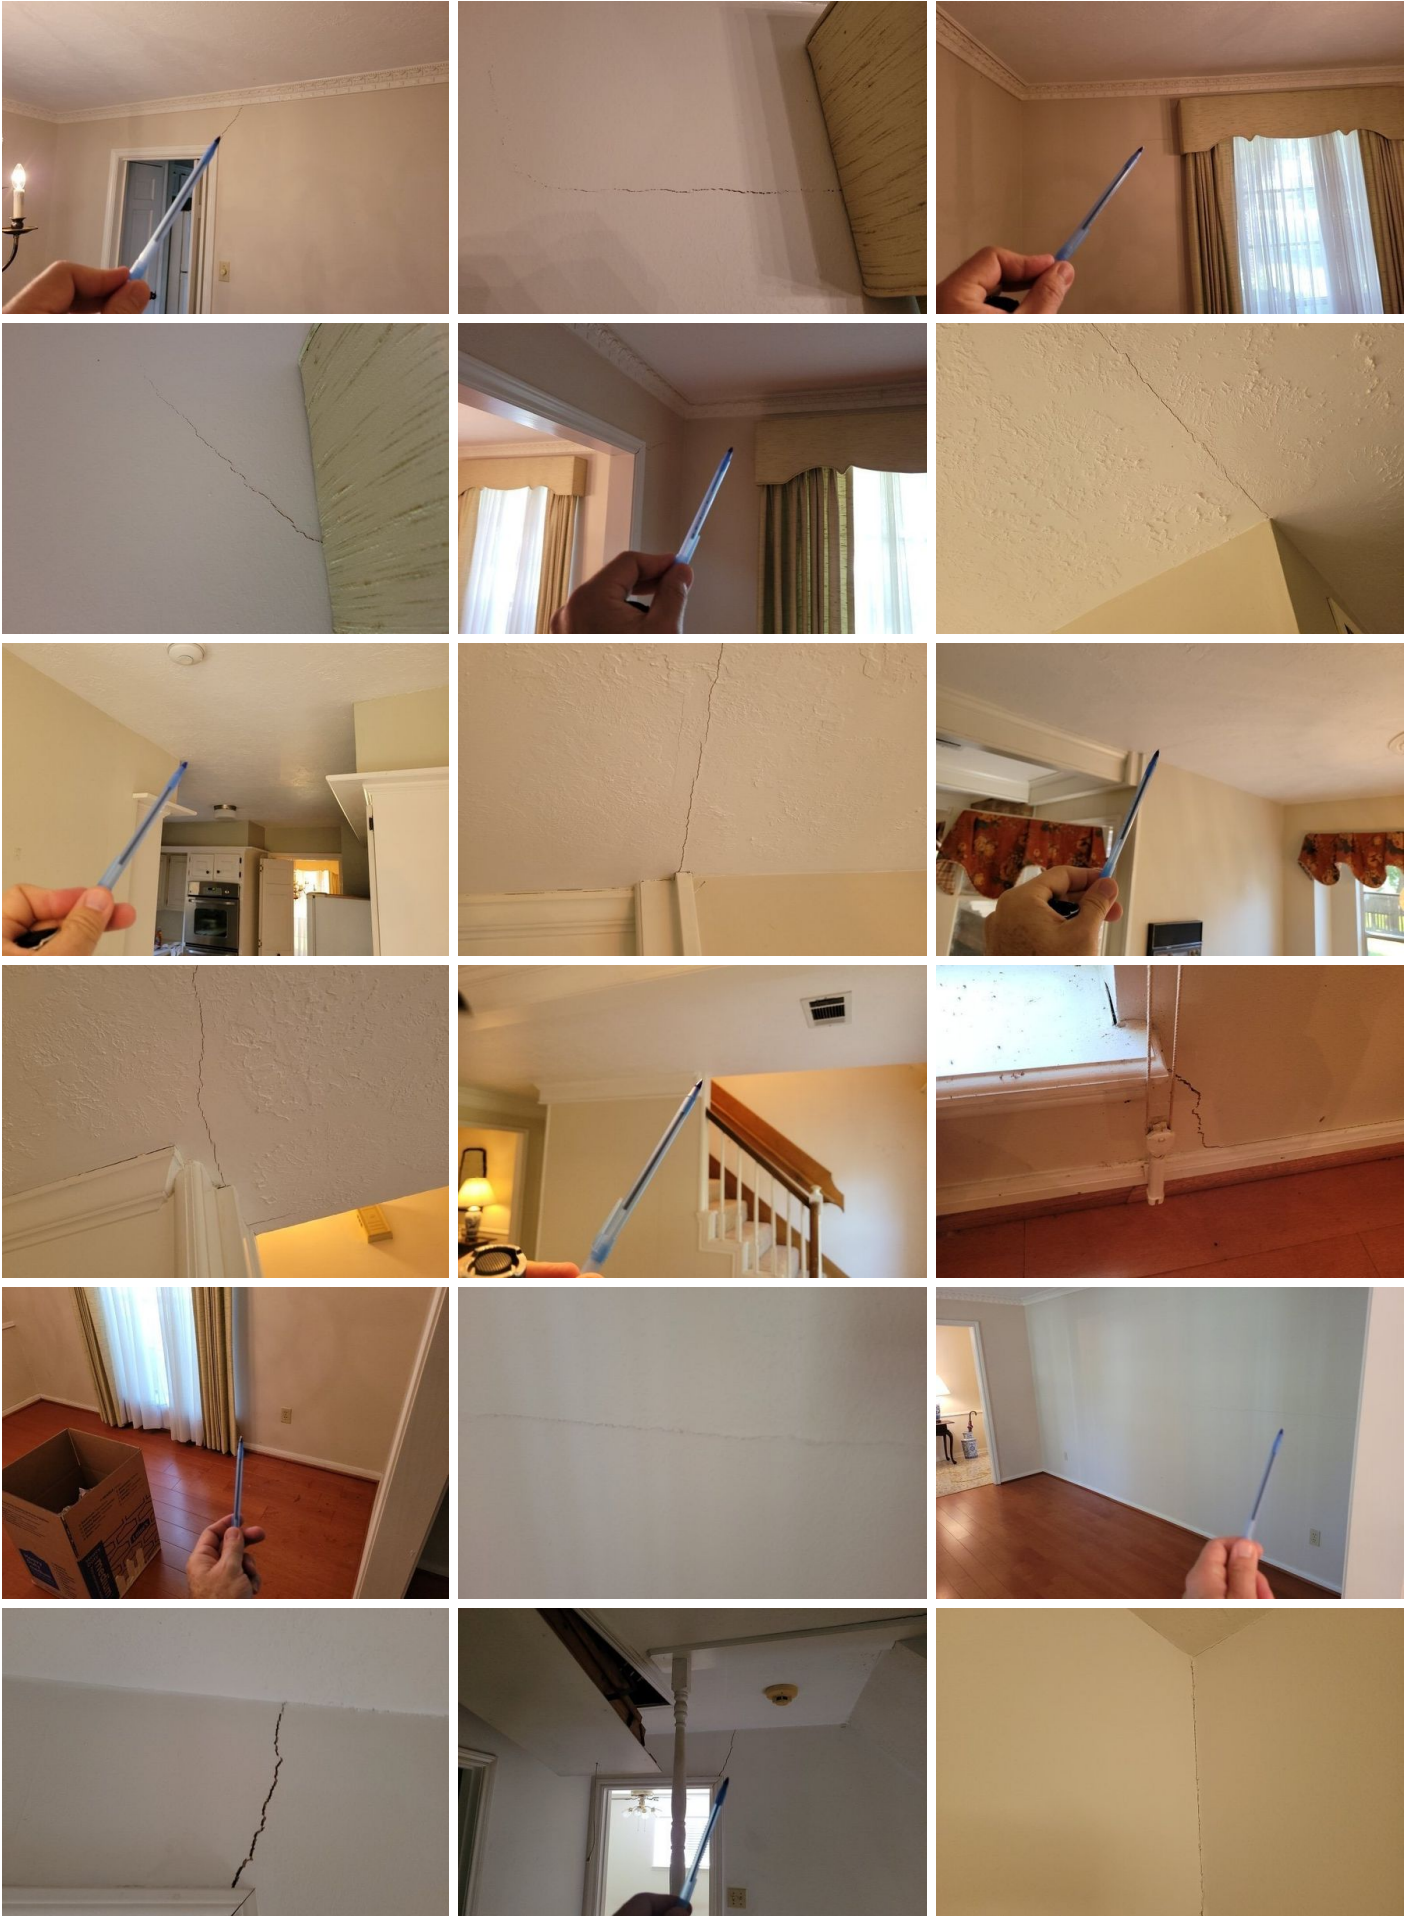

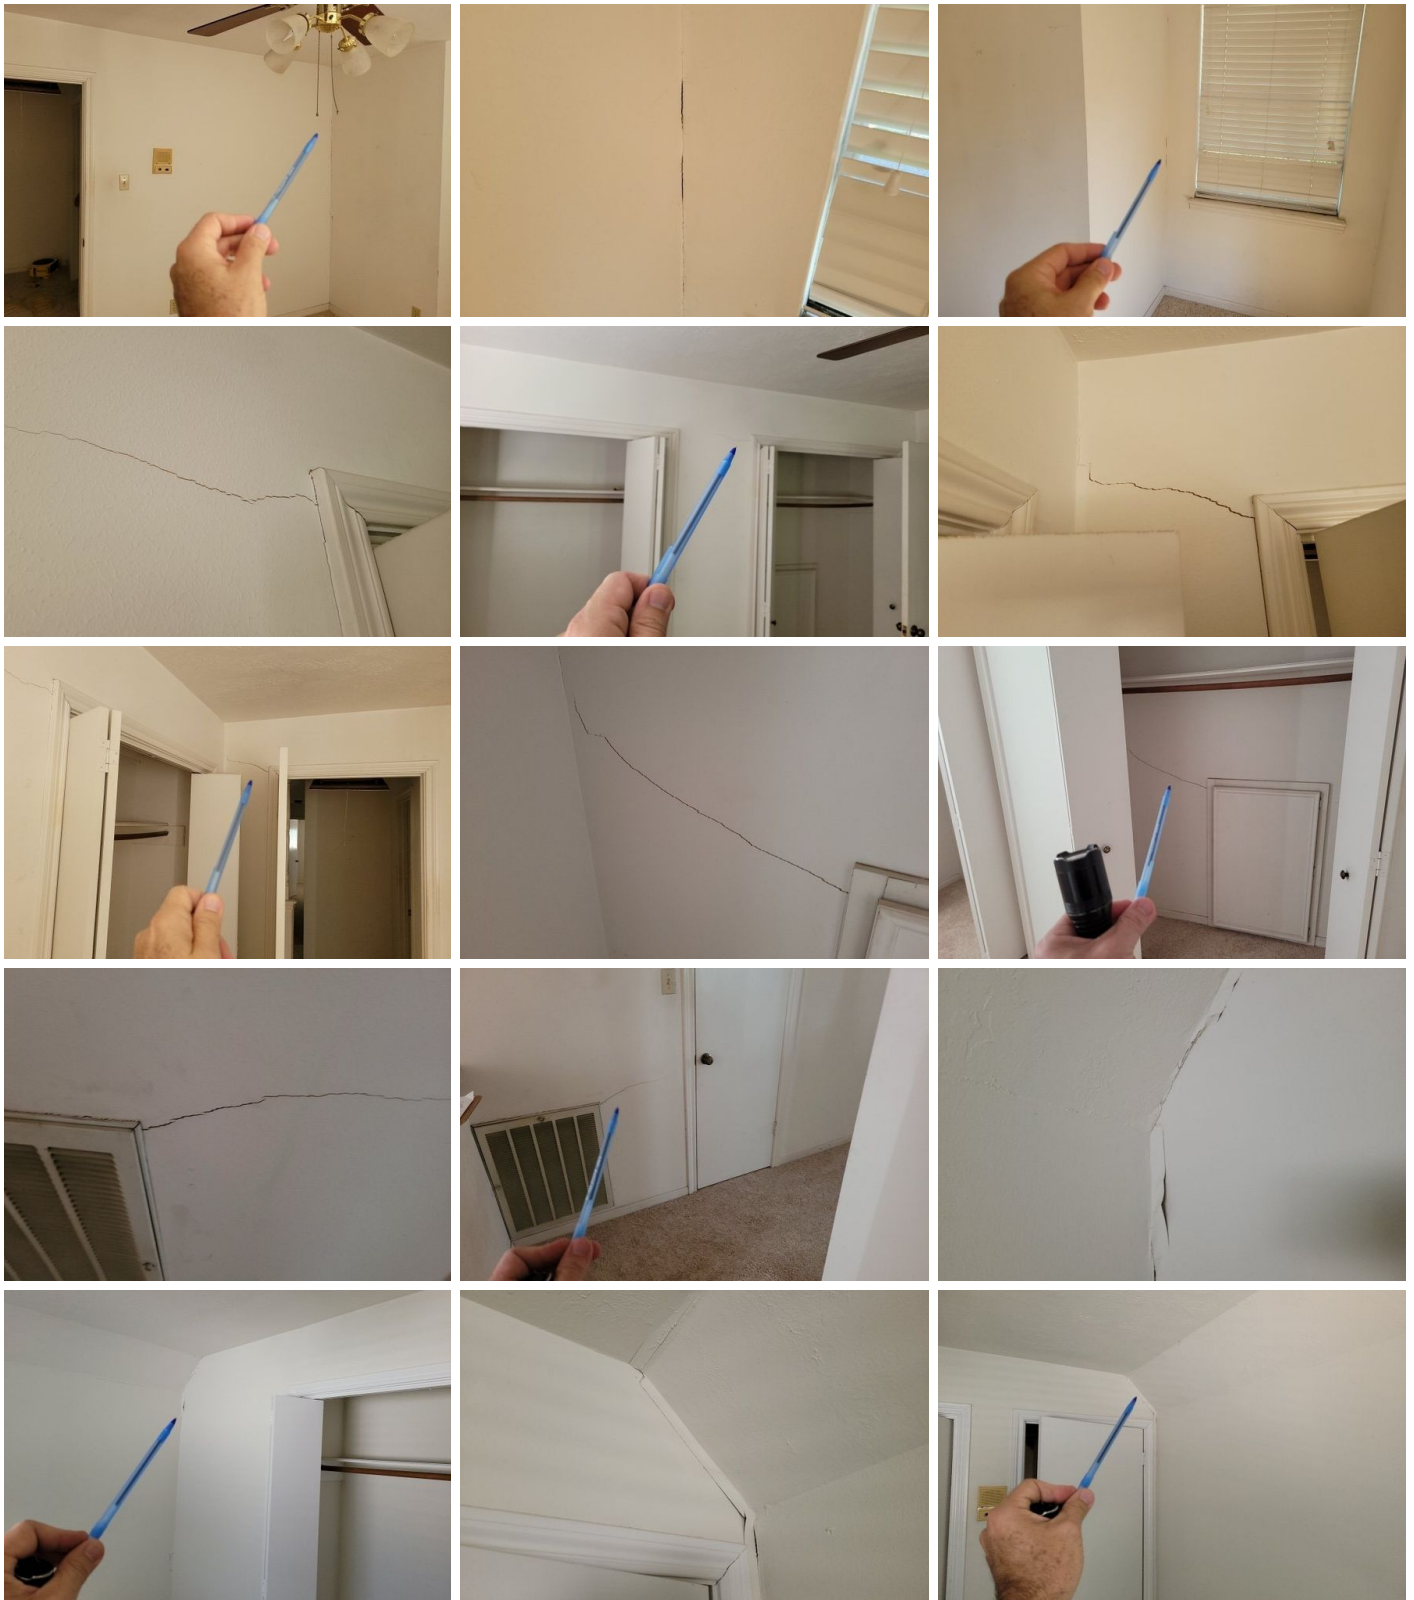

Concrete Cracks - Garage

Cracking of the foundation concrete exists in virtually all foundations. It is pointed out that cracking is a normal property of concrete and other brittle materials, and Hedderman Engineering, Inc. assumes no responsibility should cracks be found that are not mentioned in this report. Some cracking was observed in this concrete foundation, including at the garage floor.



Separation of Materials: Window frame

Front West

The window frame was separated from the exterior brick veneer apparently due to movement.



Separation of Materials: Door frame

Front Door

The door frame was separated from the exterior brick veneer apparently due to movement.



Separation of Materials: Sticking doors

Master Bedroom Master Bath Master Bedroom Closet

Doors that were sticking due to movement of the house were observed at the time of the inspection.

Separation of Materials: Non latching doors

Master Bedroom Closet 2nd Floor East Bedroom West Bedroom

Doors that would not latch due to misalignment of the striker plate and the locking mechanism were observed.

Separation of Materials: Door triangles at top

Master Bedroom Closet 2nd Floor East Bedroom West Bedroom

Door frames that were out of square, leaving a triangular separation between the door and the door frame at the top of the door were observed where a separation was visible at the top of the door.

Separation of Materials: "Ghost" doors


2nd Floor Bathroom

"Ghost" doors, where the door swings open and/or shut by itself due to unlevelness were observed.

Separation of Materials: Crown molding seperation

Hallway

The crown molding was observed to be separated at the ceiling which is typically related to movement in the house.

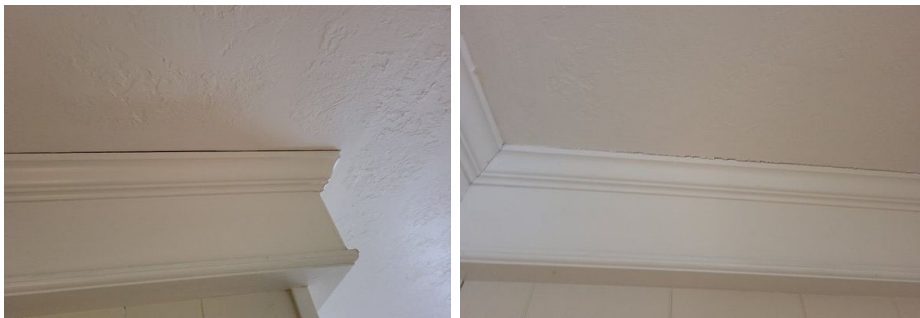

Separation of Materials: Baseboard separation

Dining Room

The baseboard trim was observed to be separated, which can be an evidence of movement.



Separation of Materials: Door trim separation

Master Bath Living Room

We observed door trim that had separations at the trim joints at some locations.





Separation of Materials: Rafter separation

One or more rafters were observed to be separated from the ridge beam in the attic, which can be an evidence of movement.

Separation of Materials: Decorative beam separation

Family Room


The decorative beam was separated from the ceiling and/or the crown molding.



Separation of Materials: Wall tile cracked


Master Bath

The tile on the wall was cracked which can be an evidence of movement of the house.

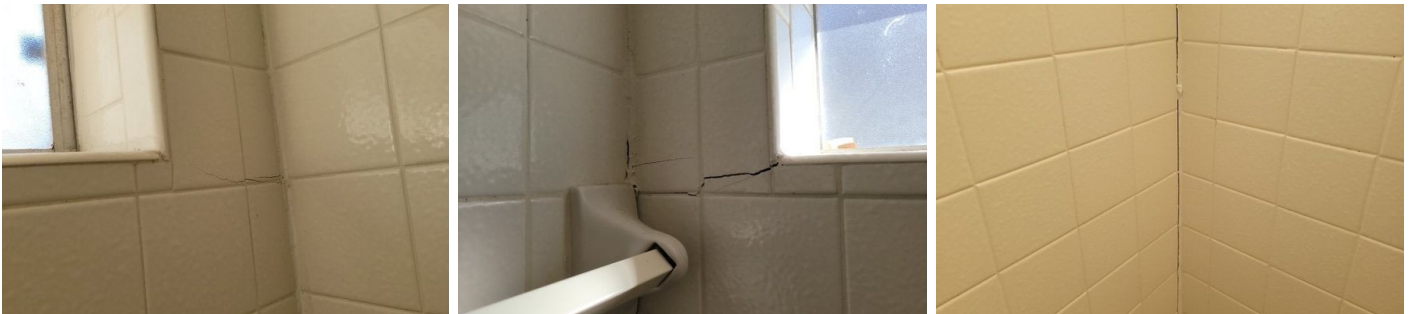

Separation of Materials: Chimney separated

The chimney was separated from the exterior wall due to movement of the foundation.

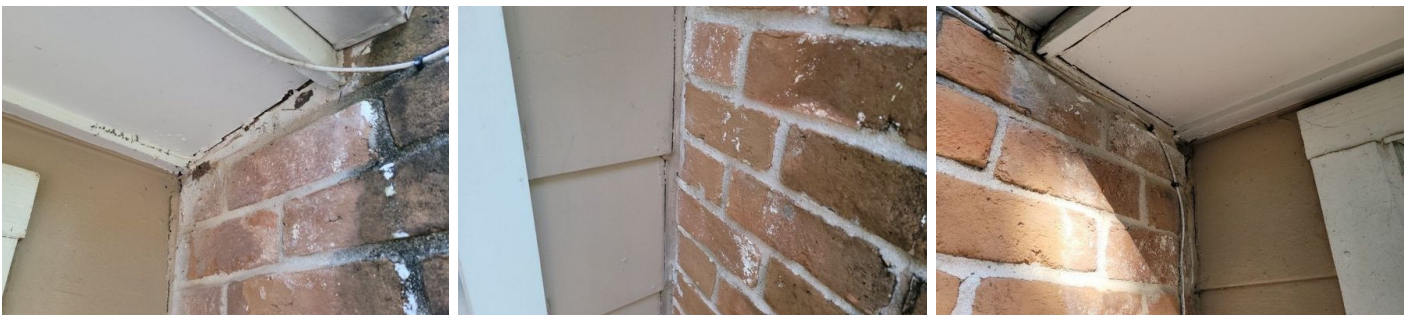

Separation of Materials: Vanity separated

Master Bath

We observed that the bath vanity was separated from the bathroom wall which can be an evidence of movement of the foundation.



Separation of Materials: Separation between veneer and siding

Front


We observed separations between the veneer and siding, and the separations appear to be related to movement of the foundation.



Perimeter Grading/Drainage: FLOOD PLAIN

100 Year Floor Plain

This inspection does not include determining if the property is in the 100 year flood plain. For further information regarding the elevation of this lot, check with your survey and/or a land surveyor.

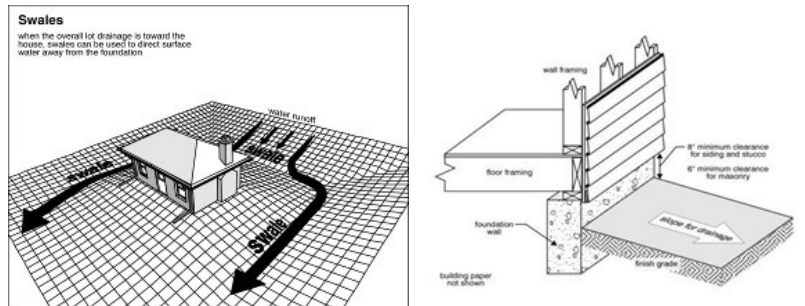

Recommendations/repair

4.5.1 FOUNDATION CONCLUSIONS

RECOMMEND SEWER LEAK TEST

It is recommended that a plumber be contacted to perform camera observation or leak testing on the underground sewer piping to determine if the underground piping is leaking. A leaking sewer pipe can contribute significantly to the instability of the supporting soils by introducing excessive moisture into the soils, thus weakening them, resulting in foundation settlement.

Obtain Cost Estimate

4.5.2 FOUNDATION CONCLUSIONS

REPAIR RECOMMENDED

Most of the structures previously inspected by this firm have experienced some degree of differential foundation movement, and this structure was no exception. After careful examination, it is our opinion that the degree of the foundation movement is more than what is acceptable. The most significant movement was located at the front of the house.

Due to the more than acceptable amount of movement of the foundation of this structure, it is our opinion that releveling of the foundation is needed at this time. It is recommended that at least three foundation repair contractors be contacted in order that they may make their own assessment of the scope and cost of the work needed to bring this foundation back to an acceptable degree of levelness.

Obtain Cost Estimate

4.6.1 Perimeter Grading/Drainage

GRADING FLAT, FURTHER INVESTIGATION RECOMMENDED

The grade was essentially flat, and it appears that water may pool at some areas after a rain. Further investigation with the homeowner is recommended to determine if water pools for a significant time after a rain. If so, an underground drainage system may need to be installed, and you should contact a company specializing in underground drainage system for a cost estimate.

R401.3

Obtain Cost Estimate

5: ROOF


Information

Roof Description: ROOF OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Roof Description: Composition Shingles

The pitched roof surface was constructed of composition shingles. The life expectancy of a composition shingle roof has been observed to vary from 15 to 20 years, with most requiring replacement at about 17-20 years.

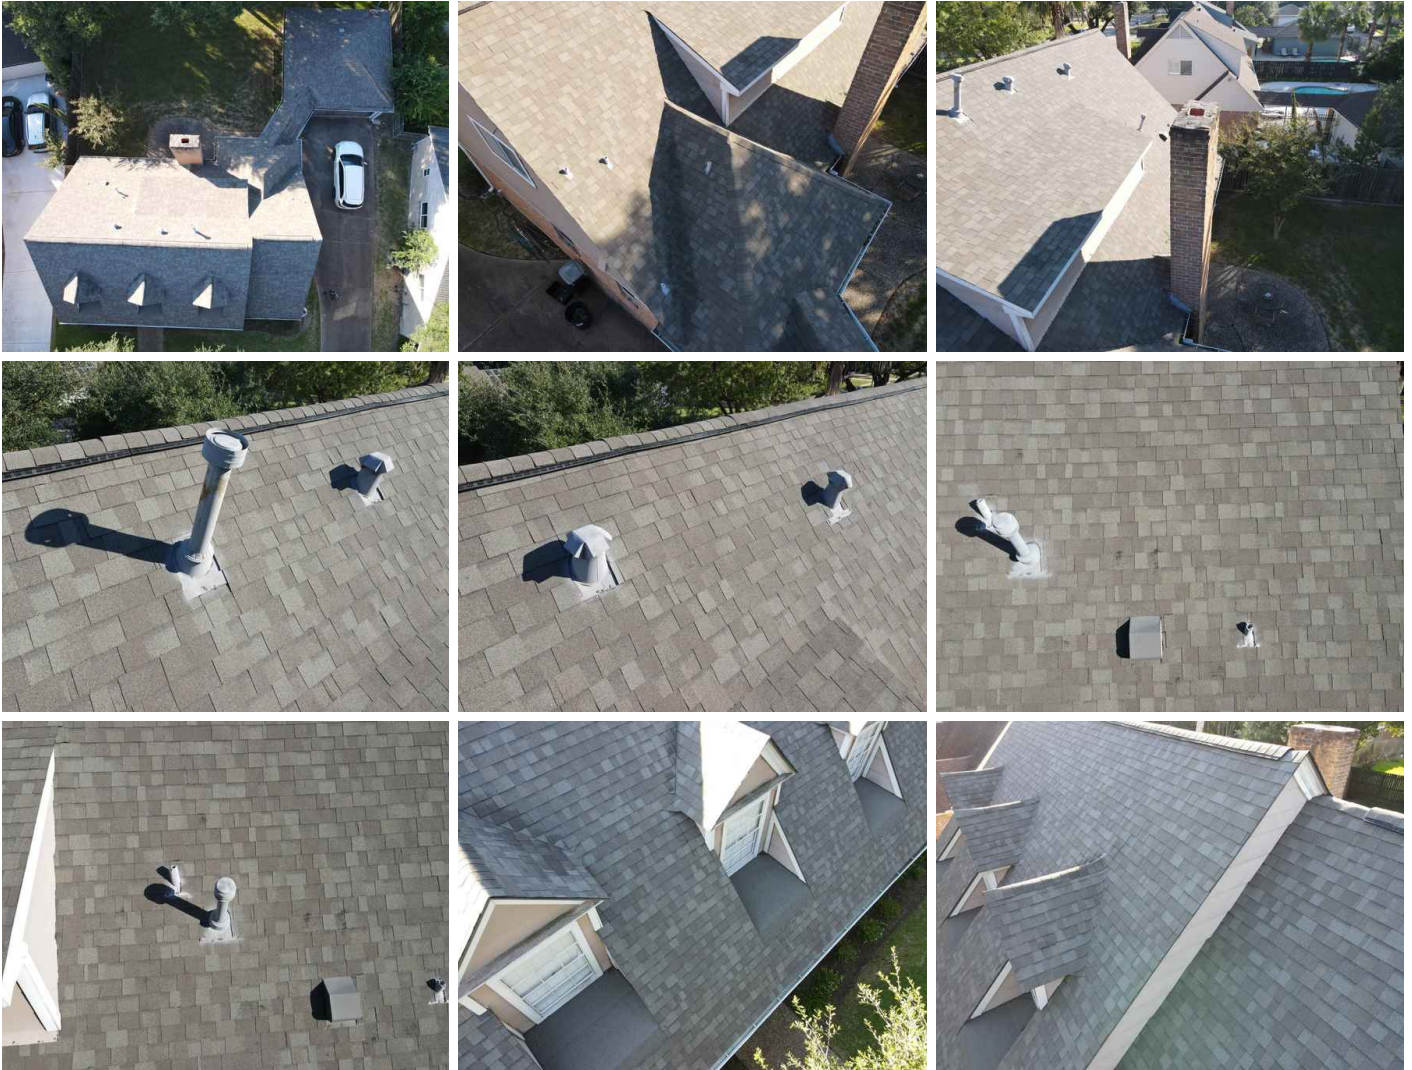

Age of Roof from Sellers Disclosure: Age of Roof: 5 years

The age of the roof, according to the sellers disclosure statement, was five years.

Roof viewed from: Drone due to height and/or pitch

Due to the height and/or steep pitch on the roof, the roof was not viewed from its surface due to safety concerns, but was viewed from photographs taken by a drone.

Roof Ventilation: Roof Vents

Gable Vent(s), Continuous Ridge Vent


The ventilation for the attic space was observed to include the following vents listed above.



Roof Leaks: Stains appear to be from previous leaks


2nd Floor Hallway West Bedroom

After observing the interior of the structure, evidences of current roof leaks were not visible. The absence of evidences of roof leaks does not guarantee that roof leaks were not present; rather, that no evidences of leaking were visible at the time of the inspection. Some stains were visible, but the stains appeared to be related to previous roof leaks. It is recommended that you check with the owner and/or a service company concerning the stains.

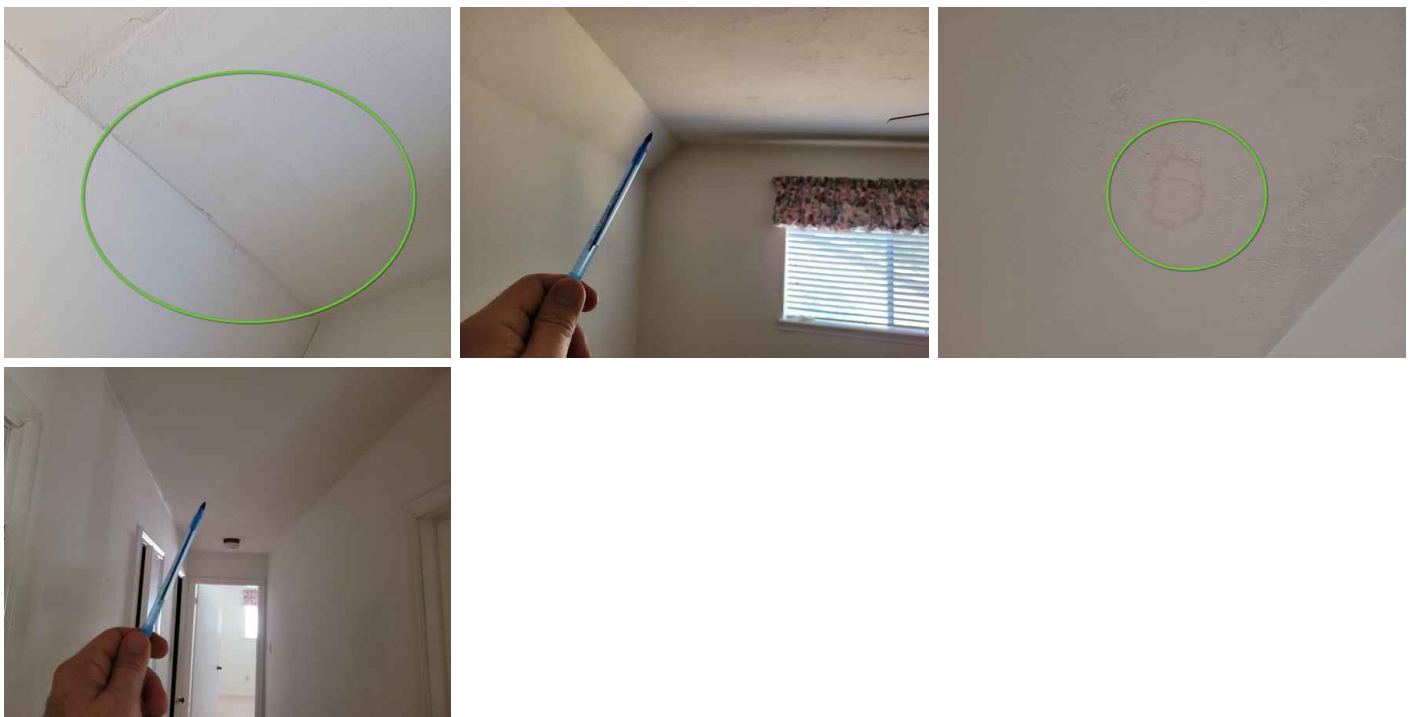

Roof Leaks: Attic stains appear to be from previous leaks

After observing the interior of the structure, evidences of current roof leaks were not visible. The absence of evidences of roof leaks does not guarantee that roof leaks were not present; rather, that no evidences of leaking were visible at the time of the inspection. Some stains were visible in the attic, but the stains appeared to be related to previous roof leaks. It is recommended that you check with the owner and/or a service company concerning the stains.

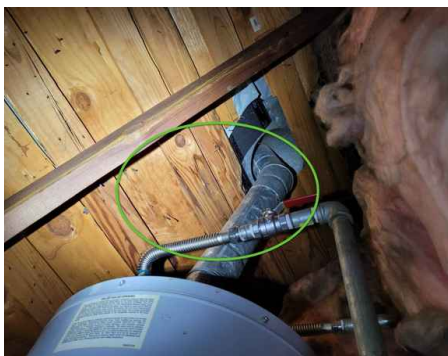

Limitations

Roof viewed from

LIMITATIONS OF ROOF INSPECTION

It is pointed out that our roof inspection is limited to viewing the surface of the roof from only those areas determined by the inspector to safely accessible at the time and conditions of the inspection. If the height of the roof, steepness of the pitch, or surface conditions due to wear or weather are such that the inspector determines that he cannot safely access some or all of the roof, then we will use a drone if possible (subject to weather limitations and/or No Fly Zones) to take photos of the surface of the roof. The roof will also be viewed from the underside of the roof, from the readily accessible attic access decking. For areas of the attic/roof that are not readily accessible from the safety of secure access decking, the inspector is not required to walk off the decking across the attic framing members to access all portions of the attic. Therefore, it is pointed out that there may be deficient roof conditions present in the attic that are not visible on the day of the inspection due to the limitations imposed on the inspector. This emphasizes the need and responsibility of the client to do further investigations with a roofing contractor to determine all deficiencies with the roof before any option period ends.

Recommendations/repair

5.8.1 Roof Details

ROOF JACKS

Lead - Fold Blocks Air Flow

The roof jacks at the plumbing vent pipes were observed to have the conditions as described above. Further investigation with a roofing contractor is recommended to make all needed repairs.

Obtain Cost Estimate



5.10.1 ROOF CONCLUSION

SERVICEABLE CONDITION - SOME REPAIRS NEEDED

The roof appears to be in generally serviceable condition at this time with some repairs needed for the item(s) shown above. Have a roofing contractor provide a cost estimate to make all necessary repairs to bring the roof into a completely serviceable condition.

Obtain Cost Estimate

6: STRUCTURAL FRAMING


Information

Framing Description: OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Framing Description: Two story house wood frame

The house was observed to be a two story wood frame structure that includes the standard major framing components, including wall framing and ceiling joists, and roof framing.

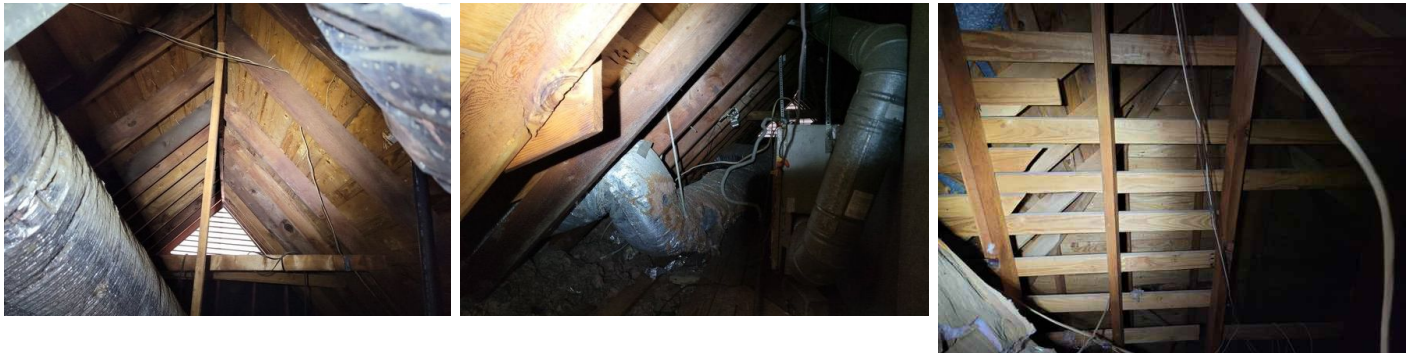

Attic Framing: Viewed from attic access walkway

The attic space was viewed only from the areas determined by the inspector to be safely accessible from the access walkway.

Attic Framing: Roof Framing Less than Current Standards

The roof framing in the attic was observed to be less than the current construction standards for roof framing. Typical differences between older structures and current code requirements can include purlins that are not the same size as the rafters; the vertical bracing for the purlins being spaced more than four feet apart; ridge beams not sized large enough for the miter cuts on the rafters, etc. However, the framing was adequate when the house/garage was constructed, and has performed satisfactorily these many years. Houses/garages that are built to previous code requirements are grandfathered, and are not required by the building code to be updated every time the code is revised.

Limitations

Framing Description

INACCESSIBLE FRAMING NOT VIEWED

It is pointed out that framing members in the wall, ceiling, floor, and/or roof that were covered with finish construction materials were not accessible and were not viewed at the time of the inspection. HEI performs limited, visual inspection in accordance with industry standards and does not remove finish construction materials to view framing members that are not readily accessible and viewable.

Recommendations/repair

6.2.1 Attic Framing

FIRESTOP MISSING BETWEEN GARAGE AND HOUSE

No firestop has been provided in the garage at the breezeway to prevent a fire from spreading between the garage and house.

Obtain Cost Estimate



6.5.1 Rafters

RAFTER NOT FLUSH ON RIDGE BEAM

We observed rafters that were separated at the top of the rafter, where the rafter meets the top ridge beam. Rafters should be flush against the ridge beam, and it is recommended that 3 foot make-up pieces be "sistered" onto the rafters, so that the make-up pieces are flush against the ridge. This will allow the rafters to bear against the ridge beam for the entire length of the miter cut on the rafter.

Obtain Cost Estimate



6.20.1 STRUCTURAL FRAMING CONCLUSION

REPAIRS NEEDED

The primary load carrying members of the structural framing that were accessible and viewed at the time of the inspection were generally functional with the exception of the item(s) listed above as in need of repair. Have a contractor determine the cause of the condition and confirm the scope of repairs needed, along with a cost estimate for all repairs.

Obtain Cost Estimate

7: WATER PENETRATION

Information

Water Penetration: OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Water Penetration: Moisture Meter - No High Readings

We checked around window and door openings, bathrooms, and other locations susceptible to moisture intrusion with a moisture meter, and found no evidence of elevated moisture at the time of the inspection.

Recommendations/repair

7.1.1 Water Penetration

WATER STAINS/WATER DAMAGE

2ND FLOOR WINDOWS SILLS

Evidences of water penetration to the interior of the structure were observed, including water stains and/or water damaged materials.

Further investigation is recommended with service companies to determine the source(s) of the water penetration along with any secondary damages, and also to provide a cost estimate for any needed repairs.

Obtain Cost Estimate



7.1.2 Water Penetration

VULNERABILITY TO WATER PENETRATION

Window sealants, Hose Bibb, Gas Line, Electrical Box, Electrical Disconnect, Piping

A substantial vulnerability to water penetration was observed at penetrations/openings through the exterior building envelope, and it is recommended that all penetrations/openings be sealed against water penetration. Typical examples on a structure may include light fixtures, air conditioning refrigerant lines, water piping, gas piping, vent caps, windows, doors, expansion joints, etc. Below is a representative sample of locations and/or photographs showing some, but not necessarily all, locations where there is a vulnerability to water penetration. Have a contractor provide a cost estimate to seal all vulnerable areas on the exterior building envelope against water penetration and/or open up any clogged weepholes in the veneer.

Obtain Cost Estimate



8: FIREPLACE/CHIMNEY

Information

FIREPLACE OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Masonry fireplace: Location


Family Room



Masonry fireplace: Description-Masonry Fireplace

Gas log lighter, Manual Gas Shut-off Valve

The fireplace was a masonry fireplace that vented up a chimney through the roof.

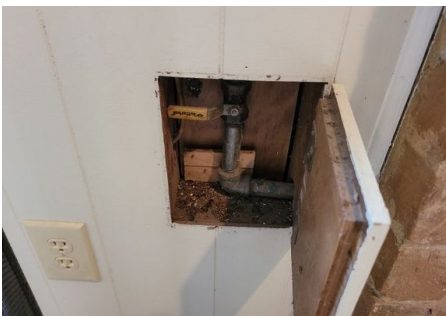

Masonry fireplace: Chimney flue not visible for entire flue

It should be noted that the inside of the chimney flue is not visible due to the construction of the chimney, and was not inspected. The chimney flue extends from just above the fireplace opening inside the house to the top of the chimney. If this a concern to you, we recommend that a fireplace service company be contacted.

Obtain Cost Estimate

Masonry fireplace: Damper Functional

The damper was operationally checked at the time of the inspection, and opened and closed properly, with no repairs needed to the operation of the damper.

Masonry fireplace: Log lighter functional

The gas log lighter was operationally checked, and was functional at the time of the inspection.

Recommendations/repair

8.2.1 Masonry fireplace

DAMPER - C CLAMP MISSING

The damper was not equipped with a C-Clamp device to prevent closing the damper completely to allow the hazardous combustion gases a path to escape up the chimney.

Obtain Cost Estimate



HEI file photo showing c-clamp in masonry fireplace




HEI file photo showing c-clamp in metal fireplace

8.2.2 Masonry fireplace

WEATHER CAP - MISSING

The top of the chimney flue did not have a spark arrester/weather cap installed in the flue to prevent water penetration down the chimney and bird entry into the chimney. Evidences of water penetration were visible at the firebox, where the firebrick was stained.

Obtain Cost Estimate

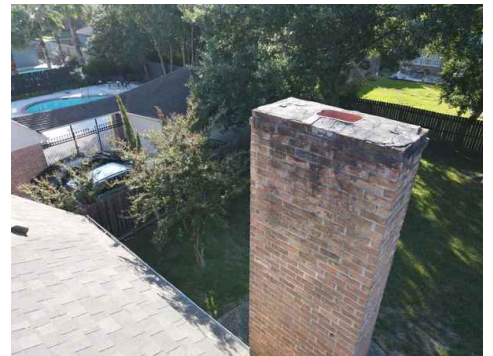

8.2.3 Masonry fireplace

DAMPER - SEVERELY RUSTED

The damper was severely rusted and difficult to operate. It should either be repaired, if possible, or replaced by a fireplace service company.

Obtain Cost Estimate




8.2.4 Masonry fireplace

GROUT MISSING - FIREBOX

Some of the grout was missing at the joint of the front wall of the firebox, which can be a fire hazard as it can allow the heat of the fire to enter the wall cavity, and it is recommended that the separation be properly filled with mortar.

Obtain Cost Estimate

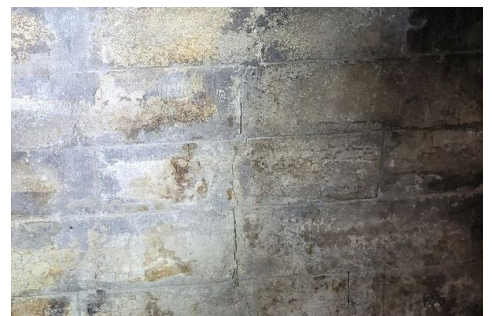

9: ATTIC


Information

OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Ladder: Original ladder - Not rated

The access ladder into the attic appeared to be the original installation ladder, and the ladder was not labeled to indicate the rated capacity of the ladder. The ladder does not meet current code requirements for ladders into attics. Consideration should be given to replacing the ladder with a ladder that meets current code requirements.

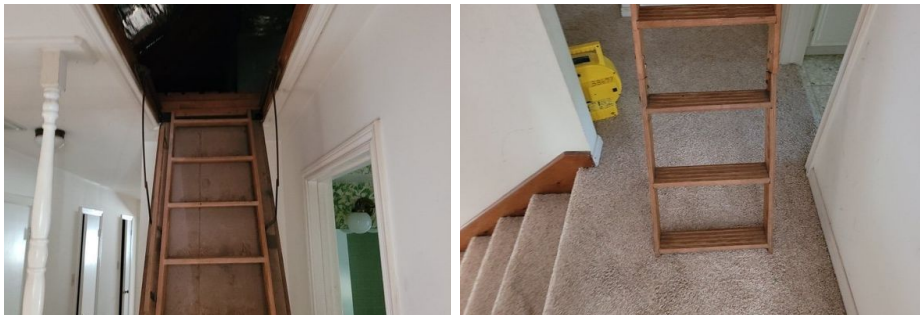

Viewed from attic decking

The attic was entered and was viewed from the access decking provided in the attic. It is pointed out that the inspector is not required to access areas of the attic without the safety of adequate walkway decking.

Roof Decking: Description

Plywood

The roof decking was observed from the attic space to be as described above.



Insulation: 10"-12" Blown-in

The insulation in the attic was average for the age of the house. The blown-in insulation appeared to be approximately 10-12" thick, which would be approximately an R30 energy rating. It is pointed out that the insulation requirements according to the latest standard for new houses in this area is an R38 energy rating.

Table 1102.1.1



Limitations

Attic Viewed From

ATTIC NOT ALL ACCESSIBLE

The entire attic space was not accessible from the decking provided, and if remote areas were viewed at all, it would be from the safety of the access decking. Note that it is our policy to not walk off the access decking nor climb over equipment to walk across framing members due to safety hazards and the potential for damaging equipment/ductwork and/or slipping off the framing members and falling through the ceiling. It is pointed out that there may be deficiencies in the attic and/or for the roof that were not viewed at the time of the inspection due to a lack of access walkway decking.

Recommendations/repair

9.1.1 Ladder

WEATHERSTRIPPING MISSING AT ATTIC ACCESS DOOR

The weatherstripping was missing around the access door. It is recommended that a foam rubber weatherstrip with a mastic backing be placed around the outer edge of the access door to prevent the energy loss from the conditioned air spaces.

Obtain Cost Estimate

9.1.2 Ladder

APPLIANCES IN ATTIC, NEED PULL DOWN LADDER

The attic space contained one or more appliances that require access for servicing and/or replacement, and a pull down stairway should be provided that is rated at a minimum of 350-pound capacity.

Obtain Cost Estimate

M1305.1.3 Appliances in attics

Attics containing appliances requiring access shall be provided with a pull down stairway with a clear opening not less than 22 inches in width and a load capacity of not less than 350 pounds and a clear and unobstructed passageway large enough to allow removal of the largest appliance, but not less than 30 inches (762 mm) high and 22 inches (559 mm) wide and not more than 20 feet (6096 mm) in length when measured along the centerline of the passageway from the opening to the appliance. The passageway shall have continuous solid flooring in accordance with Chapter 5 not less than 24 inches (610 mm) wide.

A level service space at least 30 inches (762 mm) deep and 30 inches (762 mm) wide shall be present along all sides of the appliance where access is required. The clear access opening dimensions shall be a minimum of 20 inches by 30 inches (508 mm by 762 mm), where such dimensions are large enough to allow removal of the largest appliance.

9.2.1 Service decking/platform decking

INADEQUATE WALKWAY AND/OR PLATFORM DECKING

The attic did not have adequate service decking to all the equipment in the attic. The service decking should be a continuous deck that is a minimum of 24 inches wide, that extends from the attic access opening to all equipment in the attic. The platform decking should be a continuous deck that is a minimum of 30 inches wide, that extends along all sides of the appliance where access is required. In addition, the decking should be free from any obstructions, such as gas lines, electrical wiring, ductwork, framing members, etc.

M1305.1.3**Obtain Cost Estimate**

10: EXTERIOR CLADDING

Information

Descriptions:

The materials, styles, and components present and observable at the time of the inspection are as follows:

Cladding Material

Brick Veneer, Wood



Brick/Stone Veneer: Eroded Brick - Monitor

West East

Some of the bricks were eroded slightly at various locations of the house. The degree of the erosion was not such that the bricks need to be repaired. The condition needs to be monitored in the future, and repairs made if the condition worsens.



Recommendations/repair

10.8.1 Wood Siding

UNSEALED VERTICAL JOINTS

The wood siding was unsealed at the vertical joints which can allow water to enter the living space and also to damage the ends of the siding. Have the vertical joints sealed.

Obtain Cost Estimate



11: EXTERIOR ITEMS

Information

OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Gates and Fences: Description

Wrought Iron fence/gate, Wood fence

We observed the following types of gates and/or fences at this property as described above.



Gates and Fences: Gates and Fences - No Repairs

The gates and fences were in generally good condition at the time of the inspection and no repairs were observed to be needed.

Recommendations/repair

11.1.1 Flatwork Concrete/Patios/Walkways

SIDEWALK

The sidewalk was uneven at the front of the house, and presents a tripping hazard.

Obtain Cost Estimate



11.1.2 Flatwork Concrete/Patios/Walkways

DRIVEWAY REPAIR

The driveway concrete was badly cracked, and the damaged portion presents a tripping hazard. It is recommended that a contractor be contacted to provide a cost estimate to make the needed repairs.

Obtain Cost Estimate



11.2.1 Gutters and Downspouts

GUTTERS

Debris, Screens missing

The gutters had item(s) in need of repair.

Obtain Cost Estimate

11.3.1 Gates and Fences

WOOD FENCE

Starting to rot

The wood fence was in need of some repairs.

Obtain Cost Estimate

11.4.1 Wood Rot

WOOD ROT

REAR

Fascia

We observed evidences of wood rot and it is recommended that all rotted wood be replaced. Have a contractor provide a cost estimate to determine the entire scope of the wood rot, and provide a cost estimate to replace all rotted wood in the house.

Obtain Cost Estimate



11.9.1 Miscellaneous Exteriors

PAINT - LINTELS

The metal lintels over the windows and doors in brick veneer were not painted or the lintels were rusting, and need to be painted. Have a contractor provide a cost estimate for repairs.

Obtain Cost Estimate



12: INTERIOR ITEMS

Information

OBSERVATIONS AND CONCLUSIONS

The following items were inspected, with our Observations and Conclusions noted.

Windows: Operational - No repairs

No items requiring repair were observed concerning the operation of the windows. The windows that were accessible at the time of the inspection were opening and closing properly.

Windows: Windows are Single Pane

The windows in the house were observed to be the original single pane windows.

Smoke alarms: Installed at some locations

Smoke alarms were observed to be installed at some of the required locations in the house as set forth in the 2012 International Residential Code. The current code gives the Locations required, the Power Source, and the Interconnectivity requirements.

R314.3 Location.

Smoke alarms shall be installed in the following locations:

1. In each sleeping room.
2. Outside each separate sleeping area in the immediate vicinity of the bedrooms.
3. On each additional story of the dwelling, including basements and habitable attics but not including crawl spaces and uninhabitable attics. In dwellings or dwelling units with split levels and without an intervening door between the adjacent levels, a smoke alarm installed on the upper level shall suffice for the adjacent lower level provided that the lower level is less than one full story below the upper level.

R314.4 Power source.

Smoke alarms shall receive their primary power from the building wiring when such wiring is served from a commercial source, and when primary power is interrupted, shall receive power from a battery. Wiring shall be permanent and without a disconnecting switch other than those required for overcurrent protection.

R314.5 Interconnection.

Where more than one smoke alarm is required to be installed within an individual dwelling unit in accordance with Section R314.3, the alarm devices shall be interconnected in such a manner that the actuation of one alarm will activate all of the alarms in the individual unit. Physical interconnection of smoke alarms shall not be required where listed wireless alarms are installed and all alarms sound upon activation of one alarm.

Limitations

Smoke alarms

SMOKE ALARMS NOT OPERATIONALLY CHECKED

We could not determine if the smoke alarms are connected to a security alarm system as is common practice, therefore, to avoid possibly triggering a security alarm we did not operationally check each device, nor did we check the interconnectivity of the alarms. For safety purposes, it is recommended that smoke detectors and carbon monoxide detectors be replaced every ten years.

Recommendations/repair

12.1.1 Doors

NON-LATCHING AT STRIKER PLATE

MASTER BEDROOM CLOSET 2ND FLOOR EAST BEDROOM WEST BEDROOM

We observed non-latching doors that were in need of adjustment to the striker plate on the door frame.

Obtain Cost Estimate

12.1.2 Doors

STICKING DOORS

MASTER BEDROOM MASTER BATH MASTER BEDROOM CLOSET

Doors were observed that were sticking and are in need of adjustment. Contact a service company to make the needed repairs.

Obtain Cost Estimate

12.1.3 Doors

"GHOST" DOORS

2ND FLOOR BATHROOM

We observed a "ghost" door that opens/closes by itself, and the door needs to be adjusted. Contact a service company to make the needed repairs.

Obtain Cost Estimate

12.1.4 Doors

GLASS NOT SAFETY GLASS

FRONT DOOR SIDES

The glass in the door was not marked as being safety glass as required. Contact a service company to make the needed repairs.

Obtain Cost Estimate

12.1.5 Doors

DAMAGED

FRONT DOOR

We observed a door(s) that was damaged, and needs to be replaced. Contact a service company to make the needed repairs.

Obtain Cost Estimate



12.1.6 Doors

DRAGS ON CARPET

2ND FLOOR NORTH BEDROOM HALLWAY

The door(s) was dragging on the carpet, and should be trimmed on the bottom. A one inch gap between the bottom of the door and the carpet is recommended to allow for proper air flow for the HVAC system.

Obtain Cost Estimate

12.3.1 Floor coverings

CARPET STAINED

FAMILY ROOM

The carpet was observed to be stained, and it is recommended that it be cleaned or replaced.

Obtain Cost Estimate



12.4.1 Stairs/Handrails/Guardrails

HANDRAIL NOT TERMINATED INTO WALL

The handrails for the stairway were not constructed according to the current building code standards, which is expected given the age of the house. Therefore, the ends of the handrails do not terminate into the wall, which could allow loose clothing or a purse or bag to catch on the open end, causing tripping and/or falling down the stairs.

311.7.8.2

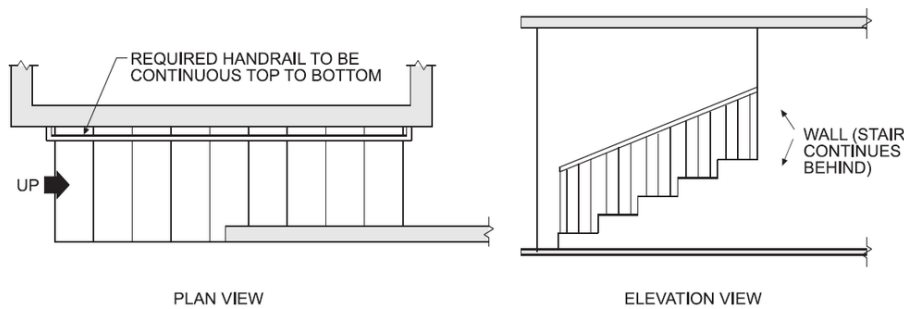


Figure R311.7.8.2
HANDRAILS

12.6.1 Carbon monoxide detector

MISSING

The house does not meet the current code concerning carbon monoxide alarms which can be a safety issue. If bringing the house up to current code standards is desired, the section below from the 2012 International Residential Code is the current requirements for carbon monoxide alarms in a home.

Obtain Cost Estimate**R315.1 Carbon monoxide alarms.**

For new construction, an approved carbon monoxide alarm shall be installed outside of each separate sleeping area in the immediate vicinity of the bedrooms in dwelling units within which fuel-fired appliances are installed and in dwelling units that have attached garages.

12.9.1 Wood rot interior

EXTENSIVE

MASTER BATH BEHIND TUB

Extensive wood rot was observed and it is recommended that the damaged wood be replaced. It is pointed out that additional damage could be present under the rotted material that will not be visible until the outer rotted materials are removed. Have a service company determine the entire scope of wood rot throughout the house, and provide a cost estimate to replace all rotted wood.

Obtain Cost Estimate

13: CLOSE

Information

CLOSE

Opinions and comments stated in this report are based on the apparent performance of the items included within the scope of the inspection, at the time of the inspection. Performance standards are based on the knowledge gained through the experience and professional studies of the inspector. There is no warranty or guarantee, either expressed or implied, regarding the habitability, future performance, life, merchantability, and/or need for repair of any item inspected. It is suggested that it would be a prudent thing to purchase a Home Warranty Policy to protect the appliances and equipment against unforeseen breakdowns during the first year and for preexisting conditions. It is recommended that you research various options available and protect yourself with a policy. Check with your agent for details and please read our comments concerning Home Warranty policies on page 4 of this report.

Items identified as being deficient and in need of repair along with our Recommendations are provided in the above report. Many, but not all, recommendations are highlighted in bold red text. It is our intention, and your responsibility, that you follow up on these deficiencies and recommendations as part of your due diligence by contacting the appropriate service contractor for **Further Investigation** and to **Obtain a cost estimate**. It is pointed out that other related and/or underlying conditions may be present, and which may not be apparent without further investigation. Items identified as being deficient and/or in need of repair along with our Recommendations are provided in the above report. Many, but not all, recommendations are highlighted in bold red text. It is our intention, and your responsibility, that you follow up on these deficiencies and recommendations as part of your due diligence by contacting the appropriate service contractor(s) for **Further Investigation, Obtain a cost estimate and/or Contact the Builder**. It is pointed out that other related and/or underlying conditions may be present, and which may not be apparent without further investigation by qualified service companies. It is emphasized how important it is for you if you intend to rely on our report(s), to continue to gather the in-depth information that will be obtained by further investigation with appropriate service technicians who will use their specialized knowledge of the component(s) and the related building codes along with their specialized diagnostic equipment to give you a **TOTAL PICTURE** of the condition of the property. Failure on your part to do your due diligence will constitute negligence on your part and result in an incomplete body of knowledge upon which you base your decisions regarding this property. We recommend that your further investigations be done before the expiration of your option period and before closing on the property.

We also recommend that you review the Service Agreement at the end of this report regarding any complaint concerning the inspection services provided pursuant to the service agreement, As agreed to, Client must notify HEI in writing of such complaint within ten (10) business days of the date of Client's actual discovery and thereafter allow a prompt reinspection of the item relating to the claimed condition. Client further agrees that client and he/she/it's agents, employees or independent contractors **will make no alterations, repairs or replacements to the item complained about prior to a reinspection by HEI as agreed above.**

As an additional service, we recommend using a new tool we have on our website that can quickly turn your inspection report into an easy-to-read estimate of repairs for a nominal fee. These pricing reports from a third party company called **RepairPricer** not only make the inspection report easy to understand in terms of dollars and cents, but they are also useful negotiation tools. Just visit the page below on our website and upload your report into **RepairPricer**. If you have any questions when you receive your report, you can contact them at info@repairpricer.com <http://www.heddermanengineering.com/repair-cost-estimates>

Thank you again for asking HEDDERMAN ENGINEERING, INC. to perform this inspection for you. If you have any questions after reviewing this report, please feel free to call the office. It is emphasized that the executed Service Agreement contract, which has been included at the end of this report, contains a provision under "Dispute Resolution" for you to contact HEI to resolve any disputes.

At your service,
 Kyle Kuhl
 Texas Licensed Professional Engineer #141672
 Texas Firm Number: 7942




14: RECEIPT PAGE

Information



HEDDERMAN ENGINEERING, INC.

www.heddermanengineering.com Office 281-355-9911 Fax 281-355-9903 office@heddermanengineering.com

10/05/2022

TO: June Chapman in C/O Debbie Cooper

REF: Inspection of the property at 11511 Olympia dr, HOUSTON, TX 77077.

Total cost of inspection: \$625.00

Total Paid: \$625.00

Total Due: - 0 -

15: SERVICE AGREEMENT

Information

For your records, following is the Service Agreement that you executed for this inspection.

HEDDERMAN ENGINEERING, INC.

Office: 281-355-9911 Fax: 281-355-9903

office@heddermanengineering.com www.heddermanengineering.com

Real Estate Inspection Service Agreement

NOTICE: THIS AGREEMENT IS INTENDED TO BE A LEGALLY BINDING CONTRACT - PLEASE READ IT CAREFULLY

NAME OF CLIENT(S): June Chapman in C/O Debbie Cooper

DATE OF INSPECTION: 10/05/2022

PROPERTY ADDRESS: 11511 Olympia dr, HOUSTON, TX 77077

Purpose of inspection

The purpose of the inspection is to view selected accessible components and/or systems, and to inform you, our client, of our observations and professional opinions from a NON-INVASIVE VISUAL SURVEY on whether or not those selected components and/or systems appear to be functioning on the day of the inspection, or appear to be in need of repair. Although this report may include observations of some building code violations, total compliance with structural, mechanical, plumbing, electrical codes, specifications, and/or legal requirements is specifically excluded. HEI does not perform Code inspections. Since building codes change every few years, our inspections are not done with the intention of bringing every item in the house into compliance with current code requirements. Rather, the standard of our inspections is a **PERFORMANCE STANDARD** to determine if the items inspected in the opinion of HEI appear to be functioning at the time of the inspection, or appear to be in need of repair. It is pointed out that other engineers/inspectors may have different opinions to those given in this report. It is also not our purpose to verify the adequacy and/or design of any component of the house, including the proper sizing and compatibility of HVAC, Electrical, and/or Plumbing components.

It is also not within the purpose and/or scope of this report to determine the insurability, habitability, merchantability, future performance, suitability of use, economic life span, or deferred maintenance issues, and/or issues unnamed in this report. This report is not an insurance policy, neither is it an express or implied warranty or guarantee as to future life and/or continued performance of the items inspected. Our inspection and report are intended to express HEI's perceived impression of the apparent performance of the inspected components and systems viewed on the date of the inspection. HEI's intent is to reduce your risk associated with this transaction, however we cannot eliminate all risk, nor assume your risk. Any items pointed out as in need of repair or further investigation should be evaluated by a qualified repair specialist or service company who should provide estimated repair costs **PRIOR TO CLOSING ON THE PROPERTY**. By accepting this agreement, the Client understands that the services provided by HEI are the types of services described in the Professional Services Exemption of the Texas Deceptive Trade Practices-Consumer Protection Act ("DTPA) and agrees that no cause of action exists under the DTPA related to the services provided.

It is recommended that you obtain as much history as is available concerning this property. This historical information may include copies of any seller's disclosures, previous inspection or engineering reports, building drawings and/or specifications, bids to perform repair work on the property, receipts from repair work that has been performed, reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should attempt to determine whether repairs, renovations, remodeling, additions or other such activities have taken place at this property.

Scope of inspection

The scope of the inspection includes limited, visual observations at the interior and exterior of the structure, the attic (if applicable) as viewed only from the areas determined by the inspector to be safely accessible, the underside of the house (if applicable) as viewed only from the crawlspace areas determined by the inspector to be safely accessible, and the roof as viewed from the ground and/or only from the locations on the roof **if the roof is determined by the inspector to be safely accessible**. Only those items **readily** accessible and visible at the time of the inspection will be viewed and included in this report. Any items causing visual obstruction, including, but not limited to, furniture, furnishings, floor or wall coverings, registers and grills on HVAC ductwork,, foliage, soil, appliances, stored items, insulation, etc., will not be moved or removed. Only those electrical outlets that are readily accessible will be operationally checked. Disassembly or removal of any portion of the structure, mechanical equipment, plumbing equipment, or electrical equipment is beyond the scope of this inspection.

The components of the property included, if applicable, in the scope of the inspection:

Structural:

Foundation, elevation survey including sketch of house and level readings, primary load-carrying framing members, roof surface, water penetration, grading and drainage, fireplace/chimney, and miscellaneous items related to the house.

Mechanical:

Air conditioning and heating systems, water heater, built-in appliances, and garage door opener.

Plumbing:

Water and gas supply lines that are visible, sinks, toilets, tubs, showers, visible drain lines, and vents.

Electrical:

Service entrance conductors, electric meter, distribution panel, visible wiring, light fixtures, switches, and accessible receptacle outlets.

Lawn Sprinkler:

Control panel, solenoid valves, backflow prevention device, visible piping, and sprayer heads.

Pool:

Basin, deck, waterline tiles, pumps, filters, piping, heater, timer, and electrical.

The following items, even if present in the subject property, are not inspected and do not constitute any part of the inspection services to be performed hereunder unless a specific notation is made on this report stating its condition:

Tainted and Corrosive drywall (Chinese Drywall), Clock Timers, Landscape Lighting, Sump Pumps, Wood Destroying Insects/Pests, Antennas, Environmental Hazards, Laundry Equipment, Water Filters, Geological faults/subsidence, Automatic Oven Cleaners, Fire Sprinklers System, Mold/Microbial, Water Wells, Mosquito Misting Systems, Buried/Concealed Plumbing, Fire/Smoke Alarm Systems, Septic Systems, Indoor Air Quality, Asbestos, Low Voltage and data Systems, Lights on Photo-cell/timers, Carbon Monoxide Alarms, and Water Softeners/Water Treatment systems/Reverse Osmosis systems with all related piping.

Reinspections:

HEI typically does not perform reinspections on the property. However, if we agree to return to the property, it is with the understanding that we are not certifying the adequacy of any repair work that has been done, and there will be an additional fee charged. This is also true for conditions that are beyond the control of the inspector and hinder the inspector during the inspection, such as inclement weather, lack of adequate access to attics, crawlspaces, or other areas, utilities that are off, non-functional equipment, etc. If a return trip to the house is requested to finish items that were not able to completed at the time of the originally scheduled inspection, then an additional fee will be charged.

Limitations of Inspection

A visual inspection method will generally produce a competent first impression assessment of the apparent performance of the structural, mechanical, plumbing, and electrical components, provided repairs have not been performed which would cover distress patterns normally produced by problems. Because the inspection procedure is visual only, and is not intended to be diagnostic and/or technically exhaustive, an inherent residual risk remains that undiscovered problems exist and/or future problems will develop.

This report is provided solely for the use of the person to whom this report is addressed, and is in no way intended or authorized to be used by a third party, who may have different requirements, and to whom we have not contracted with to perform an inspection. If a third party chooses to use this inspection report, they do so without HEI's permission or authorization, and they do so at their own risk.

Dispute Resolution

In the event of a complaint concerning the inspection services provided pursuant to this agreement, Client must notify HEI in writing of such complaint within ten (10) business days of the date of Client's actual discovery and thereafter allow a prompt re-inspection of the item relating to the claimed condition. Client further agrees that client and he/she/it's agents, employees or independent contractors **will make no alterations, repairs or replacements to the item complained about prior to a reinspection by HEI as agreed above**. You agree that failure to comply with

this procedure shall result in your express release of all claims Client may have against HEI, known and unknown, related to the item complained about and any related alleged act or omission by HEI.

LIMITATION OF LIABILITY: In any event the inspector fails to fulll the obligations under this agreement, CLIENTS EXCLUSIVE REMEDY AT LAW OR IN EQUITY AGAINST INSPECTOR IS LIMITED TO A MAXIMUM RECOVERY OF DAMAGES EQUAL TO THE INSPECTION FEE PAID HEREIN. CLIENT VOLUNTARILY AGREES TO WAIVE THEIR RIGHTS UNDER THE DECEPTIVE TRADE PRACTICES-CONSUMER PROTECTION ACT, SECTION 17.41 ET SEQ. BUSINESS & COMMERCE CODE. This limitation of liability applies to anyone, including client, who is damaged or has to pay expenses of any kind, including attorney fees and costs. Client assumes the risk of losses greater than the refund of the fee paid herein. Client acknowledges that this limitation of liability is reasonable in view of the relatively small fee that inspector charges for making the inspections when compared with the potential of exposure that inspector might otherwise incur in the absence of such limitation of liability, and that a much higher fee would be charged if the inspector were subject to greater liability.

Statute of Limitations

The parties agree that no claim, demand, or action, whether sounding in contract or in tort, may be brought to recover damages against HEI, or its officers, agents, or employees MORE THAN TWO YEARS AND ONE DAY AFTER THE DATE OF THE INSPECTION OR THE DATE ANY PURPORTED CAUSE OF ACTION ARISING OUT OF THE INSPECTION ACCRUES. TIME IS EXPRESSLY OF THE ESSENCE HEREIN. Client understands that this time period may be shorter that otherwise provided by law.

Acceptance of Report

By signing I confirm that I have read, understood, and agree to the above pre-inspection service agreement, and that I agree to be bound by these terms and conditions. In the absence of Client signing this service agreement prior to or at the time of the inspection, then acceptance of the report and/or payment for the inspection shall constitute agreement with all of the terms of this agreement. The report to be prepared by HEI shall be considered the final and exclusive findings of HEI regarding the inspection of the property which is the subject of this agreement. Client shall not rely on any oral statements made by HEI or its representatives prior to issuance of the printed report.

NOTE: IF THE INSPECTION IS CANCELLED LESS THAN ONE FULL BUSINESS DAY BEFORE THE SCHEDULED TIME, INCLUDING SATURDAYS, SUNDAYS, AND/OR HOLIDAYS, THE CLIENT WILL BE CHARGED ½ OF THE ORIGINAL INSPECTION FEE AND AGREES TO PAY SUCH PENALTY FEE. IF THE INSPECTION IS CANCELLED LESS THAN ONE HOUR BEFORE THE SCHEDULED TIME OF THE INSPECTION, THE CLIENT WILL BE CHARGED THE FULL INSPECTION FEE.



I HAVE READ AND ACCEPT THIS AGREEMENT