

With regards to the inspection to this property there is extensive damage done to the interior of the house with electrical fixtures having been ripped out of the wall and junction box's . The furnace wiring and the AC wiring appear to be as it was when the house was built. The main panel is undisturbed but is not labeled. The sub panel is has the feed for the pool and the fountain, this panel is overloaded and the wired feeding this is undersized .

I am comfortable with turning everything off and turning on the furnace circuits and the AC furnace . The sub panel will need to will to be refeed ,the pool equipment on the sub panel is labeled .

The cost to identify and energize the furnace circuits and AC circuits as well as refeed the subpanel \$800