



PROPERTY INSPECTION REPORT FORM

| | |
|---------------------------------------------------------------------------------------|-----------------------------------------|
| LRES CORP <i>Name of Client</i> | 07/20/2022 <i>Date of Inspection</i> |
| 3300 Pebblebrook Drive 23, Seabrook, TX 77586 <i>Address of Inspected Property</i> | |
| Dan Romero <i>Name of Inspector</i> | 5674 <i>TREC License #</i> |
| <i>Name of Sponsor (if applicable)</i> | <i>TREC License #</i> |

PURPOSE OF INSPECTION

A real estate inspection is a visual survey of a structure and a basic performance evaluation of the systems and components of a building. It provides information regarding the general condition of a residence at the time the inspection was conducted. *It is important* that you carefully read ALL of this information. Ask the inspector to clarify any items or comments that are unclear.

RESPONSIBILITY OF THE INSPECTOR

This inspection is governed by the Texas Real Estate Commission (TREC) Standards of Practice (SOPs), which dictates the minimum requirements for a real estate inspection.

The inspector IS required to:

- use this Property Inspection Report form for the inspection;
- inspect only those components and conditions that are present, visible, and accessible at the time of the inspection;
- indicate whether each item was inspected, not inspected, or not present;
- indicate an item as Deficient (D) if a condition exists that adversely and materially affects the performance of a system or component **OR** constitutes a hazard to life, limb or property as specified by the SOPs; and
- explain the inspector's findings in the corresponding section in the body of the report form.

The inspector IS NOT required to:

- identify all potential hazards;
- turn on decommissioned equipment, systems, utilities, or apply an open flame or light a pilot to operate any appliance;
- climb over obstacles, move furnishings or stored items;
- prioritize or emphasize the importance of one deficiency over another;
- provide follow-up services to verify that proper repairs have been made; or
- inspect systems or components listed under the optional section of the SOPs (22 TAC 535.233).

RESPONSIBILITY OF THE CLIENT

While items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions, in the event that any further evaluations are needed, it is the responsibility of the client to obtain further evaluations and/or cost estimates from qualified service professionals regarding any items reported as Deficient (D). It is recommended that any further evaluations and/or cost estimates take place prior to the expiration of any contractual time limitations, such as option periods.

Please Note: Evaluations performed by service professionals in response to items reported as Deficient (D) on the report may lead to the discovery of additional deficiencies that were not present, visible, or accessible at the time of the inspection. Any repairs made after the date of the inspection may render information contained in this report obsolete or invalid.

REPORT LIMITATIONS

This report is provided for the benefit of the named client and is based on observations made by the named inspector on the date the inspection was performed (indicated above).

ONLY those items specifically noted as being inspected on the report were inspected.

This inspection IS NOT:

- a technically exhaustive inspection of the structure, its systems, or its components and may not reveal all deficiencies;
- an inspection to verify compliance with any building codes;
- an inspection to verify compliance with manufacturer's installation instructions for any system or component and DOES NOT imply insurability or warrantability of the structure or its components.

NOTICE CONCERNING HAZARDOUS CONDITIONS, DEFICIENCIES, AND CONTRACTUAL AGREEMENTS

Conditions may be present in your home that did not violate building codes or common practices in effect when the home was constructed but are considered hazardous by today's standards. Such conditions that were part of the home prior to the adoption of any current codes prohibiting them may not be required to be updated to meet current code requirements. However, if it can be reasonably determined that they are present at the time of the inspection, the potential for injury or property loss from these conditions is significant enough to require inspectors to report them as Deficient (D). Examples of such hazardous conditions include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices and arc-fault devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

Please Note: items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions. The decision to correct a hazard or any deficiency identified in an inspection report is left up to the parties to the contract for the sale or purchase of the home.

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR



Home Inspection Report

Prepared exclusively for
LRES CORP



PROPERTY INSPECTED:
3300 Pebblebrook Drive
23
Seabrook, TX 77586

DATE OF INSPECTION: 07/20/2022
Inspection No. 521097-919

INSPECTED BY:

Dan Romero
2107 Plantation Dr.
Richmond, TX 77406
dan.romero@pillartopost.com
(832) 612-4349

INSPECTOR:

Dan Romero
Lic.#: 5674
dan.romero@pillartopost.com
(832) 612-4349

Each office is independently owned and operated

| | | | |
|----------------------|---------------------------|-------------------------|----------------------|
| I = Inspected | NI = Not Inspected | NP = Not Present | D = Deficient |
| I | NI | NP | D* |

REPORT SUMMARY

I. STRUCTURAL SYSTEMS

E. Walls (Interior and Exterior)

Comments:

• **INTERIOR WALLS**

Observed missing and damaged base boards at various areas.

Observed hairline cracks at the left bedroom walls.

Observed missing and damaged gypsum wall board at the laundry room and hall closet.

Repairs and corrections are required and advised.

• **Observed outside closet full of debris.**

In need of cleaning out.

F. Ceilings and Floors

Comments:

• **CEILINGS**

Observed small hole at bedroom on right side.

Repairs and corrections are required and advised.

• **FLOORS**

Observed missing floor covering throughout home.

Observed debris, furniture and trash along floors at various areas.

Repairs, corrections and cleaning is required and advised.

G. Doors (Interior and Exterior)

Comments:

• **EXTERIOR DOORS**

Observed damaged door casing around front entry door.

The door was also sticking and hard to operate.

The glass patio door lock was inoperable.

The screen door was missing at patio door.

Repairs and corrections are required and advised.

H. Windows

Comments:

• **The windows were single pane glass units.**

Observed damaged window next to chimney

Observed missing screen at left bedroom.

Observed loose and weak spring supports at the right side bedroom window.

Repairs and corrections are recommended and advised.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

J. Fireplaces and Chimneys

Comments:

- The home was equipped with a wood burning fireplace. The spark screen was functioning as designed. The fire box appeared to be in satisfactory condition. Hearth extension was adequate.

In need of cleaning and service checkup by a qualified chimney sweep specialist.

K. Porches, Balconies, Decks, and Carports

Comments:

- PATIO
Observed stored debris and trash along the patio area. Corrections and cleaning are required and advised.

L. Other

Comments:

- FRONT ENTRY COVERING
Observed damaged porch covering structure from upstairs unit at the entry door area.
Repairs and corrections are recommended and advised by a qualified contractor specialist.

II. ELECTRICAL SYSTEMS

A. Service Entrance and Panels

Comments:

- MAIN BREAKER PANEL
NAME: FEDERAL PACIFIC
LOCATION : EXTERIOR
The main beaker distribution panel has the service entrance wires routed underground, 110-220 volt service with copper conductors using breakers. MAIN SHUT OFF DISCONNECT : 100Amps
At the time of the inspection the breaker distribution box was located but deficiencies were observed including the following.
The panel was a FEDERAL PACIFIC panel which are no longer allowed due to fire hazards.
The 6 awg. copper grounding conductor to connected to the grounding rod could not be verified.
Panel board dead front cover was not labeled properly to identify each breaker slot as required.
Observed missing Anti-oxidant along the main lug terminals.
Observed over exposed conductor at the main electrical supply line.
Arc fault protection breakers were not observed at the required locations.
Observed missing screws at the dead front cover plate.
Repairs and corrections are required by a licensed electrician.

| I = Inspected | NI = Not Inspected | NP = Not Present | D = Deficient | |
|----------------------------------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| I | NI | NP | D* | |
| <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <p>B. Branch Circuits, Connected Devices, and Fixtures <i>Comments:</i></p> <ul style="list-style-type: none"> • NOTICE <p>At the time if the inspection the electrical utility was not connected and so the branch circuits could not be properly inspected or tested. Observed missing light fixture globe at the hall area. Observed missing cover at lighting fixture in left bathroom . Observed missing covers at the bathroom exhaust vents. Observed missing and smoker detectors older than 10 years . (As per manufacturer, Any detector ten years or older is required to be replaced heater they are functioning or not.) Smoke detectors are required in every bedroom and hall areas. Further evaluation, Repairs and corrections are required and advised by a licensed electrician.</p> |
| III. HEATING, VENTILATION, AND AIR CONDITIONING SYSTEMS | | | | |
| <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <p>A. Heating Equipment <i>Comments:</i></p> <ul style="list-style-type: none"> • At the time of the inspection the electrical utility was not connected and so the heating equipment could not be properly inspected or tested. Repairs and corrections are required by a licensed HVAC Company. |
| <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <input checked="" type="checkbox"/> | <p>B. Cooling Equipment <i>Comments:</i></p> <ul style="list-style-type: none"> • It appears that the condensing unit had been removed and was missing. Not present. Not inspected. |
| IV. PLUMBING SYSTEMS | | | | |
| <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <p>A. Plumbing Supply, Distribution Systems and Fixtures <i>Comments:</i></p> <ul style="list-style-type: none"> • The plumbing system appears to be tied with the city water supply system. The supply water system appears to be Copper plumbing. At the time of the inspection the home appears to have been winterized and the water utility was not turned on. Therefore, the plumbing system and appliances could not be properly inspected or tested. <p>Further evaluation, repairs and corrections are required by a licensed specialist.</p> <ul style="list-style-type: none"> • LAUNDRY ROOM No water Not inspected or tested, but exposed plumbing was observed. Further evaluation, repairs and corrections are required by a licensed plumber specialist. • KITCHEN Observed missing knob and damaged cabinet covers. Observed exposed plumbing under sink cabinet. Repairs and corrections are recommended and advised. |

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

- LEFT SIDE BATHROOM
No water, Not inspected or tested.
Observed damaged flooring under sink cabinet .
Observed missing shower head.
Further evaluation, repairs and corrections are required by a qualified contractor specialist.
- RIGHT SIDE BATHROOM
No water, not inspected, or tested.
Observed missing tub stopper.
Observed chipped tub surface.
Repairs and corrections are required by a qualified contractor specialist.

V. APPLIANCES

A. Dishwasher

Comments:

- There was not water or electrical utilities, and so the unit could not be properly inspected or tested.
Observed standing water in the unit.
Further evaluation, repairs and corrections are required by a licensed specialist.

C. Range Hood and Exhaust Systems

Comments:

- There was no electrical utilities, and so the unit could not be properly inspected or tested.
Observed standing water in the unit.
Further evaluation, repairs and corrections are required by a licensed specialist.

D. Ranges, Cooktops, and Ovens

Comments:

- There was no electrical utilities on, and so the unit could not be properly inspected or tested.
Observed missing Handle at front panel.
Observed missing anti tipping devise behind unit as required to avoid tip-over.
Improper clearance was observed to the right side of the unit. (Minimum clearance from the edge of burners to combustible materials is 6” inches.)
(Overheating and damage, with a potential for fire to occur is present.)
Further evaluation, repairs and corrections are required by a licensed specialist.

H. Dryer Exhaust Systems

Comments:

- Observed clogged and dirty exhaust dryer vent.
In need of cleaning by a professional contractor.

| | | | |
|----------------------|---------------------------|-------------------------|----------------------|
| I = Inspected | NI = Not Inspected | NP = Not Present | D = Deficient |
| I | NI | NP | D* |

INSPECTION REPORT

I. STRUCTURAL SYSTEMS

| | | | |
|-------------------------------------|--------------------------|--------------------------|--------------------------|
| <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
|-------------------------------------|--------------------------|--------------------------|--------------------------|

A. Foundations

Type of Foundation(s): Slab on grade

Comments:

• **PERFORMANCE:**

The serviceability and usability of the foundation were found to be satisfactory on the day of the inspection.

No structural repairs or deficiencies were observed.

NOTE: The inspection performed was a very limited visual inspection at accessible areas only. The foundation was part of a larger structure, where all areas were not visible.

The inspection performed cannot predict future movement and settlement or warrant the stability of the foundation flooring from a single observation.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

• SLAB ON GROUND foundations are the most common type of foundation in the Greater Houston Area for residential foundations. When supported by active or expansive soils, this type of foundation will frequently deflect enough to result in cosmetic damage (usually sheet-rock, brick veneer cracking and floor tile cracking) and possibly some minor functional problems such as sticking doors. Any owner of a building founded on a slab-on-ground foundation should be prepared to accept a degree of cosmetic distress and minor functional problems due to foundation movement.

The foundation was inspected for any unusual or abnormal signs of structural movement or settling including items listed below. The exterior slab surface was inspected for surface problems including exposed rebar, exposed cable ends, cracks in corners and obstructions or areas where slab was not visible.

PERFORMANCE OPINION:

(An opinion on performance is mandatory)

Note: Weather conditions, drainage, leakage and other adverse factors are able to effect structures, and differential movements are likely to occur. The inspector's opinion is based on visual observations of accessible and unobstructed areas of the structure at the time of the inspection. Future performance of the structure cannot be predicted or warranted.

SUGGESTED FOUNDATION MAINTENANCE & CARE - Proper drainage and moisture maintenance to all types of foundations due to the expansive nature of the area load bearing soils. Drainage must be directed away from all sides of the foundation with grade slopes. In most cases, floor coverings and/or stored articles prevent recognition of signs of settlement - cracking in all but the most severe cases. It is important to note, this was not a structural engineering survey nor was any specialized testing done of any sub-slab plumbing systems during this limited visual inspection, as these are specialized processes requiring excavation.

In the event that structural movement is noted, client is advised to consult with a Structural Engineer who can isolate and identify causes, and determine what corrective steps, if any, should be considered to either correct and/or stop structural movement.

B. Grading and Drainage

Comments:

• **PERFORMANCE:**

Observed proper drainage established and sloping away from the foundation and at least 4 to 6 inches below the siding or brick veneer walls.

No repairs are recommended at this time.

C. Roof Covering Materials

Comments:

• Not present. Not inspected.

Not applicable, since this unit was located at the first level with another unit above it.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

D. Roof Structures and Attics

Comments:

- Not present. Not inspected.
- Not applicable, since this unit was located at the first level with another unit above it.


E. Walls (Interior and Exterior)

Comments:

- EXTERIOR WALLS
- The exterior wall finish was stucco with wood board siding and trim.
The wall structure was conventional wood framing.
No structural deficiencies were observed.

NOTICE

The exterior wall structure was part of a larger building.

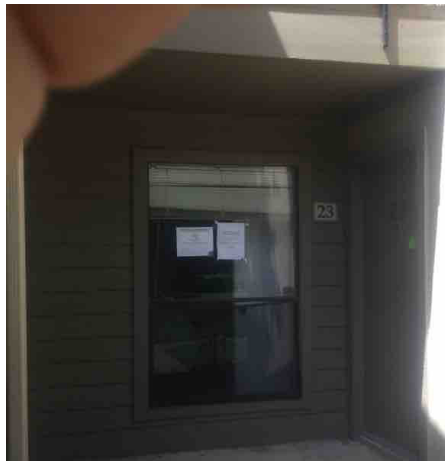

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*






• INTERIOR WALLS

Observed missing and damaged base boards at various areas.

Observed hairline cracks at the left bedroom walls.




Observed missing and damaged gypsum wall board at the laundry room and hall closet.

Repairs and corrections are required and advised.

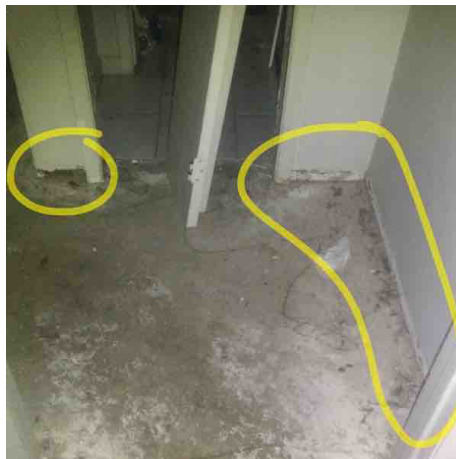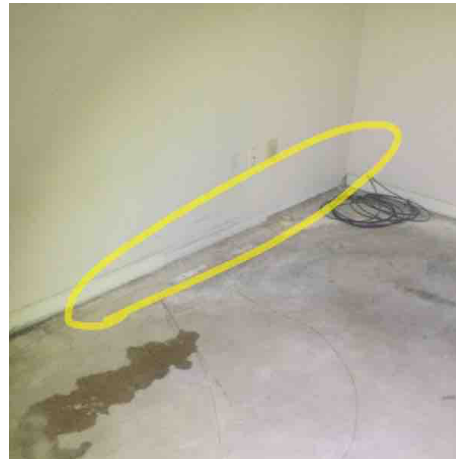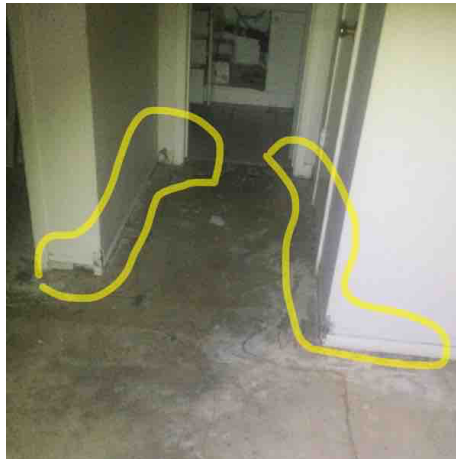


I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

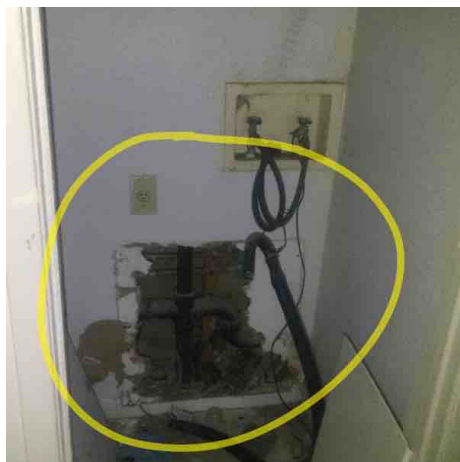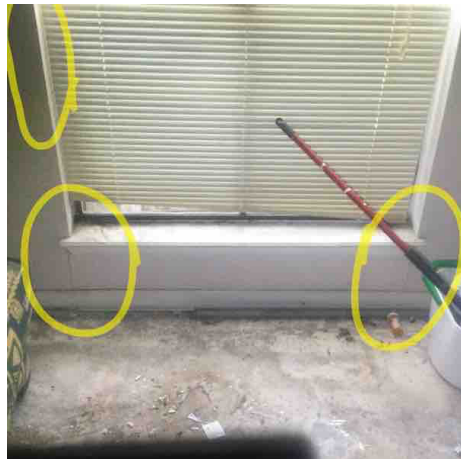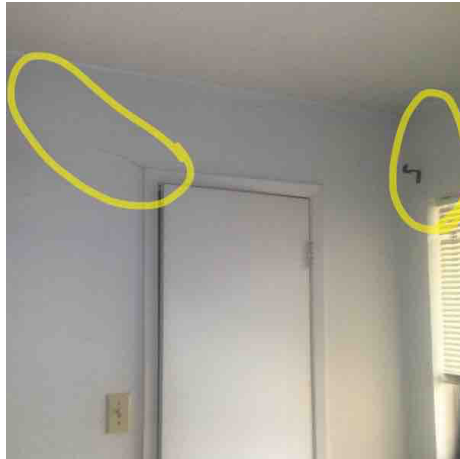

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

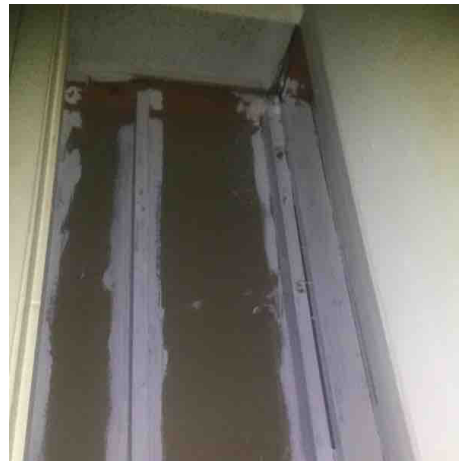

• **Observed outside closet full of debris.
In need of cleaning out.**




F. Ceilings and Floors

Comments:

• **CEILINGS**

**Observed small hole at bedroom on right side.
Repairs and corrections are required and advised.**

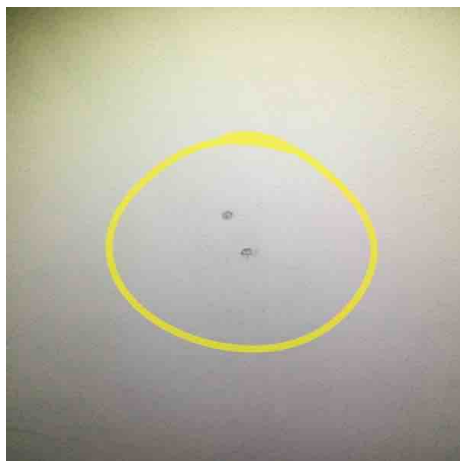

I = Inspected NI = Not Inspected NP = Not Present D = Deficient




I NI NP D*

• FLOORS

Observed missing floor covering throughout home.


Observed debris, furniture and trash along floors at various areas.

Repairs, corrections and cleaning is required and advised.

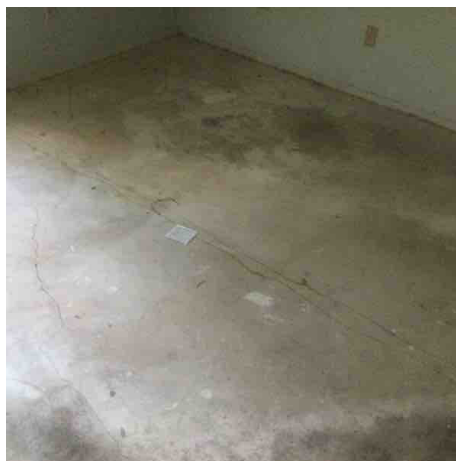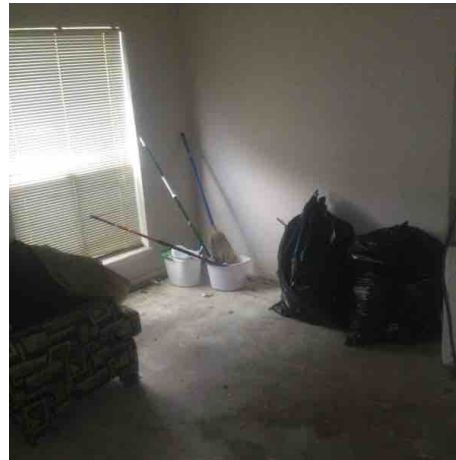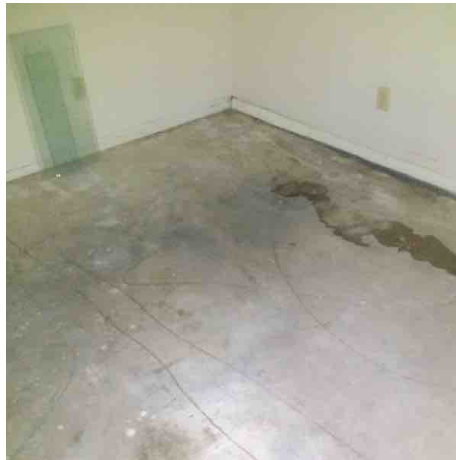

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

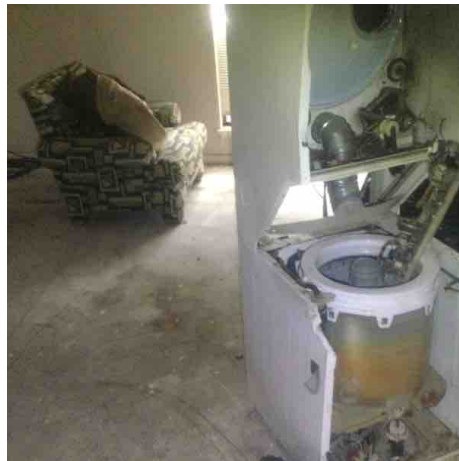

G. Doors (Interior and Exterior)

Comments:

• **EXTERIOR DOORS**


Observed damaged door casing around front entry door.

The door was also sticking and hard to operate.

The glass patio door lock was inoperable.

The screen door was missing at patio door.

Repairs and corrections are required and advised.

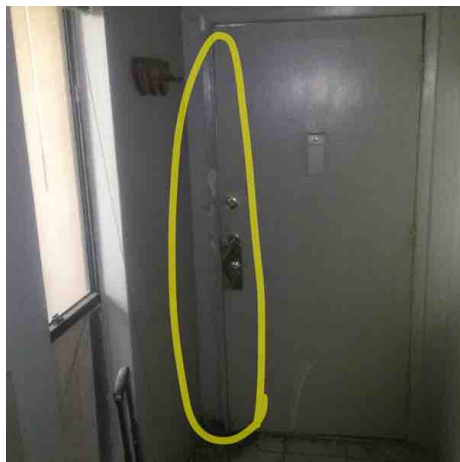




I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

H. Windows

Comments:

- The windows were single pane glass units.
 - Observed damaged window next to chimney
 - Observed missing screen at left bedroom.
 - Observed loose and weak spring supports at the right side bedroom window.
- Repairs and corrections are recommended and advised.

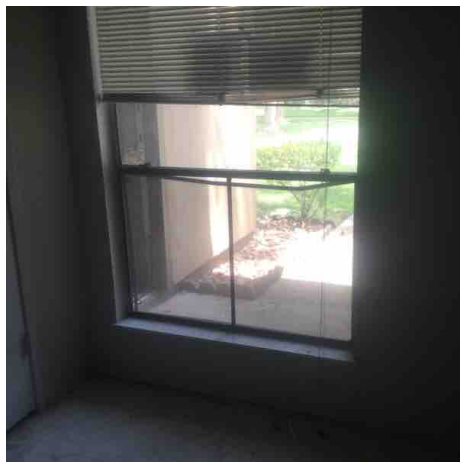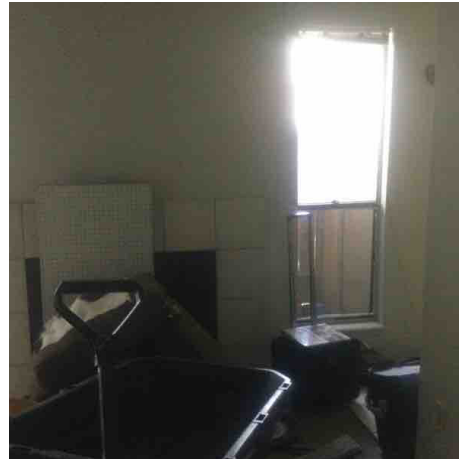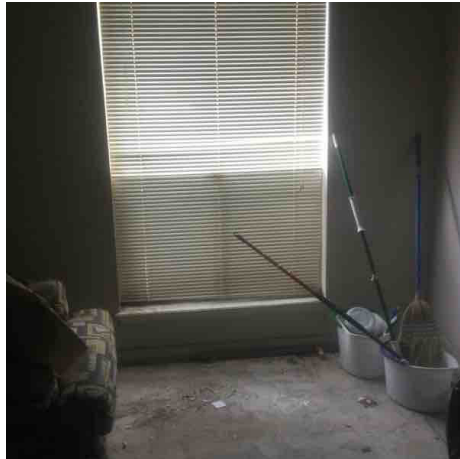

I. Stairways (Interior and Exterior)

Comments:

- Not present.

J. Fireplaces and Chimneys

WOOD BURNING ONLY

Comments:

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

- The home was equipped with a wood burning fireplace. The spark screen was functioning as designed. The fire box appeared to be in satisfactory condition. Hearth extension was adequate.

In need of cleaning and service checkup by a qualified chimney sweep specialist.



I = Inspected NI = Not Inspected NP = Not Present D = Deficient


I NI NP D*

K. Porches, Balconies, Decks, and Carports

Comments:

• PATIO

**Observed stored debris and trash along the patio area.
Corrections and cleaning are required and advised.**

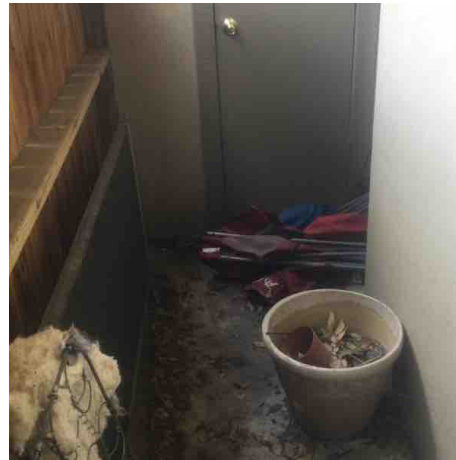


L. Other

Comments:

• FRONT ENTRY COVERING

**Observed damaged porch covering structure from upstairs unit at the entry door area.
Repairs and corrections are recommended and advised by a qualified contractor specialist.**

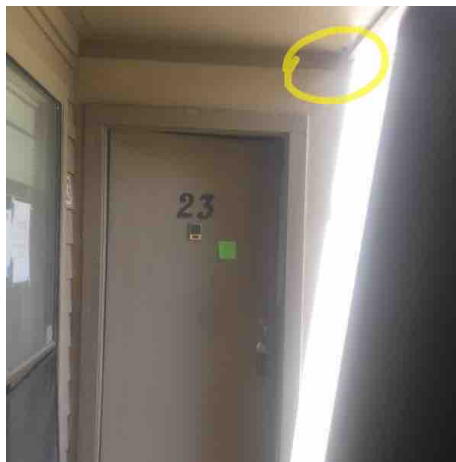

II. ELECTRICAL SYSTEMS

A. Service Entrance and Panels

⊙ COPPER

Comments:

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

**• MAIN BREAKER PANEL
NAME: FEDERAL PACIFIC
LOCATION : EXTERIOR**

The main beaker distribution panel has the service entrance wires routed underground, 110-220 volt service with copper conductors using breakers.

MAIN SHUT OFF DISCONNECT : 100Amps

At the time of the inspection the breaker distribution box was located but deficiencies were observed including the following.

The panel was a FEDERAL PACIFIC panel which are no longer allowed due to fire hazards.

The 6 awg. copper grounding conductor to connected to the grounding rod could not be verified.

Panel board dead front cover was not labeled properly to identify each breaker slot as required.


Observed missing Anti-oxidant along the main lug terminals.

Observed over exposed conductor at the main electrical supply line.

Arc fault protection breakers were not observed at the required locations.

Observed missing screws at the dead front cover plate.

Repairs and corrections are required by a licensed electrician.

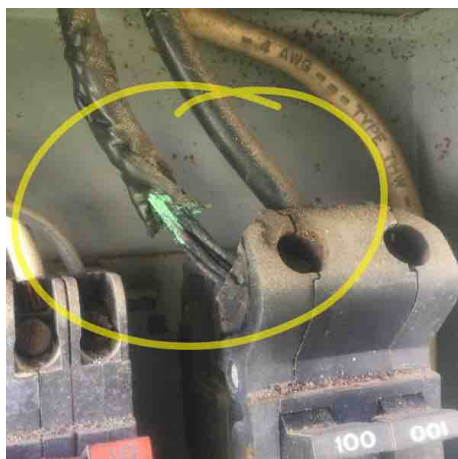

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

B. Branch Circuits, Connected Devices, and Fixtures

Comments:

• NOTICE

At the time if the inspection the electrical utility was not connected and so the branch circuits could not be properly inspected or tested.

Observed missing light fixture globe at the hall area.

Observed missing cover at lighting fixture in left bathroom .

Observed missing covers at the bathroom exhaust vents.

Observed missing and smoker detectors older than 10 years .

(As per manufacturer, Any detector ten years or older is required to be replaced heater they are functioning or not.)

Smoke detectors are required in every bedroom and hall areas.

Further evaluation, Repairs and corrections are required and advised by a licensed electrician.



I = Inspected NI = Not Inspected NP = Not Present D = Deficient


I NI NP D*

III. HEATING, VENTILATION, AND AIR CONDITIONING SYSTEMS

A. Heating Equipment

Comments:

- At the time of the inspection the electrical utility was not connected and so the heating equipment could not be properly inspected or tested. Repairs and corrections are required by a licensed HVAC Company.

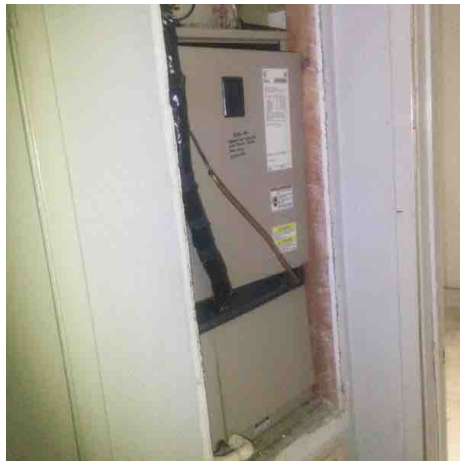

B. Cooling Equipment

Comments:

- It appears that the condensing unit had been removed and was missing. Not present. Not inspected.



I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

C. Duct Systems, Chases, and Vents

Comments:

- All visible ductwork appears to be connected and functioning properly. Observed missing replaceable air return filters. 1-16x25x1 Replacement is required.

Note,

It is always recommended to change out the filters regularly or monthly and as specified by the air-conditioning manufacturer to keep unit functioning ideally. Regular filter change will help unit function efficiently and may prolong the life expectancy of the unit.



IV. PLUMBING SYSTEMS

A. Plumbing Supply, Distribution Systems and Fixtures

Comments:

- **The plumbing system appears to be tied with the city water supply system.**

The supply water system appears to be Copper plumbing.

At the time of the inspection the home appears to have been winterized and the water utility was not turned on.

Therefore, the plumbing system and appliances could not be properly inspected or tested.

Further evaluation, repairs and corrections are required by a licensed specialist.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient


I NI NP D*

• LAUNDRY ROOM

No water

Not inspected or tested, but exposed plumbing was observed.

Further evaluation, repairs and corrections are required by a licensed plumber specialist.

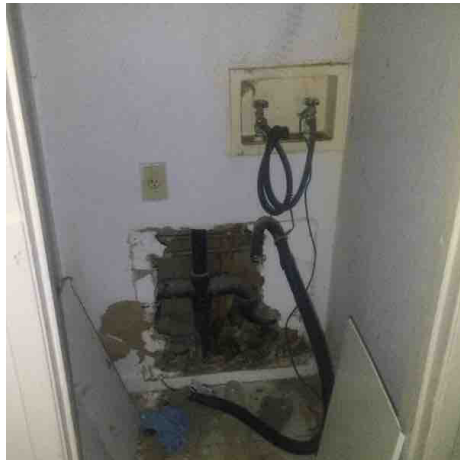

• KITCHEN

Observed missing knob and damaged cabinet covers.

Observed exposed plumbing under sink cabinet.

Repairs and corrections are recommended and advised.




I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*



• LEFT SIDE BATHROOM
No water, Not inspected or tested.
Observed damaged flooring under sink cabinet .
Observed missing shower head.
Further evaluation, repairs and corrections are required by a qualified contractor specialist.

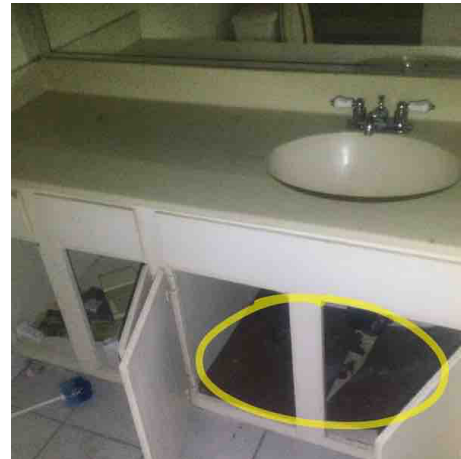

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*


• RIGHT SIDE BATHROOM

No water, not inspected, or tested.

Observed missing tub stopper.

Observed chipped tub surface.

Repairs and corrections are required by a qualified contractor specialist.

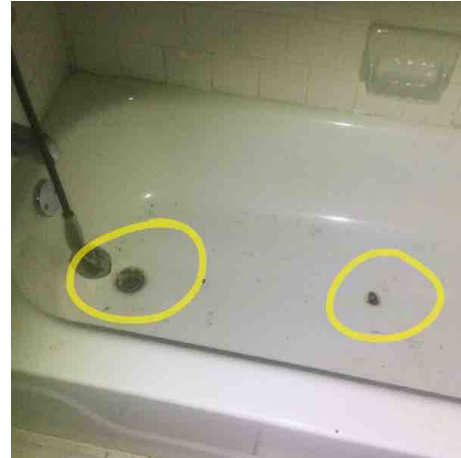

B. Drains, Wastes, and Vents

Comments:

- The sewer clean-out was not located.

Notice: The clean-outs are necessary and serve as an access to allow for people to clean out blockage in the sewer piping lines.

Further evaluation and corrections are recommended and advised.

C. Water Heating Equipment

Comments:

- Not present.

Not located.

The home appears to be using a larger shared water heating system that was not located with in the home.

Client should consult further with seller to determine functionality.

D. Hydro-Massage Therapy Equipment

Comments:

- Not present.

E. Other

Comments:

- Not present.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

V. APPLIANCES

A. Dishwasher

Comments:

- There was not water or electrical utilities, and so the unit could not be properly inspected or tested.

Observed standing water in the unit.

Further evaluation, repairs and corrections are required by a licensed specialist.



B. Food Waste Disposers

Comments:

- Not present.

C. Range Hood and Exhaust Systems

Comments:

- There was no electrical utilities, and so the unit could not be properly inspected or tested.

Observed standing water in the unit.

Further evaluation, repairs and corrections are required by a licensed specialist.



I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

D. Ranges, Cooktops, and Ovens

Comments:

- There was no electrical utilities on, and so the unit could not be properly inspected or tested.
- Observed missing Handle at front panel.
- Observed missing anti tipping devise behind unit as required to avoid tip-over.
- Improper clearance was observed to the right side of the unit. (Minimum clearance from the edge of burners to combustibile materials is 6” inches.)
- (Overheating and damage, with a potential for fire to occur is present.)
- Further evaluation, repairs and corrections are required by a licensed specialist.



E. Microwave Ovens

Comments:

- Not present.

F. Mechanical Exhaust Vents and Bathroom Heaters

Comments:

- Not tested, not inspected.

G. Garage Door Operators

Comments:

- Not present.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D*

H. Dryer Exhaust Systems

Comments:

- Observed clogged and dirty exhaust dryer vent. In need of cleaning by a professional contractor.



I. Other

Comments:

- NOT PRESENT.

VI. OPTIONAL SYSTEMS

A. Landscape Irrigation (Sprinkler) Systems

B. Swimming Pools, Spas, Hot Tubs and Equipment

C. Outbuildings

D. Private Water Wells

E. Private Sewage Disposal Systems

F. Other

G. Outdoor Cooking Equipment

⊙ NOT INSPECTED

H. Gas Lines

⊙ NOT INSPECTED



Inspection #: 521097-919