

Hilsher Group LLC

Inspection Report

Gabrielle Wells

Property Address: 3831 Supremes Trl Spring TX 77386



Hilsher Group LLC

Reevis Coleman Schultz Texas Professional Home Inspector #21983 701 N Loop 336E Conroe ,Texas 77301

PROPERTY INSPECTION REPORT

Prepared For:	Gabrielle Wells	
_	(Name of Client)	
Concerning:	3831 Supremes Trl, Spring, TX 77	7386
_	(Address or Other Identification of Inspected	d Property)
By:	Reevis Coleman Schultz Texas Professional Home Inspector / Hilsher Group LLC 3/11/2019	
_	(Name and License Number of Inspector)	(Date)
-	(Name, License Number of Sponsoring Inspector)	

PURPOSE, LIMITATIONS AND INSPECTOR / CLIENT RESPONSIBILITIES

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at <u>www.trec.texas.gov</u>.

The TREC Standards of Practice (Sections 535.227-535.233 of the Rules) are the minimum standard for inspections by TREC Licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is NOT required to turn on decommissioned equipment, systems, utility services or apply an open flame or light a pilot to operate any appliance. The inspector is NOT required to climb over obstacles, move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer's installation instructions. The inspection does NOT imply insurability or warrantability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector shall indicate, by checking the appropriate boxes on the form, whether each item was inspected, not inspected, not present or deficient and explain the findings in the corresponding section in the body of the report form. The inspector must check the Deficient (D) box if a condition exists that adversely and materially affects the performance of a system or component or constitutes a hazard to life, limb or property as specified by the TREC Standards of Practice. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing components, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards or Deficiencies below.

THIS PROPERTY INSPECTION IS NOT A TECHNICALLY EXHAUSTIVE INSPECTION OF THE STRUCTURE, SYSTEMS OR COMPONENTS. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers.

Promulgated by the Texas Real Estate Commission(TREC) P.O. Box 12188, Austin, TX 78711-2188 (512)936-3000 (<u>http://www.trec.state.tx.us</u>).

You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions expressed in previous or future reports.

ITEMS IDENTIFIED IN THE REPORT DO NOT OBLIGATE ANY PARTY TO MAKE REPAIRS OR TAKE OTHER ACTIONS, NOR IS THE PURCHASER REQUIRED TO REQUEST THAT THE SELLER TAKE ANY ACTION. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods.

Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES

Each year, Texans sustain property damage and are injured by accidents in the home. While some accidents may not be avoidable, many other accidents, injuries, and deaths may be avoided through the identification and repair of certain hazardous conditions. Examples of such hazards include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices for electrical receptacles in garages, bathrooms, kitchens, and exterior areas;
- malfunctioning arc fault protection (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- · excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.

These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions. While the TREC Standards of Practice do not require inspectors to perform a code compliance inspection, TREC considers the potential for injury or property loss from the hazards addressed in the Standards of Practice to be significant enough to warrant this notice.

Contract forms developed by TREC for use by its real estate licensees also inform the buyer of the right to have the home inspected and can provide an option clause permitting the buyer to terminate the contract within a specified time. Neither the Standards of Practice nor the TREC contract forms require a seller to remedy conditions revealed by an inspection. The decision to correct a hazard or any deficiency identified in an inspection report is left to the parties to the contract for the sale or purchase of the home.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR:

Standards of Practice:	In Attendance:	Type of building:
TREC Texas Real Estate Commission	Customer	Single Family (2 story)
Style of Home:	Approximate age of building:	Home Faces:
Traditional	New Construction	SE
Temperature:	Weather:	Ground/Soil surface condition:
Over 65 (F) = 18 (C)	Cloudy	Damp

Rain in last 3 days:

No

I NINP D

I. STRUCTURAL SYSTEMS

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.



stick built with radiant barrier



14 inches fiberglass blown insulation

🗹 🗌 🗌 🔲 A. Foundations

Type of Foundation (s): Poured concrete Method used to observe Crawlspace: No crawlspace Comments:

(1) This is not an engineering report, but is only an opinion based on observation of conditions known to be related to foundation performance, using the knowledge and experience of the inspector.

(2) The foundation is poured on grade with post tension cables that appears to be performing as designed.

Image: Image Im

Comments:



(1) End cap is missing on gutter in areas. This is not considered today's standards. I recommend having a qualified contractor inspect and make repairs as needed.



B. Item 1(Picture) right side of the home

(2) There is a negative slope towards the exterior areas. This area does not appear to drain water away from home and needs landscaping and drainage corrected to show a minimum of 4 inches of slab.



B. Item 2(Picture) front of the home

(3) The gutter downspout(s) missing deflector(s) at the exterior. Erosion can continue or become worse if not corrected. A qualified contractor should inspect and replace as needed.



B. Item 3(Picture) left side of the home

C. Roof Covering Materials

Types of Roof Covering: Architectural Viewed from: Ground, Ladder, Walked roof, Attic Roof Ventilation: Ridge vents, Soffit Vents, Passive Comments:



(1) This inspection does not warrant against roof leaks.

(2) Flashing appears to be unfinished in multiple areas. This is not considered today's standards. I recommend having a qualified contractor inspect and make repairs as needed.



C. Item 1(Picture)

C. Item 2(Picture)

(3) The flashing is not clearly visible and I am unable to verify proper installation and condition. I recommend consulting with a roofing professional to evaluate and make any necessary repairs.



C. Item 3(Picture) multiple areas roof line

☑ □ □ ☑ ☑ D. Roof Structures and Attics

Method used to observe attic:From entry, Walked, InaccessibleViewed from:Attic, Ground, Ladder, Walked roofRoof Structure:Stick-built, 2 X 6 Rafters, SheathingAttic Insulation:Blown, FiberglassApproximate Average Depth of Insulation:14 inchesApproximate Average Thickness of Vertical Insulation:less than 6 inchesAttic info:Attic access, Pull Down stairsComments:(1) Attic space inspected with limited access. This is for your information.

(2) Excess roof sheathing needs to be removed from passive vent in attic space. This is for your

information. I recommend having a qualified contractor make repairs as needed.

I NINP D



D. Item 1(Picture)

☑ □ □ ☑ E. Walls (Interior and Exterior)

Wall Structure: Wood

Comments:

(1) Drywall is being patched or repaired in multiple areas. This is for your information.



E. Item 1(Picture) multiple areas throughout home

(2) Areas where wiring or piping passes through walls should be sealed. I recommend having a qualified person seal as needed.



E. Item 2(Picture) left side of the home



E. Item 3(Picture) left side of the home

(3) A gap between the fascia and roof sheathing exists which allows insects or bees to enter attic.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NINP D



E. Item 4(Picture) multiple areas roof line

(4) Exterior areas are unfinished or unpainted. This is a cosmetic issue. I recommend having a qualified contractor inspect and make repairs as needed.





E. Item 5(Picture) left side of the home

E. Item 6(Picture) multiple areas rear of the home

(5) Building materials need to be trimmed in areas. This is for your information.




E. Item 7(Picture) left side of the home

(6) Different color mortar in areas. This is a cosmetic issue. I recommend having a qualified contractor make repairs as needed.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NINP D



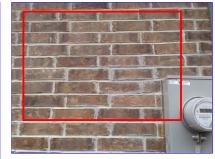

E. Item 9(Picture) multiple areas left side of the home

E. Item 8(Picture) multiple areas rear of the home



E. Item 10(Picture) multiple areas right side of the home

(7) Exterior siding is need of cleaning and routine maintenance. I recommend having a qualified person clean and make repairs as needed,



E. Item 11(Picture) multiple areas exterior

(8) The drywall on the wall is missing piece in areas. While this damage is cosmetic, it needs to be repaired. A qualified contractor should inspect and repair as needed.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NINP D



E. Item 12(Picture) upstairs hallway closet

F. Ceilings and Floors


Floor Structure: Slab Floor System Insulation: NONE Ceiling Structure: 6" or better Comments:

(1) The concrete floor of garage is cracked in areas. These cracks do not appear significant and seem typical. I recommend a structural engineer inspect to determine the integrity of floor and repair as needed.



F. Item 1(Picture) multiple areas garage

(2) The Drywall on the ceiling reveals tape line and nail bed areas (cosmetic). This damage is considered cosmetic. A qualified contractor should inspect and repair as needed.

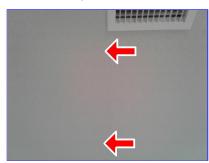

F. Item 2(Picture) living room (visible from upstairs hallway)

(3) The Drywall on the ceiling shows repair signs in areas. While this damage is cosmetic, it needs to be repaired. A qualified contractor should inspect and repair as needed.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NINP D



F. Item 3(Picture) kitchen

☑ □ □ ☑ G. Doors (Interior and Exterior)

Comments:

(1) The interior garage door does not have the required self closing hinge. This is not considered to be today's standard. I recommend having a qualified person make repairs as needed.



G. Item 1(Picture) garage door

(2) The main entry door is missing locking hardware . This is a maintenance issue and is for your information. A qualified contractor should inspect and repair as needed.



G. Item 2(Picture) front door

(3) The entry door missing weather-stripping. This is a maintenance issue and is for your information This can cause some heat loss in winter and loss of cool air in summer if not corrected. A qualified contractor should inspect and repair as needed.

```
I NINP D
```



G. Item 3(Picture) front door

G. Item 4(Picture) rear door

(4) The Entry door needs adjustment in areas. This is a maintenance issue and is for your information. A qualified contractor should inspect and repair as needed.



G. Item 5(Picture) study

🗹 🗌 🔲 🗹 H. Windows

Comments:

Windows have damaged or missing screens. This is not considered to be today's standards. I recommend having a qualified person make repairs as needed.




H. Item 1(Picture) All windows

I NINP D	
	I. Stairways (Interior and Exterior)
	Comments:
	J. Fireplaces and Chimneys
	Chimney (exterior): N/A
	Operable Fireplaces: None
	Types of Fireplaces: None
	Number of Woodstoves: None
	Comments:

☑ □ □ ☑ K. Porches, Balconies, Decks and Carports

Comments:

The concrete floor on the covered porch at the rear of home has cracked in some areas (which are cosmetic). Further deterioration can occur if not repaired. A qualified contractor should inspect and repair as needed.

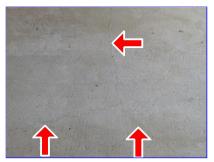

K. Item 1(Picture) multiple areas rear patio

🗹 🗌 🗌 🗹 L. Other

Comments:

(1) Drywall crew is present at time of inspection process. Multiple areas are taped off throughout home. This will limit the ability of the thermal camera in areas. This is for your information.



L. Item 1(Picture) multiple areas being repaired



L. Item 2(Picture) multiple areas

(2) Soap dispenser is not installed. However the hole is drilled. This is for your information.

I NINP D



L. Item 3(Picture) kitchen

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

I NINP D

II. ELECTRICAL SYSTEMS

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.



meter box and breaker box lef side of the home



I Control A. Service Entrance and Panels

Electrical Service Conductors: Below ground, Aluminum Panel Capacity: 150 AMP Panel Type: Circuit breakers Electric Panel Manufacturer: Square D Comments:

(1) The main panel box is located at the outside. However, the main disconnect (shut-off) is outside at meter base panel (for your information).



A. Item 1(Picture) 150 amp home

(2) The electrical panel has branch circuit wires bundled together that are entering the panel through one

I NINP D

to two entry points. This is not considered today's standard. It is recommended that each sheathed wire enter the panel independently and be sealed for fire blocking purposes. I recommend having a qualified electrician evaluate and make repairs as needed.



A. Item 2(Picture)

Image: Image:

Type of Wiring: Romex Branch wire 15 and 20 amperage: Copper Comments:

(1) I recommend checking all smoke detectors for functionality and putting fresh batteries in each unit upon move in. It is recommend to have smoke detection in each bedroom, hallways and living area. (Carbon monoxide detection is recommended if home is equiped with gas fired appliances)

(2) Problem(s) discovered with Branch Circuits such as amateur wiring installation, doubled wiring at neutral/grounding bar, and any other problems that an electrical contractor may discover while performing repairs need correcting. I recommend a licensed electrical contractor inspect further and correct as needed.



B. Item 1(Picture)

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

I NINP D In the normal operating devices: Head distribution systems including systems including: Heating equipment; Cooling filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall operate automatic safety controls; long the manufacturer or installer for other circumstances may cause equipment damage; Operate automatic safety controls; long to extinguish solid fuel fires; or observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.



Lennox

mfd not liste



Lennox

🗌 🗹 🗌 🔲 A. Heating Equipment

Type of Systems: Forced Air Energy Sources: Gas Heat System Brand: Lennox Number of Heat Systems (excluding wood): One Comments:

(1) It is recommend to have heating systems serviced annually.

(2) Unable to test. The gas meter issues are present.



A. Item 1(Picture)

I = Inspected	NI = Not Inspected NP = Not Present D = Deficient
I NINP D	
☑ □ □ □ B.	Cooling Equipment
	Type of Systems: Air conditioner unit
	Central Air Manufacturer: Lennox
	Comments:
	(1) It is recommended to have HVAC systems serviced annually.
	(2) The ambient air test was performed by using thermometers on the air handler of Air conditioner to determine if the difference in temperatures of the supply and return air are between 14 degrees and 22 degrees which indicates that the unit is cooling as intended. The supply air temperature on your system read 50 degrees, and the return air temperature was 68 degrees. This indicates the range in temperature drop is normal.
☑ □ □ □ C.	Duct Systems, Chases, and Vents
	Ductwork: Insulated
	Filter Type: Cartridge
	Filter Size: 16x25
	Comments:
	I recommend changing all HVAC filters upon move in.
areas of concern, sor	ling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all me areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and rvice door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that

the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that


qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

REI 7-5 (05/04/2015)

I NINP D

IV. PLUMBING SYSTEM

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

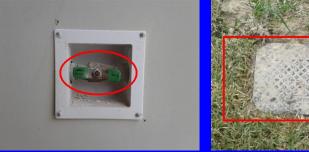

water shutoff inside garage



water pressure 62 psi



water meter front right of home



rinnai tankless water heater gas fired

Image: A. Plumbing Supply Distribution Systems and Fixtures

Location of water meter: Front, Right Side Location of main water supply valve: Right Side Extra Info: inside garage Static water pressure reading: 62 pounds/square inch Water Source: Public Plumbing Water Supply (into home): Not visible Plumbing Water Distribution (inside home): PEX Water Filters: (We do not inspect filtration systems) Comments:

(1) The hot water was not on for inspection. I did not inspect condition of faucets, fixtures, plumbing, pressure or volume. There is an additional charge for a separate trip to return and inspect plumbing.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NINP D



A. Item 1(Picture)

(2) The stop-valve and linkage does not work properly at the . This is not considered up to today's standard Repairs are needed. A licensed plumber should troubleshoot further to determine cause or remedy.



A. Item 2(Picture) guest bath upstairs left



A. Item 3(Picture) master bath sink left side

(3) Shower not function tested because the workers have area taped off. This is for your information.



A. Item 4(Picture) master bath

B. Drains, Waste, and Vents Washer Drain Size: 2" Diameter Plumbing Waste: PVC Comments:

|--|

🗹 🗹 🗌 🗹 C. Water Heating Equipment

Energy Sources: Gas (quick recovery) Capacity (Water Heater): Tankless Water Heater Manufacturer: Rinnai (Tankless) Water Heater Location: Garage Comments:

(1) Unable to test. The gas meter issues are present.



C. Item 1(Picture)

(2) The water heater is installed without the recommended emergency overflow drain pan. This is not considered to be today's. I recommend having a drain pan installed by a qualified person.



C. Item 2(Picture)

□ □ ☑ ☑ □ D. Hydro-Massage Therapy Equipment

Comments:

🗹 🗌 🗌 🗹 E. Other

Comments:

Issues with the gas meter. As a result no gas fired appliances are working at time of inspection process. Builders informed.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NINP D



E. Item 1(Picture)


E. Item 2(Picture)

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

I NINP D

V. APPLIANCES

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

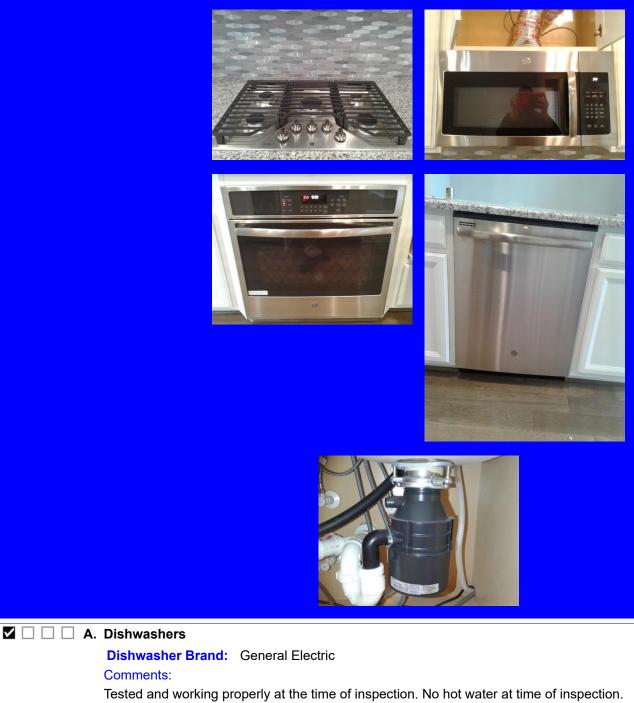

🗹 🗌 🔲 🛛 B. Food Waste Disposers

Disposer Brand: Badger

I NINP D	
	Comments:
	Tested and working properly at the time of inspection.

□ 🗹 □ □ C. Range Hood and Exhaust Systems

Exhaust/Range hood: Vented, General Electric

Comments:

Microwave vent hood is not working properly at time of inspection. This is not considered today's standards. I recommend having a qualified contractor inspect and make repairs as needed.



C. Item 1(Picture)

✓ ✓ □ □ D. Ranges, Cooktops and Ovens

Range/Oven: General Electric

Comments:

(1) No gas at cooktop. Appliance not function tested. This is for your information.



D. Item 1(Picture)

(2) Gas shut off valve is located behind a pull out drawer to right of oven. This can make shutoff in an emergency difficult. This is for your information.



D. Item 2(Picture)

D. Item 3(Picture)

I NINP D

(3) Tested and working properly at the time of inspection.



D. Item 4(Picture) tested @(350) F

🗌 🗹 🗌 🔲 E. Microwave Ovens

Built in Microwave: General Electric

Comments:

Appliance not working properly at time of inspection. This is not considered today's standards. I recommend having a qualified contractor inspect and make repairs as needed.



E. Item 1(Picture)

F. Mechanical Exhaust Vents and Bathroom Heaters

Comments:

Tested and working properly at the time of inspection.

🗹 🗌 🔲 🗹 G. Garage Door Operator(s)

Comments:

The garage door at the front of home is manually operated. This is a maintenance issue and is for your information. A qualified contractor should inspect and repair as needed.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NINP D



G. Item 1(Picture)

🗹 🗌 🖾 H. Dryer Exhaust Systems

Comments:

The dryer vent piping is long and vertical which can trap lint at elbow. Vent pipes should be cleaned regularly if they are longer than normal (10 feet or more) or vented vertically. I recommend repair as needed.



H. Item 1(Picture) laundry room

|--|

Comments:

I. Other

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.



A. Landscape Irrigation (Sprinkler) Systems

Comments:

Sprinkler system has been disabled and was not tested.



A. Item 1(Picture)

Image: Image:

Comments:

(1) Any area with a pool or spa should be equiped with safety features: Fencing (minimum 4ft), Self closing/latching/lockable gates (latch 54 inches), Door alarms on any doors leading to pool area and Splash alarms. I recommend consulting your insurance provider and their recommendation and requirements.

(2) Our company does not inspect pool for leaks or seepage. Only components readily accessible are inspected.

🗌 🗌 🗹 🔲 C. Outbuildings

Comments:

□ □ ☑ □ D. Private Water Wells (A coliform analysis is recommended)

Comments:

I = Inspected	NI = Not Inspected NP = Not Present D = Deficient	
I NINP D		
	We only check wells for functionality and water pressure, water quality is not part of the scope of this inspection.	
🗆 🗆 🖬 🔲 E.	Private Sewage Disposal (Septic) System	
	Comments:	
🗆 🗆 🗹 🔲 F.	🗌 🗹 🔽 F. Other	
	Comments:	
🗌 🗖 🗹 G. Outdoor Cooking Equipment		
	Comments:	

VII. Home Warranty Information

A. This home is eligible for a one year Home Warranty offer!

Comments:

Items included in the one year home warranty if purchased are: *Furnaces, Boilers, Heat Pumps, Central Air Conditioners, Electrical System, Thermostats, Water heater System, Plumbing, Polybutylene lines, Sump Pump, WhirlPools, Dishwasher, Food Waste Disposer, Cooking Range/Oven, Microwave, Kitchen Refrigerator, Trash Compactor, Plumbing Fixtures and Faucets, Domestic Water Softener, Clearing of Line Stoppage, Well Water System, Refrigerant Recapture and Disposal, Permits in conjunction with a covered repair, Code Violations in conjunction with a covered repair, Improper installation or modification, Removal of defective equipment, Fireplace gas burner, Attic and Exhaust fans, Humidifiers, Dehumidifiers, Electronic Air Filtering Devices, Door bell System, Lighting Fixtures, Septic Lines, Ejector pump.* For more information and to compare warranties or purchase this warranty, please click on the Warranty offer beside your uploaded report.