

8616 Daffodil St Houston TX 77063 (Office) (713) 723-4215 (Fax) (713) 723-3334

(Fax) (713) 723-3334 E-Mail office@foxinspectiongroup.com

Company TPCL # 0575464 Certified Applicator TPCL # 0704820 Technician TPCL # 0587102, 0745495, 0764144, 0772213, 0772220, 0772221, 0772384

Repor	t Number: 200702TTTJMc-9923 Red Tamarack Lane
	t Prepared for Michael Wright Thursday, July 2, 2020 Contact #:
Insped	ction Address: 9923 Red Tamarack Lane Tomball, TX 77375
Prope	rty was <u>Occupied</u>
Warra	nty Offered: Yes
	etor: John McElroy etor Licence No.: TPCL: 0587102
Te	cas Termite Terminators Additional Statements Included in the Scope of Inspection Agreement that are not
Α.	Promulgated by the Texas Department of Agriculture This inspection is only good for the date and time of the inspection. Texas Termite Terminators, its Inspectors, employees and agents will not guarantee or warrant the absence of any wood destroying insect. Due to the characteristics and behavior of various wood destroying insects, the insects may not be visible or detectable on the date and time of the inspection. Even with the best inspection, termites can remain hidden and unnoticed for a long period of time. Swarming of wood destroying insects can occur in a short amount of time and may by the first signs of the presence
	of wood destroying insects that were not detectable at the time of the original inspection. If swarming occurs after the date and time of the original inspection and active wood destroying insects were not detectable at the time of the original inspection. Texas Termite Terminators, its Inspectors, employees and agents cannot be liable for the non-detectable infestation and will not assume any liability for corrective actions needed and will not assume liability for non-detectable / hidden wood damage.
В.	Texas Termite Terminators Standard Operational Inspection Procedures: The Inspector will perform a visual inspection of the visible and accessible foundation perimeter beam (slab-on-grade foundation), visual inspection of the visible and accessible exterior perimeter beam and accessible interior perimeter beam and piers (pier-&-beam foundation), probe visible and accessible exterior wood for active or signs of previous activity of a wood destroying insects, visual inspection of the structures accessible interior walls, ceiling, baseboards and cabinetry and visual inspection of the accessible areas of the attic. The inspector will not deface the structure, cut holes, remove panels, pull back carpet, lift floor treatments, cut holes in
C.	the floors, wall or ceilings, move boxes, furniture, personal items or effects. The inspector will then complete this WDIR using the SPCB required standards for completing this form. These standards can be provided to you upon request. Additional Information from Texas Termite Terminators. AREAS OF POTENTIAL NON-VISIBLE WOOD DESTROYING INSECT ACTIVITY AREAS ARE LISTED BUT NOT LIMITED TO THE FOLLOWING: In the wall voids at
	the bathroom bathtraps and shower stalls/enclosures, plumbing penetrations within the construction wall voids, below high soil lines, behind heavy foliage, non-visible slab joints, non-visible slab cracks, under and/or behind decks and/or raised patios, behind cosmetic repairs of the foundation beam, within sill plates and between sub-floors and any other area that the Inspector marks as inaccessible in section 6B of this report. Texas Termite Terminators and its Inspectors, employees and agents will not assume any liability for active infestation of a wood destroying insect that is not visible and/or accessible to the Inspector at the time of the original inspection.
D.	The Inspector will do his/her best to access and to inspect all accessible and visible areas and/or components of the structure. This inspection is only good for the date and time of this inspection and Texas Termite Terminators, its Inspectors, employees and agents will not assume any liability for non-accessible areas and non-visible wood destroying insects. If for any reason you are unhappy with the performance of the Inspector, his/her findings or unwilling to accept the scope of this inspection. Texas Termite Terminators will be more than happy to refund to you the cost of this inspection within 90 day's from the date of the original inspection. The refund is contingent on you surrendering all copies of this inspection report back to Texas Termite Terminators and you releasing Texas Termite Terminators, its employee and its agents from all future liabilities to the inspected property. This refund cannot be made if the report has already been used to close on a real estate transaction.

TEXAS OFFICIAL WOOD DESTROYING INSECT REPORT

Rule §7.176 Requires this department prescribed form to be used for real estate transactions in Texas regarding the visible presence or absence of wood destroying insects and conditions conducive to infestations of wood destroying insects.

9923 Red Tamarack Lane	Tomball	77375
Inspected Address	City	Zip Code
	SCOPE OF INSPECTION	

- A. This inspection covers only the multi-family structure, primary dwelling or place of business. Sheds, detached garages, lean-tos, fences, guest houses or any other structure will not be included in this inspection report unless specifically noted in Section 5 of this report.
- B. This inspection is limited to those parts of the structure(s) that are visible and accessible at the time of the inspection. Examples of inaccessible areas include but are not limited to (1) areas concealed by wall coverings, furniture, equipment and stored articles and (2) any portion of the structure in which inspection would necessitate removing or defacing any part of the structure(s) (including the surface appearance of the structure). Inspection does not cover any condition or damage which was not visible in or on the structure(s) at time of inspection but which may be revealed in the course of repair or replacement work.
- C. Due to the characteristics and behavior of various wood destroying insects, it may not always be possible to determine the presence of infestation without defacing or removing parts of the structure being inspected. Previous damage to trim, wall surface, etc., is frequently repaired prior to the inspection with putty, spackling, tape or other decorative devices. Damage that has been concealed or repaired may not be visible except by defacing the surface appearance.

 The WDI inspecting company cannot guarantee or determine that work performed by a previous pest control company, as indicated by visual evidence of previous treatment, has rendered the pest(s) inactive.
- D. If visible evidence of active or previous infestation of listed wood destroying insects is reported, it should be assumed that some degree of damage is present.
- E. If visible evidence is reported, it does not imply that damage should be repaired or replaced. Inspectors of the inspection company usually are not engineers or builders qualified to give an opinion regarding the degree of structural damage. Evaluation of damage and any corrective action should be performed by a qualified expert.
- F. THIS IS NOT A STRUCTURAL DAMAGE REPORT OR A WARRANTY AS TO THE ABSENCE OF WOOD DESTROYING INSECTS.
- G. If termite treatment (including pesticides, baits or other methods) has been recommended, the treating company must provide a diagram of the structure(s) inspected and proposed for treatment, label of pesticides to be used and complete details of warranty (if any). At a minimum, the warranty must specify which areas of the structure(s) are covered by warranty, renewal options and approval by a certified applicator in the termite category. Information regarding treatment and any warranties should be provided by the party contracting for such services to any prospective buyers of the property. The inspecting company has no duty to provide such information to any person other than the contracting party.
- H. There are a variety of termite control options offered by pest control companies. These options will vary in cost, efficacy, areas treated, warranties, treatment techniques and renewal options.
- I. There are some specific guidelines as to when it is appropriate for corrective treatment to be recommended. Corrective treatment may only be recommended if (1) there is visible evidence of an active infestation in or on the structure, (2) there is visible evidence of a previous infestation with no evidence of a prior treatment.
- J. If treatment is recommended based solely on the presence of conducive conditions, a preventive treatment or correction of conducive conditions may be recommended. The buyer and seller should be aware that there may be a variety of different strategies to correct the conducive condition(s). These corrective measures can vary greatly in cost and effectiveness and may or may not require the services of a licensed pest control operator. There may be instances where the inspector will recommend correction of the conducive conditions by either mechanical alteration or cultural changes. Mechanical alteration may be in some instances the most economical method to correct conducive conditions. If this inspection report recommends any type of treatment and you have any questions about this, you may contact the inspector involved, another licensed pest control operator for a second opinion, and/or the Structural Pest Control Service of the Texas Department of Agriculture.

SPCS/T-5 (Rev. 09/1/2019) Page 1 of 1


9923 Red Tamarack Lane Inspected Address 1A. Texas Termite Terminators		_ <u>Tombal</u>	<u> </u>			<u>77375</u>		
		City 1B TPCI	.: 057540	64	Zip	Zip Code		
Name of Inspection Company	101013	1B. 11 OL		SPCS Business I	_icense Number		_	
1C. 8616 Daffodil St	Houston	Texas		77063	(713)	723-4215		
Address of Inspection Company	y City	State		Zip	, ,	Telephone No.		
1D. John McElroy Name of Inspector (Please Prin	nt)			Certified Applicat Technician	or 🔲	(check one)	
1F. Thursday, July 2, 202	,							
Inspection Date								
2. Michael Wright Name of Person Purchasing	Inspection		Seller A	Agent D Buyer	Management Co	o. Other D N/A	<u> </u>	
3. N/A Owner/Seller								
4. REPORT FORWARDED TO: Titl	le Company or Mortgagee Control regulations only the purch	Purchaser of Se aser of the service i		Seller 🗹 receive a copy)	Agent	Buyer 🗆		
The structure(s) listed below were inspec	cted in accordance with the offici	ial inspection proced	dures adopted	by the Texas Str	ructural Pest Control	Service. This report i	s made subje	
to the conditions listed under the Scope 5A. Two story , Single family resid	of Inspection. A diagram must be	e attached including	all structures	inspected.		•	·	
List structure(s) inspected that may inclu		and other structure	s on the prop	erty. (Refer to Par	rt A, Scope of Inspect	tion)		
5B. Type of Construction:	_		_					
Foundation: Slab Pier and Beam				N/A				
Siding: Wood ☐ Hardie Plank ☐			nt Board					
·	ngle Metal Tile Oth							
6A. This company has treated or is treat	•			D ::	□ Oth	her \square		
If treating for subterranean termites, the		artial 📙	Spot L		LI Ott	her LI		
If treating for drywood termites or related			Limited L					
6B. N/A Date of Treatment by Inspecting	N/A Company	Common Name of I	nsect	N/A Na	ame of Pesticide, Bait	t or Other Method		
Yes No Melter I nor the company for which I am nor the company for which I am acting is Signatures:		e, or contemplate ha			se of sale of this prop	erty. I do further state	e that neither	
7A. TPCL: 05 Inspector (Technician or Certified Ar		mber)						
Others Present:								
7B. N/A Apprentices, Technicians, or Certifie	ed Applicators (Names) and Regi	stration/License Nu	mber(s)					
	, ,	o a	(0)					
Notice of Inspection Was Posted At or N 8A. Electric Breaker Box	8B. Date Posted: 07/02/2020							
Water Heater Closet	ob. Date 1 osted. <u>omozi zozo</u>							
Beneath the Kitchen Sink								
9A. Were any areas of the property obst (Refer to Part B & C, Scope of Inspectio		Yes 🗹	No 🗆					
9B. The obstructed or inaccessible area		_ ĭ				_	1	
Attic \square	Insulated area of attic	_	ng Areas		anter box abutting str	ucture \Box		
Deck Soil Grade Too High	Sub Floors	☐ Slab Jo	oints	$\overline{}$	awl Space	□ ☑	•	
Soil Grade Too High Other	Heavy Foliage	□ Eaves	Spacif		eepholes , Behind debris			
structure, Behind personal ed slab, Under floor coverings, l	ffects/furniture, Blocked Behind storage in garaç	d/Stored areas	, Constru	ction voids, I	Foundation cor	ner pops, Crac	ks in the	
plumbing penetrations,	iroudna innest infector	Yes 🗆	No 	1				
10A. Conditions conducive to wood dest (Refer to Part J, Scope of Inspection) If10B. Conducive Conditions include but a	"Yes" specify in 10B.	Yes L	No L	1				
	Wood to Ground Contact	(G)	Formboards	s left in place (I)	Excessive Moi	sture (J)		
Debris under or around structure (K)	-		Wood Rot (☐ Heavy Folia	* *		
Planter box abutting structure (O)	_		Wooden Fe	nce in Contact wi	th the Structure (R)			
Insufficient ventilation (T)			Other	(C)	Specify: N/A	<u> </u>		

Licensed and Regulated by The Texas Department of Agriculture PO Box 12847 Austin, Texas 78711-2847 Phone 866-918-4481, Fax 888-232-2567

9923 Red Tamarack Lane	Tombal				77375		
Inspected Address 11. Inspection Reveals Visible Evidence in or on the structure:	City Active	Infestation	Previous In	festation	Zip Code Previous T	reatment	
11A. Subterranean Termites	Yes 🗆	No 🗹	Yes 🗆	No 🗹	Yes 🗌	No 🗹	
11B. Drywood Termites	Yes 🗆	No 🗹	Yes 🗆	No 🗹	Yes 🗌	No 🗹	
11C. Formosan Termites	Yes 🗆	No 🗹	Yes 🗆	No 🗹	Yes	No 🗹	
11D. Carpenter Ants	Yes 🗆	No 🗹	Yes 🗆	No 🗹	Yes	No 🗹	
11E. Other Wood Destroying Insects Specify: N/A	Yes 🗆	No ☑	Yes 🗆	No 🗹	Yes 🗆	No 🗹	
11F. Explanation of signs of previous treatment (including pesticides, baits, None visible at the time of inspection	existing treatmen	nt stickers or c	ther methods) ide	entified:			
11G. Visible evidence of: None visible at the time of inspection	n has been o	bserved in the	following areas:	N/A			
If there is visible evidence of active or previous infestation, it must be noted. inspected must be noted in the second blank. (Refer to Part D, E & F, Scop 12A. Corrective treatment recommended for active infestation or evidence of the second sec	e of Inspection)			blank and all id	dentified infes	sted areas of the prop	perty
as identified in Section 11. (Refer to Part G, H and I, Scope of Inspec	tion)			Yes 🗌		No 🗹	
12B. A preventive treatment and/or correction of conducive conditions as identification of the second conducive conditions as identification. Specify reason: N/A Refer to Scope of Inspection Part J	entified in 10A &	10B is recomi	mended as follow	s: Yes 🗆		No 🗹	_

Diagram of Structure(s) Inspected

The inspector must draw a diagram including approximate perimeter measurements and indicate active or previous infestation and type of insect by using the following codes: EEvidence of infestation; A-Active; P-Previous; D-Drywood Termites; S-Subterranean Termites; F-Formosan Termites; C-Conducive Conditions; B-Wood Boring Beetles; H-Carpenter Ants; Other(s) - Specify N/A

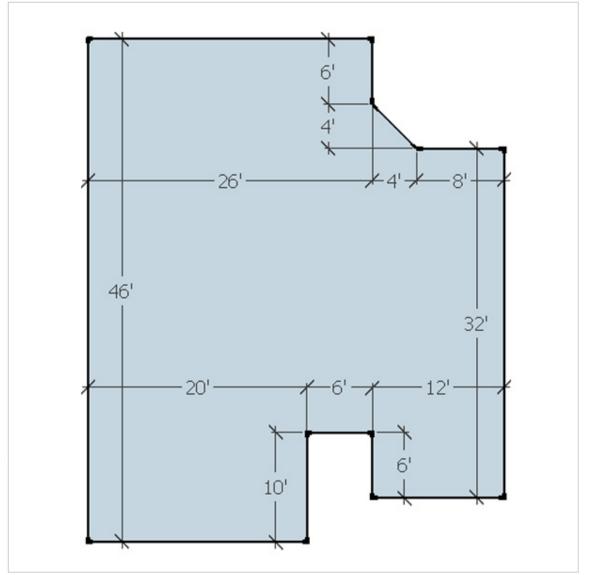

Additional Comments No visible evidence of active wood destroying insect infestation observed at the time of inspection

SPCS/T-5 (Rev. 09/1/2019) Page 2 of 3

9923 Red Tamarack Lane Inspected Address	Tomball City	77375 Zip Code			
S	Statement of Purchaser				
I have received the original or a legible copy of this form. I have read and uncunderstand that my inspector may provide additional information as an adden If additional information is attached, list number of pages: N/A		ad and understand the "Scope of Inspection." I			
Signature of Purchaser of Property or their Designee	Date				
✓ Customer or Designee not Present Buyers Initials					

SPCS/T-5 (Rev. 09/1/2019) Page 3 of 3



8616 Daffodil St. Houston TX 77063

TDA TPCL 0575464

Office: (713) 723-4215

Fax: (713) 723-3334

office@houstontexastermite

Eastern Subterranean 90-Day Free Protection

(Convertible to Lifetime)

TEXAS TERMITE TERMINATOR PROTECTION PLAN

Client

Michael Wright

Address

9923 Red Tamarack Lane

City, State, Zip Tomball, TX 77375

Effective Date **July 2, 2020**

(Effective date is date of initial inspection and the 90T3P2 must be processed in accordance with the terms on the reverse side.)

Eastern Subterranean Termite Infestation

Texas Termite Terminators or it's designee has inspected the building noted above for the purpose of determining visible evidence of Wood Destroying Insects, as defined by the Texas Department of Agriculture. Texas Termite Terminators or it's designee has provided a written report of its findings to the client. That report and the Limited Warranty are subject to the terms and condition of the Inspection Agreement, as well as the Scope and Limitations of the Limited Warranty. The parties agree that the liability of Texas Termite Terminators is as follows:

If Eastern Subterranean Termites are visually observed while this 90 day FREE Protection (Convertable to a Lifetime Renewable Termite Treatment Protection) is in good standing, Texas Termite Terminators will have the infestation treated as is determined by the terms of this agreement. Any areas having "Conducive Conditions" as noted in the written report are exempt from this coverage unless remedied and reinspected by Texas Termite Terminators (a re-inspection fee may apply).

GENERAL TERMS, SCOPE, AND LIMITATIONS ARE SET FORTH ON PAGE TWO OF THIS CERTIFICATE

