

# PROPERTY INSPECTION REPORT FORM

| Laverne Pivonka<br>Name of Client   | 02/08/2024<br>Date of Inspection |  |
|---|----------------------------------|--|
| 3025 Rosefield Drive , Houston, TX 77080<br>Address of Inspected Property |                                  |  |
| Tim Carpenter Name of Inspector   | #23947<br>TREC License #         |  |
| Name of Sponsor (if applicable)   | TREC License #                   |  |

### PURPOSE OF INSPECTION

A real estate inspection is a visual survey of a structure and a basic performance evaluation of the systems and components of a building. It provides information regarding the general condition of a residence at the time the inspection was conducted. *It is important* that you carefully read ALL of this information. Ask the inspector to clarify any items or comments that are unclear.

### **RESPONSIBILITY OF THE INSPECTOR**

This inspection is governed by the Texas Real Estate Commission (TREC) Standards of Practice (SOPs), which dictates the minimum requirements for a real estate inspection.

The inspector IS required to:

- use this Property Inspection Report form for the inspection;
- inspect only those components and conditions that are present, visible, and accessible at the time of the inspection;
- indicate whether each item was inspected, not inspected, or not present;
- indicate an item as Deficient (D) if a condition exists that adversely and materially affects the performance of a system or component OR constitutes a hazard to life, limb or property as specified by the SOPs; and
- explain the inspector's findings in the corresponding section in the body of the report form.

The inspector IS NOT required to:

- identify all potential hazards;
- turn on decommissioned equipment, systems, utilities, or apply an open flame or light a pilot to operate any appliance;
- climb over obstacles, move furnishings or stored items;
- prioritize or emphasize the importance of one deficiency over another;
- provide follow-up services to verify that proper repairs have been made; or
- inspect systems or components listed under the optional section of the SOPs (22 TAC 535.233).

#### RESPONSIBILITY OF THE CLIENT

While items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions, in the event that any further evaluations are needed, it is the responsibility of the client to obtain further evaluations and/or cost estimates from qualified service professionals regarding any items reported as Deficient (D). It is recommended that any further evaluations and/or cost estimates take place prior to the expiration of any contractual time limitations, such as option periods.

### Page 1 of 49

**Please Note:** Evaluations performed by service professionals in response to items reported as Deficient (D) on the report may lead to the discovery of additional deficiencies that were not present, visible, or accessible at the time of the inspection. Any repairs made after the date of the inspection may render information contained in this report obsolete or invalid.

### **REPORT LIMITATIONS**

This report is provided for the benefit of the named client and is based on observations made by the named inspector on the date the inspection was performed (indicated above).

ONLY those items specifically noted as being inspected on the report were inspected.

This inspection IS NOT:

- a technically exhaustive inspection of the structure, its systems, or its components and may not reveal all deficiencies;
- an inspection to verify compliance with any building codes;
- an inspection to verify compliance with manufacturer's installation instructions for any system or component and DOES NOT imply insurability or warrantability of the structure or its components.

### NOTICE CONCERNING HAZARDOUS CONDITIONS, DEFICIENCIES, AND CONTRACTUAL AGREEMENTS

<u>Conditions may be present in your home that did not violate building codes or common</u> <u>practices in effect when the home was constructed but are considered hazardous by today's</u> <u>standards. Such conditions that were part of the home prior to the adoption of any current</u> <u>codes prohibiting them may not be required to be updated to meet current code requirements.</u> <u>However, if it can be reasonably determined that they are present at the time of the inspection,</u> <u>the potential for injury or property loss from these conditions is significant enough to require</u> <u>inspectors to report them as Deficient (D). Examples of such hazardous conditions include:</u>

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices and arc-fault devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

Please Note: items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions. The decision to correct a hazard or any deficiency identified in an inspection report is left up to the parties to the contract for the sale or purchase of the home.

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

### ADDITIONAL INFORMATION PROVIDED BY INSPECTOR



Home Inspection Report

Prepared exclusively for Laverne Pivonka



PROPERTY INSPECTED: 3025 Rosefield Drive Houston, TX 77080 DATE OF INSPECTION: 02/08/2024 Inspection No. 52965-1-929

### **INSPECTED BY:**

Carpenter Home Inspections, LLC 650 Westcross St. #71 Houston, TX 77018 tim.carpenter@pillartopost.com (713) 253-0697

### **INSPECTOR:**

Tim Carpenter Lic.#: #23947 tim.carpenter@pillartopost.com (713) 253-0697

Each office is independently owned and operated

| l = Inspected   |                |    | NI = Not Inspected | NP = Not Present  | D = Deficient  |                   |  |  |  |
|---|----------------|----|--------------------|---|--|-------------------|--|--|--|
| I   | NI             | NP | D*                 |   |  |                   |  |  |  |
|   | REPORT SUMMARY |    |                    |   |  |                   |  |  |  |
|   |                |    |                    | I. ST   | RUCTURAL SYSTEMS   |                   |  |  |  |
|   |                |    |                    |   | charging water against founda<br>from foundation to help preve   |                   |  |  |  |
|   |                |    |                    |   | mounted directly to the roof so<br>d be monitored and if remove<br>eplaced.  | -                 |  |  |  |
|   |                |    |                    | <b>c c</b>  | <ul> <li>Scarred/damaged shingle tabs on roof covering, damaged shingles will not<br/>wear evenly with rest of roof covering.</li> </ul> |                   |  |  |  |
|   |                |    |                    | Recommend having a qualified roofing contractor evaluate and rectify all affected areas as necessary to restore intended operation and function of roof covering. |  |                   |  |  |  |
|   |                |    |                    | Cracked purlin brace. Reco  | mmend licensed contractor re   | epair.            |  |  |  |
| <ul> <li>D. Roof Structures and Attics<br/>Comments:</li> <li>SAFETY NOTE: Attic stairs are high and heavy. Most people will<br/>ladder to unfold and return the stairs after use. Recommend a quadder contractor evaluate and provide a solution to opening and<br/>stair unit without the use of another ladder.</li> </ul> |                |    |                    | d a qualified attic   |  |                   |  |  |  |
|   |                |    |                    | <ul> <li>Rafters cut too short or not<br/>contractor repair.</li> </ul>   | at the proper angle. Recomm  | end licensed      |  |  |  |
|   |                |    |                    |   | ing-missing insulation in areas<br>ncy and reduce energy costs.  | s as necessary to |  |  |  |
|   |                |    |                    | E. Walls (Interior and Exterior   | ·)   |                   |  |  |  |
|   |                |    |                    | <i>Comments:</i><br>• Seal all open joints, gaps, a intrusions.   | and penetrations to prevent m  | oisture or pest   |  |  |  |
|   |                |    |                    | <ul> <li>Lentils are rusted. Recomm rusting.</li> </ul>   | nend sanding and painting to p   | prevent further   |  |  |  |
|   |                |    |                    | <ul> <li>F. Ceilings and Floors<br/>Comments:</li> <li>Carpet is wrinkled in severa<br/>Recommend re-stretching or</li> </ul>                                     | al areas. This could be a trip h<br>replacing carpet.  | azard.            |  |  |  |
|   |                |    |                    | <ul> <li>Loose and cracked tiles no<br/>flooring contractor evaluate a</li> </ul>   | ted in several areas. Recomm<br>and repair or replace tile.  | end licensed      |  |  |  |

| Ксроі        | t luc | iitii | icati | 511.52303 - 1 - 323, 5025  Noserie   |   |   | 02/0 |
|--------------|-------|-------|-------|--|---|---|------|
| l = Ins      | spect | ed    |       | NI = Not Inspected   | NP = Not Present  | D = Deficient   |      |
| I            | NI    | NP    | D*    |  |   |   |      |
|              |       |       |       | <ul> <li>G. Doors (Interior and Exterior<br/>Comments:</li> <li>Exit door to garage should b<br/>or replaced.</li> </ul>   | r <b>)</b><br>e self closing. Recommend hin   | nges be adjusted  |      |
|              |       |       |       | <ul> <li>Ghost door noted (door that contractor repair. (Laundry Repair)</li> </ul>  | will not remain open) Recomm<br><b>oom)</b>   | end licensed  |      |
|              |       |       |       | Overhead garage door is cra  | acked and damaged.  |   |      |
|              |       |       |       | Recommend licensed contrac panels.   | tor evaluate and replace or rep   | lace damaged  |      |
|              |       |       |       | <ul><li>H. Windows</li><li><i>Comments:</i></li><li>Some window screens mission</li></ul>  | ing or damaged.   |   |      |
|              |       |       |       | <ul> <li>Seal and/or caulk joints and<br/>water penetration and subseq</li> </ul>  | gaps around windows to reduc<br>uent damages.   | ce air exchange   |      |
|              |       |       |       | <ul> <li>Damage dripping noted arou<br/>replace damaged stripping.</li> </ul>  | und windows. Recommend lice   | nsed contractor   |      |
|              |       |       |       | <ul> <li>Some window sills show evidence of the second second</li></ul> | dence of moisture stains from c<br><b>oom)</b>  | condensation.   |      |
|              |       |       |       | <ul> <li>I. Stairways (Interior and Exter<br/>Comments:</li> <li>Wheelchair ramp does not e<br/>contractor repair.</li> </ul>  | r <b>ior)</b><br>extend to the ground. Recomme  | end licensed  |      |
|              |       |       |       | J. Fireplaces and Chimneys<br>Comments:  |   |   |      |
|              |       |       |       | <ul> <li>Damper clamp is not installe<br/>to keep the damper slightly op</li> </ul>  | ed. Recommend installation of a<br>ben to allow any residual gas to<br>alified fireplace contractor insta   | escape from the   | Э    |
|              |       |       |       | was not tested and could not l<br>chimneys and their flue liners<br>advised to obtain the services<br>qualified personnel to perform   | ng, damper not tested. Draw of<br>be determined at the inspection<br>are not visible on our visual ins<br>of a qualified chimney sweepe<br>a complete inspection and tun<br>pliance. Operation of log-lighter | n. The interior of<br>spection. You are<br>er or other<br>le up of your | )    |
| $\checkmark$ |       |       |       | <ul> <li>K. Porches, Balconies, Decks,<br/>Comments:</li> <li>Front porch column is not set</li> </ul>   | and Carports<br>ecure. Recommend licensed co  | ntractor renair   |      |
|              |       |       |       | ·  | owing signs of settlement crack   | •   |      |
|              |       |       |       | Walkway is uneven and cou  | d pose a tripping hazard.   |   |      |
|              |       |       |       |  |   |   |      |

| l = Inspected   |    |    | NI = Not Inspected   | NP = Not Present  | D = Deficient  |                                  |  |  |
|---|----|----|--|---|--|----------------------------------|--|--|
| I   | NI | NP | D*   |   |  |                                  |  |  |
|   |    |    |  | II. ELE   | ECTRICAL SYSTEMS   |                                  |  |  |
|   |    |    |  | <ul> <li>A. Service Entrance and Panel<br/>Comments:</li> <li>Missing panel screws.</li> </ul>  | S  |                                  |  |  |
|   |    |    | <ul> <li>Non-standard screws being used to hold inner security cover, screws have<br/>sharp points and can pose a wire intrusion issue.</li> </ul> |   |  |                                  |  |  |
|   |    |    |  | <ul> <li>Anti-oxidant paste missing at<br/>distribution panel (see photo).</li> <li>apply paste as needed.</li> </ul>                                       |  |                                  |  |  |
|   |    |    |  | <ul> <li>White wires to 240 volt applia<br/>distribution panel. Wire should<br/>purpose.</li> </ul>   |  |                                  |  |  |
| $\checkmark$  |    |    |  | B. Branch Circuits, Connected   | Devices, and Fixtures  |                                  |  |  |
|   |    |    |  | Comments:<br>• Light fixtures did not illumina<br>replacing broken bulbs and ins<br>licensed electrician if fixtures of<br>make repairs to protect circuits | talling bulbs where missing. C ontinue to not work properly to | consult with a<br>o evaluate and |  |  |
|   |    |    |  | <ul> <li>Sealants observed missing a<br/>perimeter of residence (see ph<br/>grade sealant to tops and side</li> </ul>                                       | oto). Recommend applying go                                    | ood exterior-                    |  |  |
|   |    |    |  | All light fixtures require cover  | s to prevent injury and shock.                                 |                                  |  |  |
|   |    |    |  | <ul> <li>Receptacle tested as having<br/>closet)</li> </ul>   | an open ground. Primary Bath                                   | nroom (water                     |  |  |
|   |    |    |  | Recommend consulting with a<br>determine extent of service/rep<br>necessary to restore intended   | pair needed and rectify all affe                               | cted areas as                    |  |  |
|   |    |    |  | <ul> <li>Replace all batteries in smok</li> </ul>   | e detectors.   |                                  |  |  |
|   |    |    |  | <ul> <li>GFCI receptacle did not trip<br/>repair. (Garage)</li> </ul>   | when tested. Recommend lice                                    | nsed electrician                 |  |  |
|   |    |    |  | Recommend licensed electric   | cian replace damaged recepta                                   | icle. Kitchen.                   |  |  |
|   |    |    |  | III. HEATING, VENTILATIO  | ON, AND AIR CONDITIONING                                       | SYSTEMS                          |  |  |
| <ul> <li>Image: A start of the start of</li></ul> |    |    |  | <ul> <li>B. Cooling Equipment<br/>Comments:</li> <li>Rust noted in condensate par<br/>replace condensate pan.</li> </ul>                                    | n. Recommend licensed HVA                                      | C contractor                     |  |  |
| V   |    |    |  | <ul> <li>C. Duct Systems, Chases, and<br/>Comments:</li> <li>Ducts that are stacked or tou<br/>Recommend installing hangers</li> </ul>                      | ching can cause moisture buil                                  |                                  |  |  |

| l = Inspected |    |    | NI = Not Inspected | NP = Not Present   | D = Deficient                                |                  |
|---------------|----|----|--------------------|--|--|------------------|
| I             | ΝΙ | NP | D*                 |  |  |                  |
|               |    |    |                    | IV. PL   | UMBING SYSTEMS                               |                  |
|               |    |    |                    | A. Plumbing Supply, Distribution   | on Systems and Fixtures                      |                  |
|               |    |    |                    | Comments:  |  |                  |
|               |    |    |                    | <ul> <li>Recommend replacing insula<br/>Front)</li> </ul>                | tion around exterior plumbing                | pipes. (Exterior |
|               |    |    |                    | <ul> <li>"No sediment traps and/or dr</li> </ul>                         | ip legs noted on the natural ga              | as lines at the  |
|               |    |    |                    | mechanical equipment. Due to   | a change in construction stan                |                  |
|               |    |    |                    | recommend plumber evaluate   |  |                  |
|               |    |    |                    | repair as needed to meet today   | /s standards.                                |                  |
| $\checkmark$  |    |    |                    | D. Hydro-Massage Therapy Eq  | uipment                                      |                  |
|               |    |    |                    | <ul><li>Comments:</li><li>Whirlpool jets were not operative</li></ul>    | tional at time of inspection                 |                  |
|               |    |    |                    |  | aonar at anne or mspection.                  |                  |
|               |    |    |                    | Recommend repair by qualified  | l plumbing contractor.                       |                  |
| $\checkmark$  |    |    |                    | E. Gas Distribution Systems ar<br>Comments:                              | d Gas Appliances                             |                  |
|               |    |    |                    | <ul> <li>Gas supply for appliances sh<br/>use. (Laundry Room)</li> </ul> | ould be capped with a brass c                | ap when not in   |
|               |    |    |                    | v  | . APPLIANCES                                 |                  |
|               |    |    |                    | B. Food Waste Disposers  |  |                  |
| _             |    |    | _                  | Comments:  |  |                  |
|               |    |    |                    | <ul> <li>Disposal was not functioning</li> </ul>                         | at the time of the inspection.               |                  |
|               |    |    |                    | Recommend having qualified to  | echnician service/replace disp               | osal as          |
|               |    |    |                    | necessary to restore intended  |  |                  |
| $\checkmark$  |    |    |                    | D. Ranges, Cooktops, and Ove   | ns   |                  |
|               |    |    |                    | Comments:  | le a finanta lla al Alemania de la alche ata |                  |
|               |    |    |                    | <ul> <li>Flexible gas lines should not</li> </ul>                        | be installed through cabinets.               |                  |
| $\checkmark$  |    |    |                    | F. Mechanical Exhaust Vents a  | nd Bathroom Heaters                          |                  |
|               |    |    |                    | <ul><li>Comments:</li><li>Bathroom exhaust vent(s) do</li></ul>          | not terminate outside of the s               | tructure or are  |
|               |    |    |                    | terminating in the soffit vent. R  |  |                  |
|               |    |    |                    | discharge/terminate outside the  | e structure to reduce possible               | moisture buildup |
|               |    |    |                    | and related issues.  |  |                  |
| $\checkmark$  |    |    |                    | G. Garage Door Operators   |  |                  |
|               |    |    |                    | Comments:  | iom roquiros a stav apan cara                | w to protoct     |
|               |    |    |                    | <ul> <li>Garage door locking mechan<br/>opener.</li> </ul>               | ism requires a stay open scree               | w to protect     |
|               |    |    |                    | Sensors for overhead garage  | door are installed too high.                 |                  |
|               |    |    |                    | Recommend having a garage  | door contractor service/repair/              | adjust as        |
|               |    |    |                    | necessary to restore intended  |  |                  |
|               |    |    |                    | issues.  |  |                  |

| l = Inspected | NI = Not Inspected   | NP = Not Present  | D = Deficient     |
|---------------|--|---|-------------------|
| I NI NP D*    |  |   |                   |
|               | <ul> <li>H. Dryer Exhaust Systems<br/>Comments:</li> <li>Dryer exhaust vent and p<br/>reduce hazards associated</li> </ul> | ipe are dirty. Clean and maint<br>I with lint build up. | ain dryer vent to |

NI = Not Inspected

I = Inspected

NP = Not Present

D = Deficient

# I NI NP D\*

| I. STRUCTURAL SYSTEMS  |
|--|
| <section-header><section-header></section-header></section-header> |

NI = Not Inspected

02/08/2024

D = Deficient

### I = Inspected I NI NP D\*

· Corner Pops Present. Small cracks were observed in the foundation at several corners of residence, commonly called a ""corner-pop"" (see photos). NOT A STRUCTURAL ISSUE. This type of crack is guite common on foundations of this type. No recommendations necessary. However, sealing of cracks eliminates the possibility of treating cracks with poisons to kill termites. Recommend further evaluation by a gualified pest control company to determine proper method of treating condition. SUGGESTED CARE AND MAINTENANCE - Due to the highly expansive soil conditions that are prevalent to the Texas Gulf Coast Area, proper moisture control and drainage maintenance to all types of foundations should be on-going during the life of the structure. Drainage patterns should be directed away from all sides of the foundation with graded slopes directing run-off away from foundation. It is important to note that the inspection of the foundation performed today is not a structural engineering survey nor was any sub-grade or sub-slab plumbing or electrical systems evaluated during the performance of this visual inspection as these are specialized processes requiring excavation. In the event that structural movement is observed in the future, client is advised to consult with a structural engineer who can isolate, identify causes, and determine what corrective measures should be considered to either correct and/or stop structural movement.

NP = Not Present



02/08/2024

| Report Identificati | on: 52965-1-929, 3025 Rose  | efield Drive, Houston, TX 7708  | 30 0  |
|---------------------|---|---|---|
| l = Inspected       | NI = Not Inspected  | NP = Not Present  | D = Deficient   |
| I NI NP D*          |   |   |   |
|                     | intended performance of the<br>foundation can affect soil recommendations state the<br>foundation or that root bare<br>the slab. Poor drainage aw<br>also affect foundation perfo<br>location near the foundation | e drainage away from the struct<br>ne foundation. Trees and shrubs<br>noisture content and thus the fo<br>at trees and shrubs be planted a<br>riers be installed to prevent root<br>way from the slab, or pooling/sta<br>ormance. If for any reason wate<br>on for any extended period of tin<br>corrections will have to be made | s around the<br>bundation. Standard<br>away from the<br>ts from getting under<br>anding against it can<br>er pools at any<br>ne (24 consecutive |
|                     | soil levels a minimum of si<br>and graded away from the<br>10 feet, to promote positive<br>pooling/standing around th<br>reduce possible moisture of<br>• <b>Downspouts improperl</b>                             | ndard practice and recommend<br>x (6) to eight (8) inches below th<br>slab, at a minimum rate of six (<br>e drainage and to prevent water<br>the foundation area(s). Standard<br>exposure and help detect insect<br>y discharging water against f<br>downspouts away from found   | he top of the slab<br>(6) inches per every<br>r from<br>soil levels will also<br>t/pest activity.<br><b>Foundation.</b>                         |
|                     | prevent water damage.   |   |   |
|                     |   |   |   |
|                     | C. Roof Covering Materials<br>Types of Roof Covering: A   |   |   |

Comments: · Construction of roof/pitch did not allow for safe access to roof covering, roof was visually observed on the ground with binoculars (30 or 40 zoom cameras are also used) and / or by ladder at edge of roof surface, some areas could not be visually observed.

Viewed From: Ladder at edge, Ground level with binoculars

02/08/2024

 I = Inspected
 NI = Not Inspected
 NP = Not Present
 D = Deficient

 I
 NI NP D\*
 • IMPORTANT INFORMATION CONCERNING ROOFS: According to

• IMPORTANT INFORMATION CONCERNING ROOFS: According to statistical information recently released by NAPLIA (North American Professional Liability Insurance Agency, LLC) roofing related issues (including water penetration) account for 30% of all buyer's complaints after the sale of a home. This is the 2nd largest percentage area of complaints by home buyers. One of the reasons for this is that a roof can begin to malfunction at any time, especially after periods of heavy wind and / or rain.

Roofing experts agree that there is no exact method for a home inspector to determine the accurate remaining life expectancy of a roof during a visual inspection that is non invasive in nature. According to statistical data provided by housing experts, in the Texas Gulf Coast area, a properly constructed standard grade asphalt composition shingle roof has an average life expectancy of 12 - 15 years. A premium grade asphalt composition shingle roof has an average life expectancy of 15 - 25 years.

The condition and remaining life expectancy of a roof can be adversely affected by various factors including method of application, quality of material, presence of skylights, and weather extremes. It is therefore very important for the buyer to make sure that the age of the roof be disclosed by the current seller and / or previous seller. Your real estate agent can assist you in obtaining this information. It is also important for the prospective buyer to obtain disclosure information with regard to previous leaking, the history of repairs, and / or remodeling projects that included any section of the roof.

• Satellite Antennas that are mounted directly to the roof surface may allow water penetration. This should be monitored and if removed, the holes should be sealed and the shingles replaced.



NI = Not Inspected NP = Not Present D = Deficient

## I NI NP D\*

I = Inspected

• Scarred/damaged shingle tabs on roof covering, damaged shingles will not wear evenly with rest of roof covering.

Recommend having a qualified roofing contractor evaluate and rectify all affected areas as necessary to restore intended operation and function of roof covering.



Page 14 of 49 REI 7-6 (8/9/2021) Promulgated by the Texas Real Estate Commission • (512) 936-3000 • www.trec.texas.gov


- I = Inspected NI = Not Inspected NP = Not Present D = Deficient
  - I NI NP D\*
- Cracked purlin brace. Recommend licensed contractor repair.



# ✓ □ □ ✓ D. Roof Structures and Attics

Viewed From: Entered attic Approximate Average Depth of Insulation: 8 to 10 inches of insulation Comments:

• For reference only.

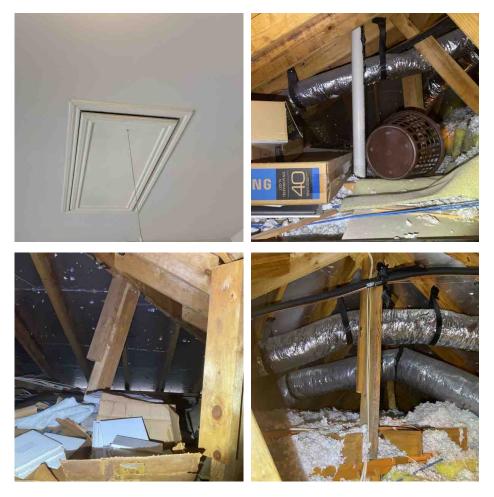

Page 15 of 49REI 7-6 (8/9/2021)Promulgated by the Texas Real Estate Commission • (512) 936-3000 • www.trec.texas.gov

- I = Inspected NI = Not Inspected NP = Not Present D = Deficient
  - I NI NP D\*



I = Inspected NI = Not Inspected NP = Not Present D = Deficient

## I NI NP D\*



• SAFETY NOTE: Attic stairs are high and heavy. Most people will require a ladder to unfold and return the stairs after use. Recommend a qualified attic ladder contractor evaluate and provide a solution to opening and closing the stair unit without the use of another ladder.



- I = Inspected NI = Not Inspected NP = Not Present D = Deficient
  - I NI NP D\*
- Rafters cut too short or not at the proper angle. Recommend licensed contractor repair.



NI = Not Inspected NP = Not Present

D = Deficient

I NI NP D\*

I = Inspected



necessary to promote better overall efficiency and reduce energy costs.

Recommend adding/replacing-missing insulation in areas as



## $\checkmark \square \square \checkmark$

E. Walls (Interior and Exterior)

Comments:

• Seal all open joints, gaps, and penetrations to prevent moisture or pest intrusions.



| l = Inspected | NI = Not Inspected | NP = Not Present | D = Deficient |
|---------------|--------------------|------------------|---------------|
|               |                    |                  |               |


## I NI NP D\*



• Lentils are rusted. Recommend sanding and painting to prevent further rusting.



• Mortar repairs were observed. Throughout.

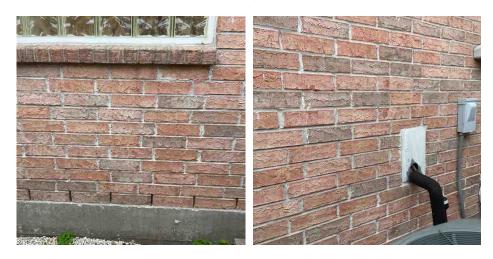

NP = Not Present I = Inspected NI = Not Inspected D = Deficient





 $\textcircled{\ }$ F. Ceilings and Floors

Comments:

• Carpet is wrinkled in several areas. This could be a trip hazard. Recommend re-stretching or replacing carpet.



I = Inspected NI = Not Inspected NP = Not Present D = Deficient

## I NI NP D\*

• Typical minor settlement cracks noted, this is typical of structures this age and should be considered cosmetic in nature.



• Loose and cracked tiles noted in several areas. Recommend licensed flooring contractor evaluate and repair or replace tile.



- I = Inspected NI = Not Inspected NP = Not Present D = Deficient
  - I NI NP D\*
  - - G. Doors (Interior and Exterior) Comments:
      - Exit door to garage should be self closing. Recommend hinges be adjusted or replaced.



· Ghost door noted (door that will not remain open) Recommend licensed contractor repair. (Laundry Room)



NI = Not Inspected N

NP = Not Present

D = Deficient

I NI NP D\*

 $\checkmark \square \square \checkmark$ 

I = Inspected

Overhead garage door is cracked and damaged.

Recommend licensed contractor evaluate and replace or replace damaged panels.



H. Windows

Comments:

• Some window screens missing or damaged.



I = Inspected NI = Not Inspected NP = Not Present

D = Deficient

- I NINP D\*
- Seal and/or caulk joints and gaps around windows to reduce air exchange water penetration and subsequent damages.



• Damage dripping noted around windows. Recommend licensed contractor replace damaged stripping.



| I = Inspected NI = Not Inspected | NP = Not Present | D = Deficient |
|----------------------------------|------------------|---------------|
|----------------------------------|------------------|---------------|

I NI NP D\*



• Windows are fixed and single hung, single pane glass.



• Some window sills show evidence of moisture stains from condensation. Seal and monitor. (Dinning Room)



D = Deficient

I = Inspected NI = Not Inspected

## I NINP D\*

✓ □ □ ✓ I. Stairways (Interior and Exterior)

Comments: • Wheelchair ramp does not extend to the ground. Recommend licensed contractor repair.

NP = Not Present



J. Fireplaces and Chimneys *Comments:* 

• Damper clamp is not installed. Recommend installation of a damper clamp to keep the damper slightly open to allow any residual gas to escape from the living area. Recommend a qualified fireplace contractor install the clamp.



02/08/2024

NI = Not Inspected

NP = Not Present

D = Deficient

## I NI NP D\*

I = Inspected

• Fireplace is wood/gas burning, damper not tested. Draw of the fireplace was not tested and could not be determined at the inspection. The interior of chimneys and their flue liners are not visible on our visual inspection. You are advised to obtain the services of a qualified chimney sweeper or other qualified personnel to perform a complete inspection and tune up of your fireplace prior to using the appliance. Operation of log-lighter was not tested. Gas line was capped.



 $\checkmark \square \square \checkmark$ 

K. Porches, Balconies, Decks, and Carports *Comments:* 

• Front porch column is not secure. Recommend licensed contractor repair.



- I = Inspected NI = Not Inspected NP = Not Present D = Deficient
  - I NI NP D\*
- Archway at front porch is showing signs of settlement cracks.
   Recommend licensed contractor repair.



• Walkway is uneven and could pose a tripping hazard.



L. Other

- Comments:
- House facing South, 63° and cloudy.

| l = Inspected | NI = Not Inspected        | NP = Not Present  | D = Deficient       |
|---------------|---------------------------|---|---------------------|
| I NI NP D*    |                           |   |                     |
|               | II. E                     | ELECTRICAL SYSTEMS  |                     |
|               | aluminum leads and uses b | nels<br>150 amp service; underground<br>reakers. Romex type wiring is<br>sible and could not be verified  | noted. All bondings |
|               |                           |   | nnection            |
|               |                           | Main dis         Image: State of the st |                     |
|               |                           |   |                     |

Page 30 of 49REI 7-6 (8/9/2021)Promulgated by the Texas Real Estate Commission • (512) 936-3000 • www.trec.texas.gov

## I = Inspected NI = Not Inspected NP = Not Present D = Deficient

# I NI NP D\*



Missing panel screws.



• Non-standard screws being used to hold inner security cover, screws have sharp points and can pose a wire intrusion issue.



02/08/2024

NI = Not Inspected NP = Not Present

D = Deficient

## I NI NP D\*

I = Inspected

• Anti-oxidant paste missing at main aluminum conductor terminals in distribution panel (see photo). Recommend having a qualified electrician apply paste as needed.



• White wires to 240 volt appliances were not marked as "hot" in the distribution panel. Wire should be marked with black electrical tape to indicate purpose.



 Image: Second state
 Image: Second state<

NI = Not Inspected

NP = Not Present

D = Deficient

## I NI NP D\*

I = Inspected

• Light fixtures did not illuminate or light bulbs were missing. Recommend replacing broken bulbs and installing bulbs where missing. Consult with a licensed electrician if fixtures continue to not work properly to evaluate and make repairs to protect circuits and prevent shock hazard. (Garage)



• Sealants observed missing at exterior wall mount light fixtures around perimeter of residence (see photo). Recommend applying good exterior-grade sealant to tops and sides of fixtures, leaving bottoms un-sealed.



- I = Inspected NI = Not Inspected NP = Not Present D = Deficient
  - I NI NP D\*
- All light fixtures require covers to prevent injury and shock.





• Receptacle tested as having an open ground. Primary Bathroom (water closet)

Recommend consulting with a licensed electrician on noted items to determine extent of service/repair needed and rectify all affected areas as necessary to restore intended electrical function, safety and protection.



| Inspected | NI = Not Inspected | NP = Not Present | D = Deficient |
|-----------|--------------------|------------------|---------------|
|           |                    |                  |               |

I NI NP D\*

1 =

• Replace all batteries in smoke detectors.



• "IMPORTANT NOTICE (PLEASE READ) - As of 2/1/09, the TREC ""Standards of Practice have changed with respect to the requirements for ""Arc-fault circuit interrupting (AFCI) devices"". They are now required and should be installed in family rooms, dining rooms, living rooms, parlors, libraries, dens, bedrooms, sunrooms, recreations rooms, closets, hallways, or similar rooms or areas. Any home built prior to 2/1/09 has to be reported by inspectors as being deficient with respect to this new standard. Please refer to the attached ""TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES"".

GENERAL INFORMATION - An ""arc-fault circuit Interrupting"" device (AFCI) protects branch-circuit wiring from arcing faults that could start an electrical fire. Arc-faults can be dangerous because they generally occur in wiring that is hidden (i.e. behind drywall, in an attic, etc.), going undetected until a fire breaks out. An AFCI does not protect an individual from being shocked (that's what a GFCI does). Arc Faults can occur by puncturing a romex wire with a nail, staple, or screw while hanging a picture, installing a shelf, or installing a cabinet.

SMOKE ALARMS / DETECTORS - Most municipal jurisdictions throughout the United States have adopted the International Residential Code (IRC) as the standard building code by which they operate.

In new home construction, the IRC requires hard wired (with battery backup), interconnected (when one alarm goes off, all interconnected alarms go off) smoke alarms

on the ceiling in each sleeping room; outside every sleeping area, and on each level of the residence.

In older homes, hard-wired, interconnected smoke alarms were not required.

However, buyers should consider the safety benefits of having their older homes upgraded. Smoke alarms are sensitive devices and, therefore, their effectiveness diminishes with age. Industry standards recommend the replacement of smoke detectors every 10 years. If you are not sure of the age of your smoke alarms, replace them.

- I = Inspected NI = Not Inspected NP = Not Present D = Deficient
  - I NI NP D\*

• GFCI receptacle did not trip when tested. Recommend licensed electrician repair. (Garage)




• Recommend licensed electrician replace damaged receptacle. Kitchen.





C. Other

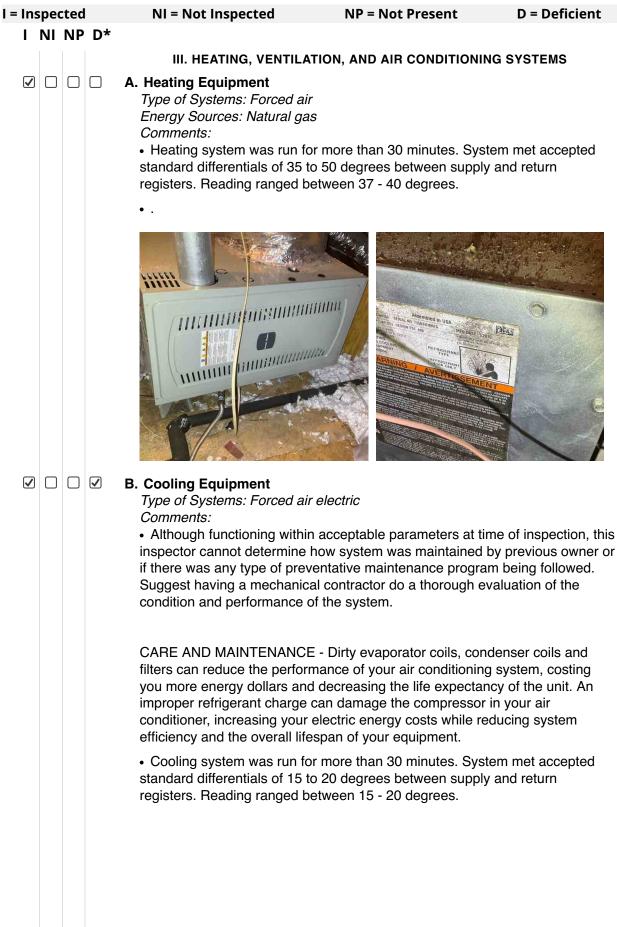


- NP = Not Present D = Deficient I = Inspected NI = Not Inspected
  - I NI NP D\*
- 2015 R-410A max breaker 40 amps.



 Rust noted in condensate pan. Recommend licensed HVAC contractor replace condensate pan.



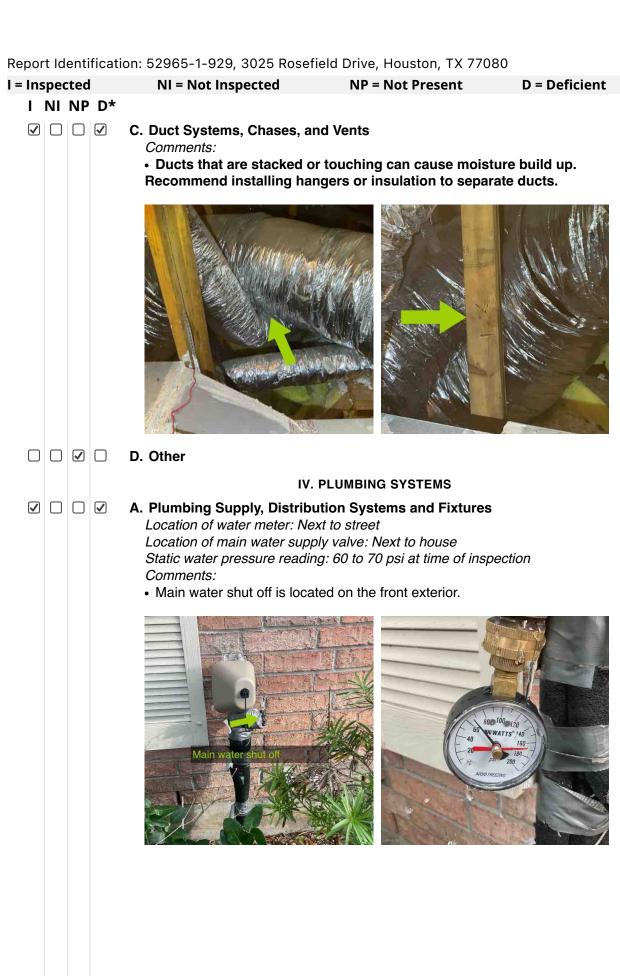

02/08/2024

- I = Inspected NI = Not Inspected NP = Not Present D = Deficient
  - I NI NP D\*
- Recommend replacing insulation around exterior plumbing pipes. (Exterior Front)



• "No sediment traps and/or drip legs noted on the natural gas lines at the mechanical equipment. Due to a change in construction standards, recommend plumber evaluate and repair as needed to meet todays standards."



✓ □ □ □ B. Drains, Wastes, and Vents

- I = Inspected
   NI = Not Inspected
   NP = Not Present
   D = Deficient

   I
   NI NP D\*
   Image: C. Water Heating Equipment
   Image: C. Water Heating Equipment
  - Energy Sources: Natural gas Capacity: 40 gallon Comments: • 2014.

Temperature and Pressure Relief Valve functioned properly when tested.



 $\checkmark \square \square \checkmark$ 

D. Hydro-Massage Therapy Equipment

- Comments:
- Whirlpool jets were not operational at time of inspection.

Recommend repair by qualified plumbing contractor.





- I NI NP D\*
- Image: Construction of the system of the

Comments:

• Gas meter is located on the exterior right side of the garage.



• Gas supply for appliances should be capped with a brass cap when not in use. (Laundry Room)




□ □ ☑ □ **F. Other** 

02/08/2024

D = Deficient

I = Inspected NI = Not Inspected NP = Not Present I NI NP D\* **V. APPLIANCES** A. Dishwasher Comments: • "Dishwasher was operated in normal mode, run through a complete, normal cycle. Function and operation appear to be normal. Lower access panel not removed. At the time of the inspection the dishwasher did not leak. Care should be taken the first time the dishwasher is run after a period of inactivity because seals tend to dry out and can leak at first. If this happens dry the area inside the unit where the leak is occurring and then re-start the dishwasher. Also be sure to follow the manufactures recommendation for type of soap and amount as this can be the cause of leaking. If it continues to leak repair is required." **B. Food Waste Disposers** Comments: • Disposal was not functioning at the time of the inspection. Recommend having qualified technician service/replace disposal as necessary to restore intended operation.

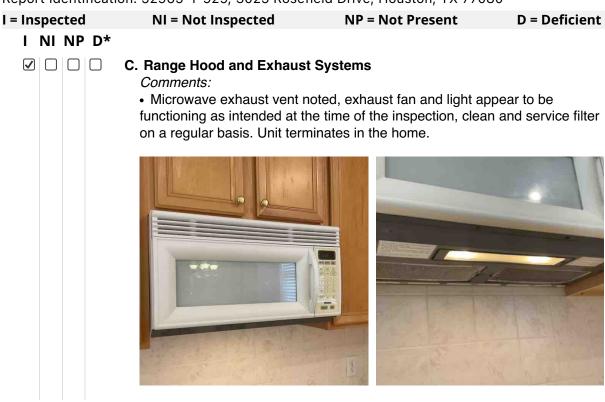

- I = Inspected NI = Not Inspected NP = Not Present D = Deficient
  - I NI NP D\*
  - $\checkmark$   $\square$   $\checkmark$  D

## D. Ranges, Cooktops, and Ovens

Comments:

• All Burners on gas cooktop functioned properly.

Oven Temperature was 348 degrees when set at 350 within the 25 degree tolerance.



• Flexible gas lines should not be installed through cabinets.



| l = Inspected | NI = Not Inspected | NP = Not Present | D = Deficient |
|---------------|--------------------|------------------|---------------|
| I NI NP D*    |                    |                  |               |

✓ □ □ □ ■ E. Microwave Ovens

- Comments:
- Microwave built-in unit functioning as intended at time of inspection.





## F. Mechanical Exhaust Vents and Bathroom Heaters Comments:

02/08/2024

NI = Not Inspected

NP = Not Present

D = Deficient

I NI NP D\*

I = Inspected

• Bathroom exhaust vent(s) do not terminate outside of the structure or are terminating in the soffit vent. Recommend adding an approved vent/duct to discharge/terminate outside the structure to reduce possible moisture buildup and related issues.



 $\checkmark \bigcirc \bigcirc \checkmark$ 

## G. Garage Door Operators

Comments:

• Garage door locking mechanism requires a stay open screw to protect opener.



I = Inspected NI = Not Inspected NP = Not Present D = Deficient

## I NI NP D\*

• The garage door opener was tested and the door opens and closes normally. The reversing function tested satisfactorily.



• Sensors for overhead garage door are installed too high.

Recommend having a garage door contractor service/repair/adjust as necessary to restore intended function and reduce possible safety related issues.



| l = Inspected         | NI = Not Inspected  | NP = Not Present | D = Deficient          |  |  |
|-----------------------|---|------------------|------------------------|--|--|
| I NI NP D*<br>♥ □ □ ♥ | <ul> <li>H. Dryer Exhaust Systems<br/>Comments:</li> <li>Dryer exhaust vent and<br/>reduce hazards associate</li> </ul> |                  | naintain dryer vent to |  |  |
|                       |   |                  |                        |  |  |
|                       | I. Other  |                  |                        |  |  |
|                       | VI  | OPTIONAL SYSTEMS |                        |  |  |
|                       | A. Landscape Irrigation (Sprinkler) Systems   |                  |                        |  |  |
|                       | B. Swimming Pools, Spas, Hot Tubs and Equipment   |                  |                        |  |  |
|                       | C. Other Built-in Appliances  | ;                |                        |  |  |
|                       | D. Other  |                  |                        |  |  |
| ~                     |   |                  |                        |  |  |

