

THE EXAMINERS HOME INSPECTIONS

346-413-9022 dben@examahome.com https://www.examahome.com



TREC REI 7-6

3201 Airport Blvd Houston, TX 77051





PROPERTY INSPECTION REPORT FORM

Jamie Gonzales & Jonathan Morales	05/17/2024 12:30 pm
Name of Client	Date of Inspection
3201 Airport Blvd, Houston, TX 77051	
Address of Inspected Property	
Ben Duta	TREC# 23232
Name of Inspector	TREC License #
Name of Sponsor (if applicable)	TREC License #

PURPOSE OF INSPECTION

A real estate inspection is a visual survey of a structure and a basic performance evaluation of the systems and components of a building. It provides information regarding the general condition of a residence at the time the inspection was conducted. *It is important* that you carefully read ALL of this information. Ask the inspector to clarify any items or comments that are unclear.

RESPONSIBILITY OF THE INSPECTOR

This inspection is governed by the Texas Real Estate Commission (TREC) Standards of Practice (SOPs), which dictates the minimum requirements for a real estate inspection.

The inspector IS required to:

- use this Property Inspection Report form for the inspection;
- inspect only those components and conditions that are present, visible, and accessible at the time of the inspection;
- indicate whether each item was inspected, not inspected, or not present;
- indicate an item as Deficient (D) if a condition exists that adversely and materially affects the performance of a system or component **OR** constitutes a hazard to life, limb or property as specified by the SOPs; and
- explain the inspector's findings in the corresponding section in the body of the report form.

The inspector IS NOT required to:

- identify all potential hazards;
- turn on decommissioned equipment, systems, utilities, or apply an open flame or light a pilot to operate any appliance;
- climb over obstacles, move furnishings or stored items;
- prioritize or emphasize the importance of one deficiency over another;
- provide follow-up services to verify that proper repairs have been made; or
- inspect system or component listed under the optional section of the SOPs (22 TAC 535.233).

RESPONSIBILTY OF THE CLIENT

While items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions, in the event that any further evaluations are needed, it is the responsibility of the client to obtain further evaluations and/or cost estimates from qualified service professionals regarding any items reported as Deficient (D). It is recommended that any further evaluations and/or cost estimates take place prior to the expiration of any contractual time limitations, such as option periods.

Please Note: Evaluations performed by service professionals in response to items reported as Deficient (D) on the report may lead to the discovery of additional deficiencies that were not present, visible, or accessible at the time of the inspection. Any repairs made after the date of the inspection may render information contained in this report obsolete or invalid.

REPORT LIMITATIONS

This report is provided for the benefit of the named client and is based on observations made by the named inspector on the date the inspection was performed (indicated above).

ONLY those items specifically noted as being inspected on the report were inspected.

This inspection IS NOT:

- a technically exhaustive inspection of the structure, its systems, or its components and may not reveal all deficiencies;
- an inspection to verify compliance with any building codes;
- an inspection to verify compliance with manufacturer's installation instructions for any system or component and DOES NOT imply insurability or warrantability of the structure or its components.

NOTICE CONCERNING HAZARDOUS CONDITIONS, DEFICIENCIES, AND CONTRACTUAL AGREEMENTS

<u>Conditions may be present in your home that did not violate building codes or common practices in effect when the home</u> was constructed but are considered hazardous by today's standards. Such conditions that were part of the home prior to the adoption of any current codes prohibiting them may not be required to be updated to meet current code requirements. However, if it can be reasonably determined that they are present at the time of the inspection, the potential for injury or property loss from these conditions is significant enough to require inspectors to report them as Deficient (D). Examples of such hazardous conditions include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices and arc-fault (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

Please Note: items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions. The decision to correct a hazard or any deficiency identified in an inspection report is left up to the parties to the contract for the sale or purchase of the home.

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

In Attendance: Buyer Occupancy: Vacant Style: Ranch Temperature (approximate): 80 Fahrenheit (F) Type of Building: Single Family, Detached Weather Conditions: Cloudy, Light Rain, Humid

Report Identification	on: <u>3201 Airport Blvd, Hou</u>	024		
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D				

I. STRUCTURAL SYSTEMS

🗆 🛛 A. Foundations

X

Type of Foundation(s): Slab on Grade *Comments:*

1: Vertical Crack

Recommendation
East

Recommendation: Contact a qualified professional.



2: Rebar Sticking Up From Ground Asafety Hazard

Exterior, east, towards center of property, immediately next to foundation Safety issue, app didn't properly upload photo

Recommendation: Contact a handyman or DIY project

3: Large Vertical Crack

Recommendation
 North
 Recommendation: Contact a qualified professional.

|--|

I NI NP D



4: Questionable Area/Possible Crack Recommendation North

Recommendation: Contact a qualified professional.



5: Large Vertical Crack
Recommendation
West
Recommendation: Contact a qualified profe

Recommendation: Contact a qualified professional.

NI=Not Inspected NP=	ot Present D=Deficient	
----------------------	------------------------	--

I NI NP D



6: Vertical Crack Recommendation West

Recommendation: Contact a qualified professional.



7: Vertical Crack Recommendation South Recommendation: Contact a qualified professional.

I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient
-------------	------------------	----------------	-------------

I NI NP D



8: Vertical Crack Recommendation South

Recommendation: Contact a qualified professional.



B. Grading and Drainage *Comments:*

 Image: C. Roof Covering Materials

 Types of Roof Covering: Asphalt

 Viewed From: Ladder

 Comments:

Image: Image shows a structure of the str

I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D				

Approximate Average Depth of Insulation: 10 R-value Comments: Attic Insulation Information: Type: Blown-In

Depth: 10 inches



1: Waves On Roof Covering Recommendation

Recommendation: Contact a qualified professional.



Image: Comments in the second seco

1: Sealing Needed Around Backsplash ©Recommendation

Prevents moisture intrusion

Recommendation: Recommended DIY Project

I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient

I NI NP D



2: Sealing Needed Around Top of Bathtub and Base Stand-Up Shower Recommendation

Prevents moisture intrusion

Recommendation: Recommended DIY Project



3: Crack In Wall to Ceiling Corner Recommendation West bedroom Possible structural issue

Recommendation: Contact a qualified professional.



☑ □ □ □ F. Ceilings and Floors

Report Identification: <u>3201 Airport Blvd, Houston, TX 77051 - May 17, 2024</u>						
I=I	nspeo	cted		NI=Not Inspected NP=Not Present D=Deficient		
Ι	NI	NP	D			
				Comments:		
X				G. Doors (Interior and Exte <i>Comments:</i>	rior)	
X				H. Windows Window Type: Double-Pane Comments:		
X				I. Stairways (Interior and E Comments:	xterior)	
		×		J. Fireplaces and Chimneys Comments:		
×				K. Porches, Balconies, Deck <i>Comments:</i>	s, and Carports	
				L. Walkways and Driveway 1: Sealing Needed Peccommendation Driveway Seal to prevent moisture inth Recommendation: Recomm	rusion	

^{2:} Differential Settlement of Driveway

Report Identification	on: <u>3201 Airport Blvd, Hou</u>	ston, TX 77051 - May 17, 20	024	
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D				

Recommendation

Driveway

Recommend leveling and sealing to control moisture direction away from home

Recommendation: Contact a qualified professional.



3: Leveling Needed While Increasing Pitch Away From Home Recommendation

Prevents moisture intrusion into the home and foundation

Recommendation: Contact a qualified professional.




Report Identification	n: <u>3201 Airport Blvd, Housto</u>	n, TX 77051 - May 17, 2024	<u>1</u>
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient
I NI NP D			

II. ELECTRICAL SYSTEMS

🛛 🗆 🖾 A. Service Entrance and Panels

Comments: Location of Service Panel: Northwest corner exterior

Location Of Main Shut-Off: Northwest corner exterior

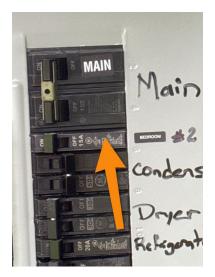

Max Amp: 100

Service Panel Details: GE



Wire Type: Copper

Service Panel Receptacles:

I=Inspected NI=Not Inspected NI	P=Not Present	D=Deficient
---------------------------------	---------------	-------------

I NI NP D



1: Missing Switch Plate Recommendation

Recommend installing to keep debris out of back panel

Recommendation: Contact a qualified professional.



\mathbf{X}

 B. Branch Circuits, Connected Devices, and Fixtures Type of Wiring: Copper Comments:

1: Disposer and Diswasher Receptacles Not Secured ASafety Hazard

Underneath kitchen sink

Recommend securing properly to avoid electric shock

Recommendation: Contact a qualified professional.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I NI NP D



2: Non-GFCI Outlets Near Sink ASafety Hazard Kitchen Need to be changed to GFCI as it's within 6 feet of the faucet

Recommendation: Contact a qualified professional.

3: Open Hot Outlets

ASafety Hazard West Bedroom / All Outlets Could overheat and cause personal injury

Recommendation: Contact a qualified professional.



C. Other Comments:

Page 13 of 22

Report Identification	n: 3201 Airport Blvd, Houston	n, TX 77051 - May 17, 2024	
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient
I NI NP D			

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

□ □ □ □ A. Heating Equipment Type of Systems: Gas-Fired Heat Energy Sources: Gas Comments: Furnace Manufacturer Information: Brand: Carrier

Year: 2021



Could Not Inspect Furnace Due To Gas Being Off:

1: Debris In Drain Pan Recommendation

Recommend cleaning for proper draining

Recommendation: Recommended DIY Project



2: Debris In Furnace Firebox Recommendation Clean for maximum efficiency

Report Identification	: 3201 Airport Blvd, Houston	, TX 77051 - May 17, 2024	
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient

Recommendation: Contact a qualified professional.



\mathbf{X}

NI

I

NP

D

B. Cooling Equipment

Type of Systems: Central Air Conditioner *Comments:*

AC Condenser Unit Informations: WeatherMaker

Year: 2021



A/C Delta Ts: Supply Temperature: 72 degrees


Lowest Return Temperature: 61.3 degrees

RESULT: within normal range, between 15-20 degrees

Page 15 of 22


I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient

I NI NP D

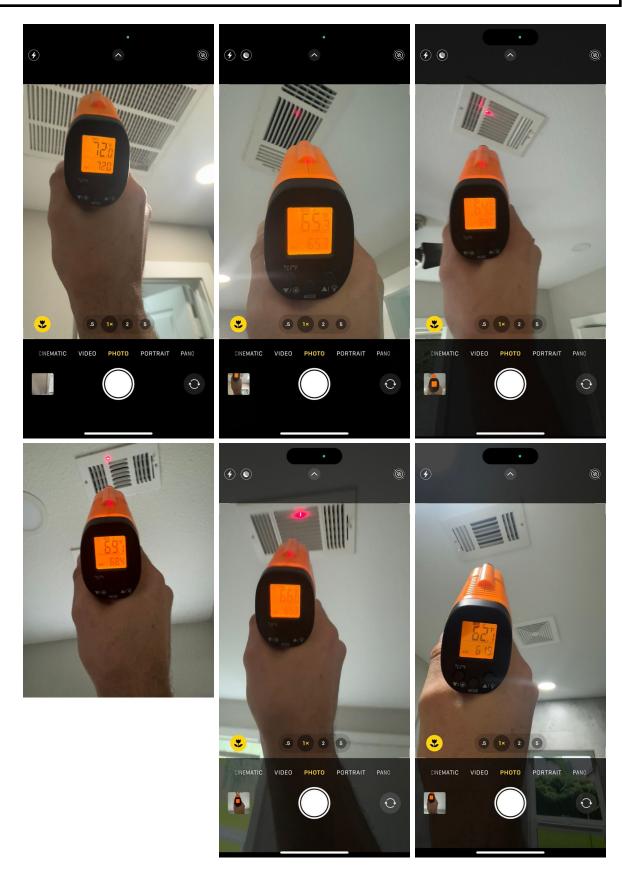

I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient
-------------	------------------	----------------	-------------

I NI NP D

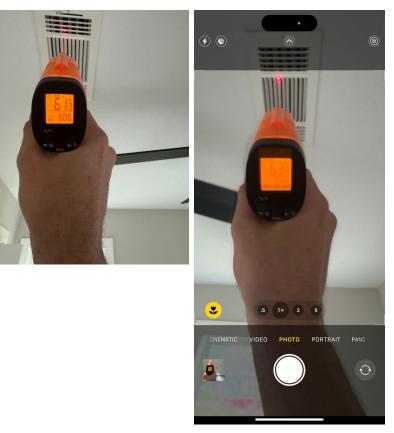

1: Water In Furnace Drain Pan Constant

Recommendation: Contact a qualified professional.



C. Duct Systems, Chases, and Vents Comments:

D. Other

Comments:

X

Report Identification: 3201 Airport Blvd, Houston, TX 77051 - May 17, 2024						
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient			
I NI NP D						

IV. PLUMBING SYSTEMS

■ □ □ A. Plumbing Supply, Distribution Systems, and Fixtures

Comments: Water Heater Information: Rheem

30 Gallon

Could not get close enough to take picture of manufacturer label due to limited space

Attic PSI To Home :



 \mathbf{X} \Box \Box

□ A. Plumbing Supply, Distribution Systems, and Fixtures

Comments: Main Water Shut-Off Location: West, closer to street

I=Inspected NI=Not Inspected	NP=Not Present	D=Deficient	
------------------------------	----------------	-------------	--

I NI NP D



- Image: Image with the system is a system is a system with the system is a syst
- Image: Constraint of the second system of
- **D. Hydro-Massage Therapy Equipment** *Comments:*
- □ □ □ □ □ E. Gas Distribution Systems and Gas Appliances Type of Gas Distribution Piping Material: Cast Iron Comments: Main Gas Shut-Off Location: North, center of property

I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D				





Page 20 of 22

R	eport	Ident	ificati	ion: <u>3201 Airport Blvd, Hous</u>	ston, TX 77051 - May 17, 20	024	
I=Inspected			NI=Not Inspected	NP=Not Present	D=Deficient		
Ι	NI	NP	D				
					V. APPLIANCE	S	
X				A. Dishwashers Comments:			
X				B. Food Waste Disposers <i>Comments:</i>			
X				C. Range Hood and Exha <i>Comments:</i>	ust Systems		
X			X	D. Ranges, Cooktops, and <i>Comments:</i> <i>Manufacturer Information</i> Whirlpool			
				White			

Couldn't Test Burners and Stove: Gas is not turned on

Oven

E. Microwave Ovens

Comments: Manufacturer Information: LG

Report Identification	: 3201 Airport Blvd, Houston	, TX 77051 - May 17, 2024	
I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient

Ι	NI	NP	D	



- **EXAMPLE 1 F. Mechanical Exhaust Vents and Bathroom Heaters** *Comments:*
- □ □ ⊠ □ G. Garage Door Operators Comments:

- H. Dryer Exhaust Systems Comments:
 - □ I. Disposer Manufacturer Information: Moen



1: No Power To Disposer →Recommendation The nearest switches do not activate the disposer

Recommendation: Contact a qualified professional.