

Jimmy Longoria Lic #7746
First Quality Home Inspections

2623 Oakcliff St
Inspection Prepared For: Amanda Palacios
Agent:

Date of Inspection: 5/7/2024

Year Built: Built 1929 Size: Approx 1396sf

**Weather: Clear** 

#### PROPERTY INSPECTION REPORT FORM

Amanda Palacios Name of Client	5/7/2024 Date of Inspection
2623 Oakcliff St, Houston, TX 77023  Address of Inspected Property	
Jimmy Longoria Name of Inspector	Lic #7746 TREC License #
Name of Sponsor (if applicable)	TREC License #

#### **PURPOSE OF INSPECTION**

A real estate inspection is a visual survey of a structure and a basic performance evaluation of the systems and components of a building. It provides information regarding the general condition of a residence at the time the inspection was conducted. It is important that you carefully read ALL of this information. Ask the inspector to clarify any items or comments that are unclear.

#### RESPONSIBILTY OF THE INSPECTOR

This inspection is governed by the Texas Real Estate Commission (TREC) Standards of Practice (SOPs), which dictates the minimum requirements for a real estate inspection.

The inspector IS required to:

- use this Property Inspection Report form for the inspection;
- inspect only those components and conditions that are present, visible, and accessible at the time of the inspection;
- indicate whether each item was inspected, not inspected, or not present;
- indicate an item as Deficient (D) if a condition exists that adversely and materially affects the performance of a system or component **OR** constitutes a hazard to life, limb or property as specified by the SOPs; and
- explain the inspector's findings in the corresponding section in the body of the report form.

The inspector IS NOT required to:

- identify all potential hazards;
- turn on decommissioned equipment, systems, utilities, or apply an open flame or light a pilot to operate any appliance;
- climb over obstacles, move furnishings or stored items;
- prioritize or emphasize the importance of one deficiency over another;
- provide follow-up services to verify that proper repairs have been made; or
- inspect system or component listed under the optional section of the SOPs (22 TAC 535.233).

#### **RESPONSIBILTY OF THE CLIENT**

While items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions, in the event that any further evaluations are needed, it is the responsibility of the client to obtain further evaluations and/or cost estimates from qualified service professionals regarding any items reported as Deficient (D). It is recommended that any further evaluations and/or cost estimates take place prior to the expiration of any contractual time limitations, such as option periods.

**Please Note:** Evaluations performed by service professionals in response to items reported as Deficient (D) on the report may lead to the discovery of additional deficiencies that were not present, visible, or accessible at the time of the inspection. Any repairs made after the date of the inspection may render information contained in this report obsolete or invalid.

#### **REPORT LIMITATIONS**

This report is provided for the benefit of the named client and is based on observations made by the named inspector on the date the inspection was performed (indicated above).

ONLY those items specifically noted as being inspected on the report were inspected.

This inspection IS NOT:

- a technically exhaustive inspection of the structure, its systems, or its components and may not reveal all deficiencies;
- an inspection to verify compliance with any building codes;
- an inspection to verify compliance with manufacturer's installation instructions for any system or component and DOES NOT imply insurability or warrantability of the structure or its components.

#### NOTICE CONCERNING HAZARDOUS CONDITIONS, DEFICIENCIES, AND CONTRACTUAL AGREEMENTS

Conditions may be present in your home that did not violate building codes or common practices in effect when the home was constructed but are considered hazardous by today's standards. Such conditions that were part of the home prior to the adoption of any current codes prohibiting them may not be required to be updated to meet current code requirements. However, if it can be reasonably determined that they are present at the time of the inspection, the potential for injury or property loss from these conditions is significant enough to require inspectors to report them as Deficient (D). Examples of such hazardous conditions include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices and arc-fault (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- · lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

Please Note: items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions. The decision to correct a hazard or any deficiency identified in an inspection report is left up to the parties to the contract for the sale or purchase of the home.

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

## **Table Of Contents**

STRUCTURAL SYSTEMS	4-11
ELECTRICAL SYSTEMS	12-14
HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS	15-16
PLUMBING SYSTEMS	17-20
APPLIANCES	21-22
OPTIONAL SYSTEMS	23-29
Glossary	30
Report Summary	31-33

NI=Not Inspected NP=Not Present D=Deficient I=Inspected NI NP D

#### I. STRUCTURAL SYSTEMS

A. Foundations

Type of Foundation(s):

Crawlspace Foundation

#### Comments:

- Structural movement and/or settling noted. Suggest that a licensed professional be consulted for further evaluation.
- Crawlspace access too low unable to inspect properly
- Unable to inspect floor boards, plumbing pipes and other areas in crawlspace properly
- No access to crawlspace unable to inspect properly





Structural movement and/or settling noted. Suggest that a licensed professional be consulted Suggest that a licensed professional be consulted for further evaluation.

Structural movement and/or settling noted. for further evaluation.

B. Grading and Drainage

- Inadequate grading improper slope in some areas
- Tree too close to structure
- · Inadequate grading high soil
- Debris in gutters



Inadequate grading - high soil



Inadequate grading - improper slope in some areas



Tree too close to structure



Inadequate grading - improper slope in some

NI NP D



Debris in gutters

C. Roof Covering Materials

Type(s) of Roof Covering:
• Asphalt shingles noted.

Viewed From:

Roof

- · Roof covering was functioning as intended at the time of inspection
- · No soffits installed for air intake into attic





Roof covering was functioning as intended at the Roof covering was functioning as intended at the time of inspection

time of inspection

D. Roof Structure and Attics

Viewed From:

Attic

Approximate Average Depth of Insulation:
• Insulation is 13 inches deep

Comments:

- · Missing weatherstripping and insulation on attic door
- Previous water stains noted on roof sheeting in attic





Missing weatherstripping and insulation on attic door

Previous water stains noted on roof sheeting in

E. Walls (Interior and Exterior)

# Wall Materials:

- Reseal expansion joints
- Previous patches on sheetrock in some areas
- Cracks on sheetrock in different areas
- Enclose opening at roof level around a/d supply line into home





Reseal expansion joints



Enclose opening at roof level around a/c supply line into home

Reseal expansion joints



Cracks on sheetrock in different areas

NI NP D

I=Inspected NI=Not Inspected NP=Not Present D=Deficient



Previous patches on sheetrock in some areas

Ceiling and Floor Materials: Comments:

- Floor in Center Bedroom slopes
- Crack on ceiling in Back Bedroom
- · Crack on ceiling in Living Area
- Slopes noted floor in different areas




Crack on ceiling in Living Area

X G. Doors (Interior and Exterior)

- Missing striker plates on back doors
- Missing weatherstripping on Front Door

NI NP D

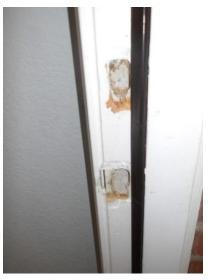

Missing striker plates on back doors

H. Windows

# Window Types: Comments:

- · Cracked window pane in Master Bedroom and in Living Area
- Some windows do not lock
- Broken locks on window in Laundry Room



Cracked window pane in Master Bedroom and in Living Area



Some windows do not lock

NI NP D





Cracked window pane in Master Bedroom and in Living Area

Broken locks on window in Laundry Room

I. Stairways (Interior and Exterior)

Comments:

J. Fireplaces and Chimneys

Locations:

Types:

Comments:

K. Porches, Balconies, Decks, and Carports

- Cracks noted on driveway
- Enclose opening on carport at side of house
- · Water standing on roof of carport
- Dip noted on roof of carport

NI NP D





Cracks noted on driveway

Enclose opening on carport at side of house



Water standing on roof of carport

L. Other

Materials:

Comments:

· Recommend having a termite inspection on house and back building

NI=Not Inspected NP=Not Present D=Deficient I=Inspected NI NP D

#### II. ELECTRICAL SYSTEMS

A. Service Entrance and Panels

#### Panel Locations:

- Electrical panel is located at the exterior of structure
- GE

Materials and Amp Rating:

- Copper wiring
- 125 amp

- · Underground electrical wires not inspected
- No AFCI breakers present
- No bonding ground
- The panel was not labeled properly
- · Recommend having electrical system checked due to one breaker heating up more than normal




The panel was not labeled properly

B. Branch Circuits, Connected Devices, and Fixtures

Type of Wiring:
• Copper wiring

- Smoke detectors functioned at the time of inspection
- No GFCI outlets on exterior
- No carbon monoxide detectors present
- Not all outlets in Kitchen are on GFCI protection
- GFCI outlet in Hall Bath did not function at the time of inspection
- No electrical outlet in Master Bath
- No smoke detector in Back bedroom and in Hallway
- Exterior outlet not weather covered
- Exterior electrical wires not enclosed properly



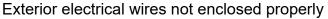



GFCI outlet in Hall Bath did not function at the time of inspection





Exterior outlet not weather covered

Smoke detectors functioned at the time of inspection

C. Other

Comments:

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

A. Heating Equipment

Type of Systems: • Carrier

Energy Sources:
• The furnace is electrically powered

• Unit functioned as intended at the time of inspection

NI NP D



Unit functioned as intended at the time of inspection

Unit functioned as intended at the time of inspection

B. Cooling Equipment

Type of Systems:

Carrier

- Condenser 2020 model
- 3 ton unit
- Unit did not cool sufficiently
- Return Air = 69 degrees; Supply Air = 57 degrees; Differential = 12 degrees
- Recommend service and further evaluation by a licensed professional
- No cut off switch on secondary drain pan





Unit did not cool sufficiently


No cut off switch on secondary drain pan

I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient
I NI NP D			
X	C. Duct Systems, Chas	ses, and Vents	
	Comments:		
	D. Other		
	Comments:		
	IV.	PLUMBING SYSTEMS	
$X \square \square X$	A. Plumbing Supply, D	istribution System and F	ixtures
	Location of Water Met • Front of structure	er:	

Location of Main Water Supply Valve: • Front of structure Comments:

- Static Water Pressure Reading:55
- PEX Plumbing Lines
- Water pressure drops when more than one faucet is turned on
- Enclose openings around kitchen sink supply and drain lines
- Master Bath reseal seams on shower tiles where they meet floor tiles
- Unable to determine extent of repair/replacement of plumbing lines



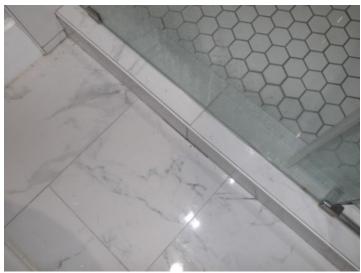

Enclose openings around kitchen sink supply and drain lines

B. Drains, Wastes, Vents

Type of Drain Piping Material:

Únknown

#### Observations:

- Underground drain lines not inspected
- Unable to locate exterior clean out drain
- Unable to determine type of drain piping material
- Recommend cleaning and checking underground drain lines
- Broken cap on exterior drain Unable to determine source of drain (no water flowing through drain at the time of inspection)



Broken cap on exterior drain - Unable to determine source of drain (no water flowing through drain at the time of inspection)


C. Water Heating Equipment

**Energy Source:** 

- · Water heater is gas powered
- Water heater is located in the exterior closet
- Kenmore

Capacity:
• Unit is 30 gallons

- 2002 model
- Unit is at it's life expectancy
- · Unable to get unit to turn on
- Flue vent too close to combustible material
- Flue vent not vented to exterior and not capped properly
- Flue vent not the proper type
- Rust damage on unit
- Water damaged boards on stand for water heater
- No T/P drain line

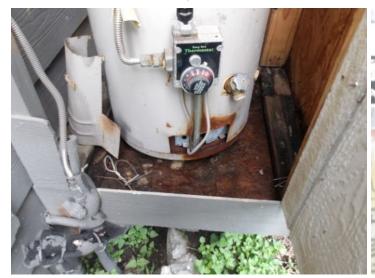





Rust damage on unit

No T/P drain line

NI NP D

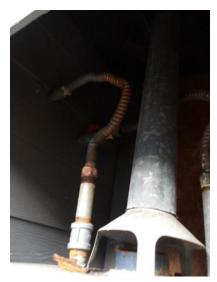

Flue vent not the proper type

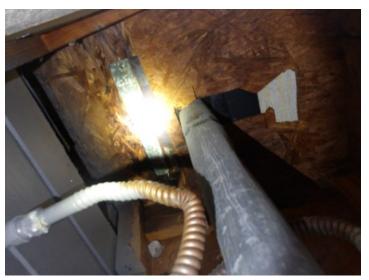

Flue vent too close to combustible material



Unable to get unit to turn on

D. Hydro-Massage Therapy Equipment

Comments:

E. Gas Distribution Systems and Gas Appliances

Location of Gas Meter:

East

Type of Gas Distribution Piping Material:

Galvanized

Comments:

· Underground gas line not inspected

B. Food Waste Disposers

### Comments:

• Unit functioned as intended at the time of inspection

NI NP D



Unit functioned as intended at the time of inspection

χ C. Range Hood and Exhaust Systems

Comments:

• Unit functioned as intended at the time of inspection

 $\chi$  D. Ranges, Cooktops, and Ovens

#### Comments:

- Unit functioned as intended at the time of inspection
- · No anti-tilt device bracket present



No anti-tilt device bracket present

X E. Microwave Ovens

#### Comments:

• Unit functioned as intended at the time of inspection

NI=Not Inspected	NP=Not Present	D=Deficient
F. Mechanical Exhaust	Vents and Bathroom H	Heaters
Comments: • Exhaust fan (s) functi	oned at the time of ins	pection
G. Garage Door Opera	tors	
Door Type: Comments:		
H. Dryer Exhaust Syste	ems	
Comments:		
I. Other		
Comments: • Outdoor equipment n	ot inspected	
VI.	OPTIONAL SYSTEMS	
A. Landscape Irrigation	(Sprinkler) Systems	
Comments:		
B. Swimming Pools, Sp	pas, Hot Tubs, and Equ	iipment
Type of Construction: Comments:		
	F. Mechanical Exhaust Comments: • Exhaust fan (s) functi G. Garage Door Opera Door Type: Comments: H. Dryer Exhaust Syste Comments: I. Other Comments: • Outdoor equipment n VI.  A. Landscape Irrigation Comments: B. Swimming Pools, Sp Type of Construction:	F. Mechanical Exhaust Vents and Bathroom F. Comments:

I=Inspected	NI=Not Inspected	NP=Not Present	D=Deficient	
I NI NP D	)			
$X \square \square X$	C. Outbuildings			

## Materials:

- NEW Oven in Back Building functioned as intended
- NEW Microwave in Back Building functioned as intended
- NEW Range Hood in Back Building functioned as intended
- NEW Disposal in Back Building functioned as intended
- A/C window unit functioned at the time of inspection
- Smoke detector in Back Building functioned at the time of inspection
- · Bedrrom door rubs on frame in Back Building
- Bath in Back Building some type of leak coming from shower unable to determine source
- No water out of exterior shower
- A/C window unit loose in Back Building
- · Inadequate grading high soil at Back Buidling
- Structural movement and/or settling noted in Back Building. Suggest that a licensed professional be consulted for further evaluation.
- · No attic entry in Back Building
- No anti-tilt device bracket present on oven in Back Building
- Cracks on ceiling in Back Building
- Missing weatherstripping on Front Door of Back Building
- Cracks on sheetrock in Back Building
- Rotted and damaged boards on Back shed
- Rotted and damaged roof sheeting on Back shed
- Tree limbs rubbing on roof of Back Building
- Unable to determine of some type of flashing was used on roof level of Back Building
- Roof covering was functioning as intended at the time of inspection on Back Building
- A/C window unit blocking only window in bedroom is a safety hazard does not provide adequate exit in the case of a fire in Back Building





Rotted and damaged roof sheeting on Back shed Unable to determine of some type of flashing was used on roof level of Back Building



Roof covering was functioning as intended at the time of inspection on Back Building



No anti-tilt device bracket present on oven in Back Building



NEW - Microwave in Back Building functioned as intended




NEW - Disposal in Back Building functioned as intended




A/C window unit blocking only window in bedroom is a safety hazard - does not provide adequate exit in the case of a fire in Back Building



Bedrrom door rubs on frame in Back Building

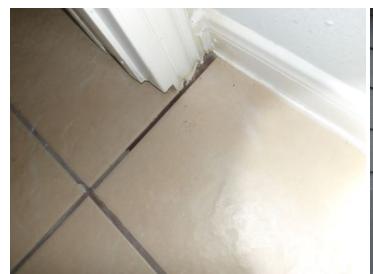

Bath in Back Building - some type of leak coming from shower - unable to determine source

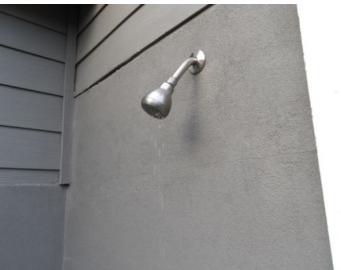

No water out of exterior shower



Structural movement and/or settling noted in Back Building. Suggest that a licensed professional be consulted for further evaluation.

Structural movement and/or settling noted in Back Building. Suggest that a licensed professional be consulted for further evaluation.






Cracks on ceiling in Back Building



Smoke detector in Back Building functioned at the time of inspection

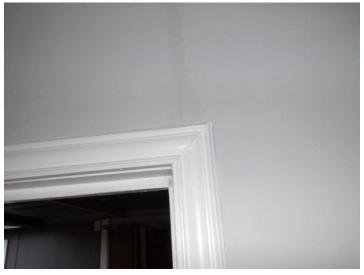

Cracks on sheetrock in Back Building



Missing weatherstripping on Front Door of Back Building





Rotted and damaged boards on Back shed

Rotted and damaged roof sheeting on Back shed

D. Private Water Wells (A coliform analysis is recommended)

Type of Pump: Type of Storage Equipment: Comments:

E. Private Sewage Disposal Systems

Type of System: Location of Drain Field: Comments:

F. Other Built-in Appliances

Comments:

G. Other

# Glossary

Term	Definition
A/C	Abbreviation for air conditioner and air conditioning
AFCI	Arc-fault circuit interrupter: A device intended to provide protection from the effects of arc faults by recognizing characteristics unique to arcing and by functioning to de-energize the circuit when an arc fault is detected.
GFCI	A special device that is intended for the protection of personnel by de-energizing a circuit, capable of opening the circuit when even a small amount of current is flowing through the grounding system.

## **Report Summary**

STRUCTURAL SYSTEMS		
Page 4 Item: A	Foundations	<ul> <li>Structural movement and/or settling noted. Suggest that a licensed professional be consulted for further evaluation.</li> <li>Crawlspace access too low - unable to inspect properly</li> <li>Unable to inspect floor boards, plumbing pipes and other areas in crawlspace properly</li> <li>No access to crawlspace - unable to inspect properly</li> </ul>
Page 4 Item: B	Grading and Drainage	<ul> <li>Inadequate grading - improper slope in some areas</li> <li>Tree too close to structure</li> <li>Inadequate grading - high soil</li> <li>Debris in gutters</li> </ul>



Inadequate grading - improper slope in some areas

Page 6 Item: C	Roof Covering Materials	No soffits installed for air intake into attic
Page 7 Item: D	Roof Structure and Attics	<ul><li>Missing weatherstripping and insulation on attic door</li><li>Previous water stains noted on roof sheeting in attic</li></ul>
Page 7 Item: E	Walls (Interior and Exterior)	<ul> <li>Reseal expansion joints</li> <li>Previous patches on sheetrock in some areas</li> <li>Cracks on sheetrock in different areas</li> <li>Enclose opening at roof level around a/d supply line into home</li> </ul>
Page 9 Item: F	Ceilings and Floors	<ul> <li>Floor in Center Bedroom slopes</li> <li>Crack on ceiling in Back Bedroom</li> <li>Crack on ceiling in Living Area</li> <li>Slopes noted floor in different areas</li> </ul>
Page 9 Item: G	Doors (Interior and Exterior)	<ul><li>Missing striker plates on back doors</li><li>Missing weatherstripping on Front Door</li></ul>

Page 10 Item: H	Windows	<ul> <li>Cracked window pane in Master Bedroom and in Living Area</li> <li>Some windows do not lock</li> <li>Broken locks on window in Laundry Room</li> </ul>
Page 11 Item: K	Porches, Balconies, Decks, and Carports	<ul> <li>Cracks noted on driveway</li> <li>Enclose opening on carport at side of house</li> <li>Water standing on roof of carport</li> <li>Dip noted on roof of carport</li> </ul>
Page 12 Item: L	Other	• Recommend having a termite inspection on house and back building
<b>ELECTRICAL SY</b>	STEMS	
Page 13 Item: A	Service Entrance and Panels	<ul> <li>No AFCI breakers present</li> <li>No bonding ground</li> <li>The panel was not labeled properly</li> <li>Recommend having electrical system checked due to one breaker heating up more than normal</li> </ul>
Page 14 Item: B	Branch Circuits, Connected Devices, and Fixtures	<ul> <li>No GFC outlets on exterior</li> <li>No carbon monoxide detectors present</li> <li>Not all outlets in Kitchen are on GFCI protection</li> <li>GFCI outlet in Hall Bath did not function at the time of inspection</li> <li>No electrical outlet in Master Bath</li> <li>No smoke detector in Back bedroom and in Hallway</li> <li>Exterior outlet not weather covered</li> <li>Exterior electrical wires not enclosed properly</li> </ul>
HEATING, VENT	LATION AND AIR C	ONDITIONING SYSTEMS
Page 16 Item: B	Cooling Equipment	
PLUMBING SYST	ΓEMS	
Page 17 Item: A	Plumbing Supply, Distribution System and Fixtures	<ul> <li>Water pressure drops when more than one faucet is turned on</li> <li>Enclose openings around kitchen sink supply and drain lines</li> <li>Master Bath - reseal seams on shower tiles where they meet floor tiles</li> <li>Unable to determine extent of repair/replacement of plumbing lines</li> </ul>
Page 18 Item: B	Drains, Wastes, Vents	<ul> <li>Unable to locate exterior clean out drain</li> <li>Unable to determine type of drain piping material</li> <li>Recommend cleaning and checking underground drain lines</li> <li>Broken cap on exterior drain - Unable to determine source of drain (no water flowing through drain at the time of inspection)</li> </ul>

Page 19 Item: C	Water Heating	Unit is at it's life expectancy
	Equipment	Unable to get unit to turn on
		Flue vent too close to combustible material
		<ul> <li>Flue vent not vented to exterior and not capped properly</li> </ul>
		Flue vent not the proper type
		Rust damage on unit
		Water damaged boards on stand for water heater
		No T/P drain line
APPLIANCES		
Page 21 Item: A	Dishwashers	Unit did not function properly - no water coming into unit
Page 22 Item: D	Ranges, Cooktops, and Ovens	No anti-tilt device bracket present
Page 23 Item: I	Other	Outdoor equipment not inspected
OPTIONAL SYST	EMS	
Page 24 Item: C	Outbuildings	Bedrrom door rubs on frame in Back Building
		Bath in Back Building - some type of leak coming from
		shower - unable to determine source
		No water out of exterior shower
		A/C window unit loose in Back Building
		Inadequate grading - high soil at Back Buidling
		• Structural movement and/or settling noted in Back Building. Suggest that a licensed professional be consulted for further evaluation.
		No attic entry in Back Building
		<ul> <li>No anti-tilt device bracket present on oven in Back Building</li> <li>Cracks on ceiling in Back Building</li> </ul>
		<ul> <li>Missing weatherstripping on Front Door of Back Building</li> <li>Cracks on sheetrock in Back Building</li> </ul>
		Rotted and damaged boards on Back shed
		Rotted and damaged roof sheeting on Back shed
		Tree limbs rubbing on roof of Back Building
		Unable to determine of some type of flashing was used on roof level of Back Building
		Roof covering was functioning as intended at the time of inspection on Back Building
		• A/C window unit blocking only window in bedroom is a safety hazard - does not provide adequate exit in the case of a fire in Back Building