



Simply The Best!

Inspection Report

Angel Polka

Property Address:
3521 Pearl Mill Ln
Conroe TX 77301



Hilsher Group LLC

**Reevis Coleman Schultz Texas Professional Home Inspector #21983
2020 N Loop W #150
Houston ,Texas 77018**

PROPERTY INSPECTION REPORT

Prepared For: Angel Polka
(Name of Client)

Concerning: 3521 Pearl Mill Ln, Conroe, TX 77301
(Address or Other Identification of Inspected Property)

By: Reevis Coleman Schultz Texas Professional Home Inspector / Hilsher Group LLC
1/6/2022
(Name and License Number of Inspector) (Date)

(Name, License Number of Sponsoring Inspector)

PURPOSE, LIMITATIONS AND INSPECTOR / CLIENT RESPONSIBILITIES

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at www.trec.texas.gov.

The TREC Standards of Practice (Sections 535.227-535.233 of the Rules) are the minimum standard for inspections by TREC Licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is NOT required to turn on decommissioned equipment, systems, utility services or apply an open flame or light a pilot to operate any appliance. The inspector is NOT required to climb over obstacles, move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer's installation instructions. The inspection does NOT imply insurability or warrantability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector shall indicate, by checking the appropriate boxes on the form, whether each item was inspected, not inspected, not present or deficient and explain the findings in the corresponding section in the body of the report form. The inspector must check the Deficient (D) box if a condition exists that adversely and materially affects the performance of a system or component or constitutes a hazard to life, limb or property as specified by the TREC Standards of Practice. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing components, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards or Deficiencies below.

THIS PROPERTY INSPECTION IS NOT A TECHNICALLY EXHAUSTIVE INSPECTION OF THE STRUCTURE, SYSTEMS OR COMPONENTS. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers.

Promulgated by the Texas Real Estate Commission(TREC) P.O. Box 12188, Austin, TX 78711-2188 (512)936-3000
(<http://www.trec.state.tx.us>).

You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions expressed in previous or future reports.

ITEMS IDENTIFIED IN THE REPORT DO NOT OBLIGATE ANY PARTY TO MAKE REPAIRS OR TAKE OTHER ACTIONS, NOR IS THE PURCHASER REQUIRED TO REQUEST THAT THE SELLER TAKE ANY ACTION. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods.

Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES

Each year, Texans sustain property damage and are injured by accidents in the home. While some accidents may not be avoidable, many other accidents, injuries, and deaths may be avoided through the identification and repair of certain hazardous conditions. Examples of such hazards include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices for electrical receptacles in garages, bathrooms, kitchens, and exterior areas;
- malfunctioning arc fault protection (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.

These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions. While the TREC Standards of Practice do not require inspectors to perform a code compliance inspection, TREC considers the potential for injury or property loss from the hazards addressed in the Standards of Practice to be significant enough to warrant this notice.

Contract forms developed by TREC for use by its real estate licensees also inform the buyer of the right to have the home inspected and can provide an option clause permitting the buyer to terminate the contract within a specified time. Neither the Standards of Practice nor the TREC contract forms require a seller to remedy conditions revealed by an inspection. The decision to correct a hazard or any deficiency identified in an inspection report is left to the parties to the contract for the sale or purchase of the home.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR:

Standards of Practice:

TREC Texas Real Estate Commission

In Attendance:

Vacant (inspector only)

Type of building:

Single Family (1 story)

Style of Home:

Traditional

Approximate age of building:

New Construction

Home Faces:

East

Temperature:

Below 65 (F) = 18 (C)

Weather:

Clear

Ground/Soil surface condition:

Dry

Rain in last 3 days:

No

Comments: Set by agent/SS

Requests Coleman

FINAL

SD: Barton Woods

Builder: DR Horton

bclewis@drhorton.com

Referral: Realtor

Rooms:

Utilities On: None

People Present at Inspection: Buyer

I = Inspected NI = Not Inspected NP = Not Present D = Deficient


I NI NP D

I. STRUCTURAL SYSTEMS

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.



stick built with radiant barrier

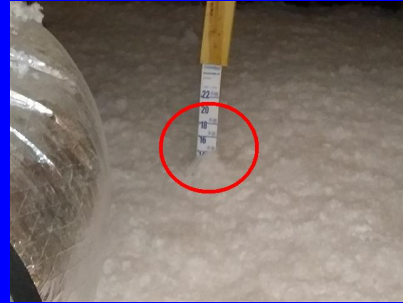

fiberglass blown 14 inches average



A. Foundations

Type of Foundation (s): Poured concrete

Method used to observe Crawlspace: No crawlspace

Comments:

(1) This is not an engineering report, but is only an opinion based on observation of conditions known to be related to foundation performance, using the knowledge and experience of the inspector.

(2) The foundation is poured on grade with post tension cables and appears to be performing as designed.

B. Grading and Drainage

Comments:

(1) The gutter downspout(s) missing deflector(s) at the exterior. Erosion can continue or become worse if not corrected. A qualified contractor should inspect and replace as needed.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D



B. Item 1(Picture) left side of home x2

(2) Downspouts discharges onto roofing surface in areas of the roof. Deterioration could occur if not corrected. I recommend having a qualified contractor make repairs as needed.



B. Item 2(Picture) roof line areas

C. Roof Covering Materials

Types of Roof Covering: Architectural


Viewed from: Ground, Ladder, Walked roof, Attic

Roof Ventilation: Soffit Vents, Passive

Comments:

(1) This inspection does not warrant against roof leaks.

(2) The flashing is not clearly visible and I am unable to verify proper installation and condition. I recommend consulting with a roofing professional to evaluate and make any necessary repairs.

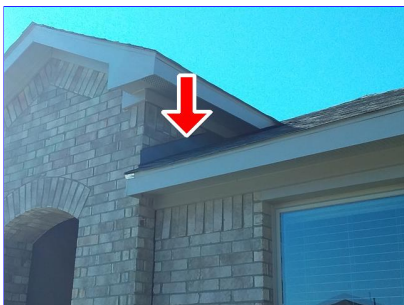

C. Item 1(Picture) roof line areas

(3) Kick out flashing is missing in areas of the roof. This is not considered today's standard. I recommend having a qualified roofing company make repairs as needed.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---

Re-inspected 01/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.



C. Item 2(Picture)

(4) The metal drip edge not painted along rake/eave at the exterior areas. Deterioration may occur if not corrected. A qualified contractor should inspect and repair as needed. Gutters have been installed. Area was not visible at time of re inspection.



C. Item 3(Picture) front of home



C. Item 4(Picture)

D. Roof Structures and Attics

Method used to observe attic: From entry, Walked, Inaccessible

Viewed from: Attic, Ground, Ladder, Walked roof

Roof Structure: Stick-built, 2 X 6 Rafters, Sheathing

Attic Insulation: Blown, Fiberglass

Approximate Average Depth of Insulation: 14 inches

Approximate Average Thickness of Vertical Insulation: less than 6 inches

Attic info: Pull Down stairs

Comments:

(1) Attic space inspected with limited access. This is for your information.

(2) There is inadequate fire blocking. This is a safety hazard and should be corrected. I recommend having a qualified person repair or replace as needed.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---

Re-inspected 01/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.



D. Item 1(Picture) garage access

E. Walls (Interior and Exterior)

Wall Structure: Wood

Comments:

(1) Nails are protruding from drywall in areas. This is a cosmetic issue. I recommend repairs as needed.

Re-inspected 01/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.



E. Item 1(Picture) inside garage


(2) The Brick siding at the exterior has hairline cracks. Deterioration can eventually occur if not corrected. A qualified contractor should inspect and repair as needed.

Re-inspected 01/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---

guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.

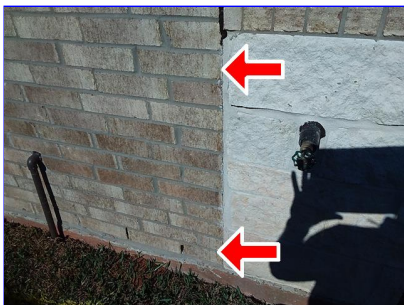

E. Item 2(Picture) left side of home

(3) Areas where wiring or piping passes through walls should be sealed. I recommend having a qualified person seal as needed.

Re-inspected 01/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.



E. Item 3(Picture) left side of home

F. Ceilings and Floors

Floor Structure: Slab
Floor System Insulation: NONE
Ceiling Structure: 6" or better

Comments:


The Drywall on the ceiling reveals tape line and nail bed areas (cosmetic). This damage is considered cosmetic. A qualified contractor should inspect and repair as needed.

Re-inspected 01/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is


I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---


performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.

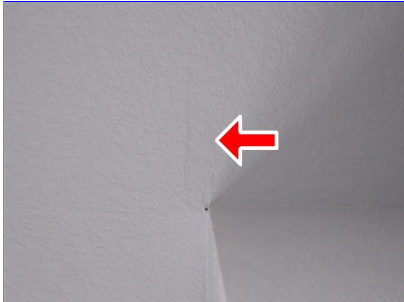


F. Item 1(Picture) front right bedroom

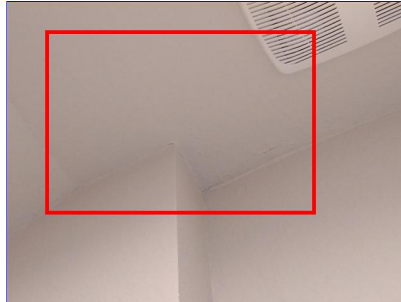


F. Item 2(Picture) guest bath

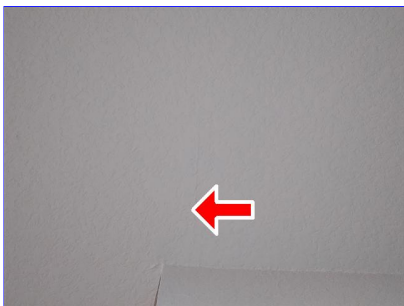


F. Item 3(Picture) bedroom hallway

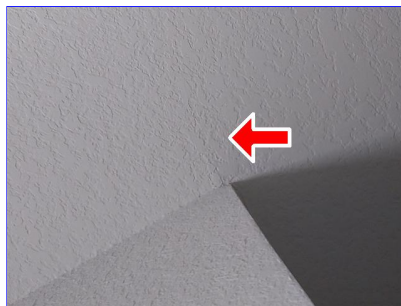

F. Item 4(Picture) front left bedroom

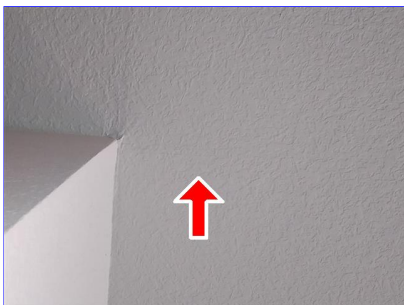

F. Item 5(Picture) living room

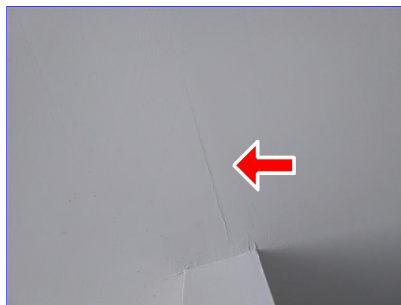

F. Item 6(Picture) garage areas

G. Doors (Interior and Exterior)

Comments:

The entry door has a damaged door jamb. This is a maintenance issue and is for your information. A qualified contractor should inspect and repair as needed.

Re-inspected 01/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.



G. Item 1(Picture) rear left bedroom




G. Item 2(Picture) rear left bedroom

H. Windows

Comments:

(1) Several windows difficult to operate in areas. This is a maintenance issue and is for your information. A qualified contractor should inspect and repair as needed.

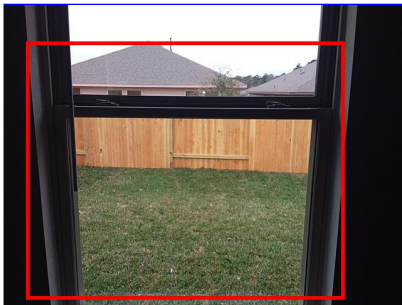

H. Item 1(Picture) multiple areas interior

(2) The glazing between glass panes appear to be failing at some windows causing cloudy glass (If there are multiple windows that are the same age and style it is safe to assume others will soon start to fail as well). I recommend having a qualified person make repairs as needed.

Re-inspected 01/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D



H. Item 2(Picture) living room

I. Stairways (Interior and Exterior)

Comments:

J. Fireplaces and Chimneys

Chimney (exterior): N/A

Operable Fireplaces: None

Types of Fireplaces: None

Number of Woodstoves: None

Comments:

K. Porches, Balconies, Decks and Carports

Comments:

The weight load capabilities are not part of this inspection.

L. Other

Comments:

(1) Laundry room only has option for electric dryer. No gas line. This is for your information.




L. Item 1(Picture) laundry room

(2) Areas of the home have caulking or grout missing or damaged. Deterioration could occur if not corrected. I recommend having a qualified contractor inspect and make repairs as needed.

Re-inspected 01/18/2022 **The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.**

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

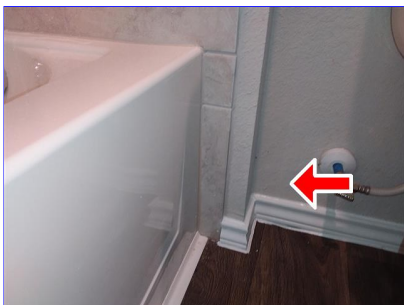

L. Item 2(Picture) left side guest bath areas



L. Item 3(Picture) multiple areas exterior outlets and service panels

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient


I NI NP D

II. ELECTRICAL SYSTEMS


The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.



meter box and main disconnect box left side of home underground service

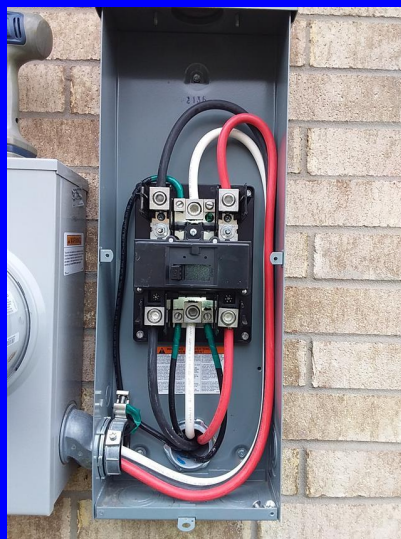

meter box 125 amp

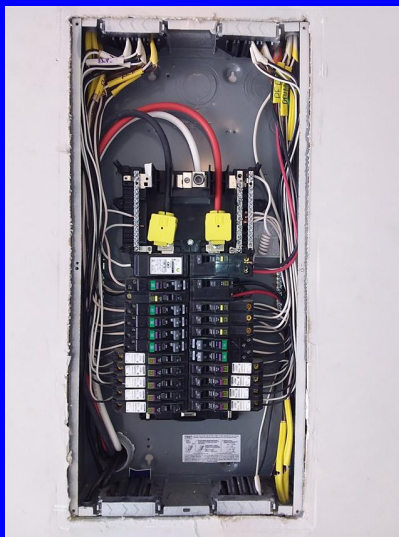

breaker box inside garage

A. Service Entrance and Panels

Electrical Service Conductors: Below ground, Aluminum

Panel Capacity: 125 AMP

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

Panel Type: Circuit breakers

Electric Panel Manufacturer: Square D

Comments:


(1) The main panel box is located at the outside. However, the main disconnect (shut-off) is outside at meter base panel (for your information).



A. Item 1(Picture) 125 amp

(2) There is no antioxidant on aluminum conductors feeding panel. This is not considered to be today's standard. I recommend having a qualified electrician evaluate make repairs as needed.

Re-inspected 01/18/2022 **The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.**

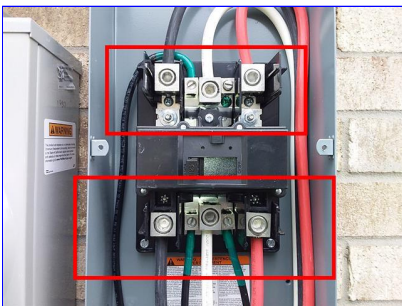

A. Item 2(Picture) 18 Jan 2022

B. Branch Circuits, Connected Devices, and Fixtures

Type of Wiring: Romex

Branch wire 15 and 20 amperage: Copper

Comments:

I recommend checking all smoke detectors for functionality and putting fresh batteries in each unit upon move in. It is recommend to have smoke detection in each bedroom, hallways and living area. (Carbon monoxide detection is recommended if home is equipped with gas fired appliances)

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily operable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.



carrier



mfd 2021 25 amp maximum breaker



carrier



April aire

A. Heating Equipment

Type of Systems: Forced Air

Energy Sources: Gas

Heat System Brand: Carrier


Number of Heat Systems (excluding wood): One

Comments:

- (1) It is recommend to have heating systems serviced annually.
- (2) Tested and working properly at the time of inspection.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---

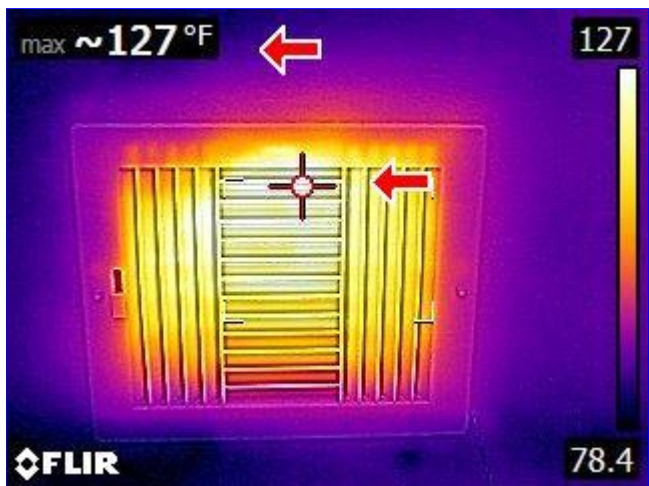

A. Item 1(Picture)

B. Cooling Equipment

Type of Systems: Air conditioner unit


Central Air Manufacturer: Carrier

Comments:


- (1) It is recommended to have HVAC systems serviced annually.
- (2) The ambient air test was performed by using infrared thermal equipment at the supply vents of Air conditioner to determine if the difference in temperatures of the supply and return air are between 14 degrees and 22 degrees which indicates that the unit is cooling as intended. The supply air temperature on your system read 50 degrees, and the return air temperature was 66 degrees. This indicates the range in temperature drop is normal.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---

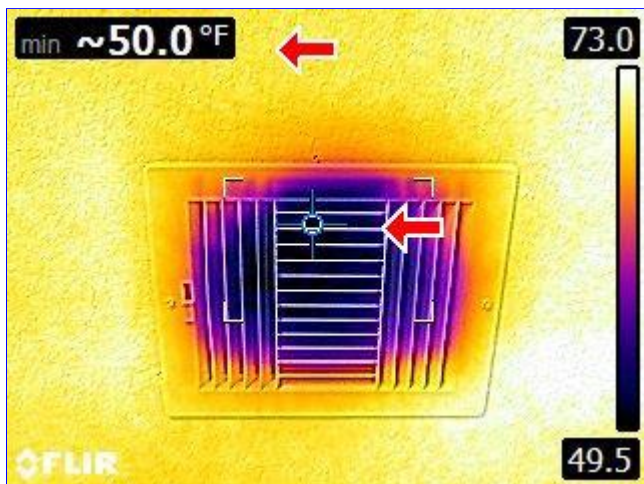

B. Item 1(Picture) supply

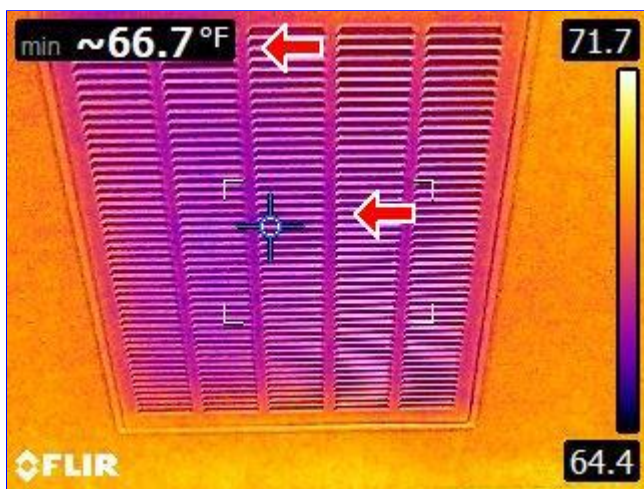

B. Item 2(Picture) return

C. Duct Systems, Chases, and Vents

Ductwork: Insulated

Filter Type: Disposable

Filter Size: N/A

Comments:

(1) I recommend changing all HVAC filters upon move in.

(2) Duct piping appears to be in contact with one another in the attic space. Condensation could occur if not corrected. I recommend having a qualified HVAC contractor further evaluate and make repairs as needed.

Re-inspected 01/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D



C. Item 1(Picture) multiple areas

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

IV. PLUMBING SYSTEM

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.




water shutoff inside garage left side




water meter front left of home



rinnai

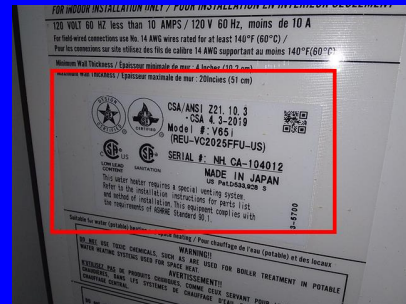

data plate

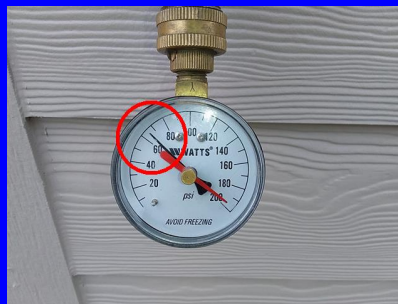

water pressure 65 psi

A. Plumbing Supply Distribution Systems and Fixtures

- Location of water meter:** Front, Left Side
- Location of main water supply valve:** Left Side
- Extra Info: inside garage
- Static water pressure reading:** 65 psi
- Water Source:** Public

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---

Plumbing Water Supply (into home): Not visible
Plumbing Water Distribution (inside home): PEX
Water Filters: (We do not inspect filtration systems)
Comments:

B. Drains, Waste, and Vents


Washer Drain Size: 2" Diameter
Plumbing Waste: PVC
Comments:

C. Water Heating Equipment

Energy Sources: Gas (quick recovery)
Capacity (Water Heater): Tankless
Water Heater Manufacturer: Rinnai (Tankless)
Water Heater Location: Garage
Comments:

(1) The water heater is installed without the recommended emergency overflow drain pan. This is not considered to be today's. I recommend having a drain pan installed by a qualified person.

Re-inspected 01/18/2022 **The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.**

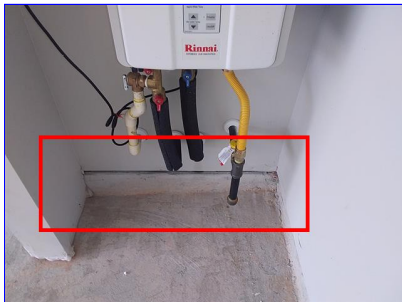

C. Item 1(Picture)

(2) Condensation drain line is not installed at time of inspection process. I recommend having a qualified plumber inspect and repair as needed.

Re-inspected 01/18/2022 **The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.**

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---



C. Item 2(Picture)

D. Hydro-Massage Therapy Equipment

[Comments:](#)

E. Other

[Comments:](#)

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

V. APPLIANCES

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.



A. Dishwashers

Dishwasher Brand: Whirlpool

Comments:

- (1) Tested and working properly at the time of inspection.
- (2) The dishwasher does not have a wall switch to prevent children from operating. I recommend repair as necessary.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---

Re-inspected 1/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.



A. Item 1(Picture)

B. Food Waste Disposers

Disposer Brand: Disposall

Serial #: moen

Comments:

Tested and working properly at the time of inspection.

C. Range Hood and Exhaust Systems

Exhaust/Range hood: Re-circulate, Whirlpool

Comments:

The kitchen vent hood does not vent to the outdoors. This is not considered to be today's standard.

Re-inspected 01/18/2022 The repairs do NOT appear to be adequate. The repair is either incomplete or has not been done according to standard workmanlike practice. It is recommended after a proper repair is performed that you obtain a copy of the repair contract from the seller(s). Our company does not guarantee repairs from contractors. We only re-inspect to determine whether or not repairs were performed.



C. Item 1(Picture)

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---

D. Ranges, Cooktops and Ovens

Range/Oven: Whirlpool

Comments:

Tested and working properly at the time of inspection.




D. Item 1(Picture) tested@(350) F

E. Microwave Ovens

Built in Microwave: Whirlpool

Comments:

Tested and working properly at the time of inspection.

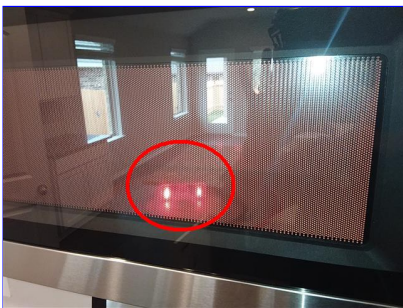

E. Item 1(Picture)

F. Mechanical Exhaust Vents and Bathroom Heaters

Comments:

Tested and working properly at the time of inspection.

G. Garage Door Operator(s)

Comments:

The sensors are in place for garage door(s) and will reverse the door.



G. Item 1(Picture)

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I	NI	NP	D
---	----	----	---

H. Dryer Exhaust Systems

Comments:

The dryer vent piping is long and vertical which can trap lint at elbow. Vent pipes should be cleaned regularly if they are longer than normal (10 feet or more) or vented vertically. I recommend repair as needed.



H. Item 1(Picture) laundry room

I. Other

Comments:

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

I = Inspected NI = Not Inspected NP = Not Present D = Deficient

I NI NP D

VI. OPTIONAL SYSTEMS



sprinkler system control panel
inside garage



backflow preventer left side of
home

A. Landscape Irrigation (Sprinkler) Systems

[Comments:](#)

Tested and working properly at the time of inspection however some sprinkler heads spray patterns will need adjustment or replacement.

B. Swimming Pools, Spas, Hot Tubs, and Equipment

[Comments:](#)

(1) Any area with a pool or spa should be equipped with safety features: Fencing (minimum 4ft), Self closing/latching/lockable gates (latch 54 inches), Door alarms on any doors leading to pool area and Splash alarms. I recommend consulting your insurance provider and their recommendation and requirements.

(2) Our company does not inspect pool for leaks or seepage. Only components readily accessible are inspected.

C. Outbuildings

[Comments:](#)

D. Private Water Wells (A coliform analysis is recommended)

[Comments:](#)

We only check wells for functionality and water pressure, water quality is not part of the scope of this inspection.

E. Private Sewage Disposal (Septic) System

[Comments:](#)

F. Other

[Comments:](#)

G. Outdoor Cooking Equipment

[Comments:](#)