



**krzysztof Cebulak**  
**Claim #:**  
**SERVPRO® Job #:**

## Job Summary

### Customer and Job Information

<b>Customer Name:</b>	krzysztof Cebulak	<b>Insurance / Client:</b>	
<b>Claim / PO Number:</b>		<b>Policy / WO Number:</b>	
<b>Servpro Job Number:</b>		<b>Customer Phone:</b>	(713) 205-3360
<b>Job Address 1:</b>	14318 Corktree Knolls	<b>Customer Email:</b>	Kceb58@gmail.com
<b>Job Address 2:</b>			
<b>City, State, Zip:</b>	Cypress, TX 77429		

### Timestamps

<b>Loss Received:</b>	9/2/2017 11:19 AM (CDT)	<b>Customer Called:</b>	9/2/2017 11:19 AM (CDT)
<b>Date of Loss:</b>	9/2/2017 11:18 AM (CDT)	<b>Arrival on Site:</b>	9/7/2017 10:05 AM (CDT)
<b>Drying Complete:</b>	9/12/2017 12:05 PM (CDT)		

### Loss Information

<b>Type of Loss:</b>	Water	<b>Cause of Loss:</b>	
<b>Structure Type:</b>	Residential	<b>Property Type:</b>	Unknown
<b>Electricity Available:</b>	Unknown	<b>Year Structure Built:</b>	

### Franchise Information

**Name:** Paris

**Address:** 3808 Hwy 271 N

Powderly, TX 75473

**Phone:** (903) 784-2700

### Additional Loss Information

<b>Category of Water:</b>	3	<b>Class of Water:</b>	3
<b>Days to Achieve Dry Standard:</b>	5.08	<b>Total Affected SF:</b>	2474.02
<b>Drying Zones:</b>	1		



krzysztof Cebulak

Claim #:

SERVPRO® Job #:

## Equipment

### Placement Count by Day and Type

Day	9/7	9/8	9/9	9/10	9/11	9/12	Total
Air Mover	36	36	36	36	36	0	180
Dehumidifier	4	4	4	4	4	0	20
<b>Total</b>	<b>40</b>	<b>40</b>	<b>40</b>	<b>40</b>	<b>40</b>	<b>0</b>	<b>200</b>

### Usage Summary

Equipment Type	Room	Equipment Model	Asset Number	Placed	Removed	Total Days*	Total Hours*
Air Mover	Bed	Triad	345A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	010A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Bed 2	Sahara Pro X3 TurboDryer	284A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	337A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Sahara Pro X3 TurboDryer	065A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	329A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Dining Room	Triad	043A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	048A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	017A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Entry	Triad	009A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Garage	Sahara Pro X3 TurboDryer	165A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Sahara Pro X3 TurboDryer	227A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Hall 2	Sahara Pro X3 TurboDryer	076A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9



Paris

krzysztof Cebulak

Claim #:

SERVPRO® Job #:

Equipment Type	Room	Equipment Model	Asset Number	Placed	Removed	Total Days*	Total Hours*
	Kitchen	Triad	014A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	331A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Sahara Pro X3 TurboDryer	129A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Linnen	Triad	349A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	047A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	023A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Lvr	Triad	030A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	025A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Sahara Pro X3 TurboDryer	137A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	315A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Sahara Pro X3 TurboDryer	254A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Mbr	Triad	326A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	338A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Sahara Pro X3 TurboDryer	274A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	339A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	024A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Mbr cl	Sahara Pro X3 TurboDryer	246A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Mbr tit	Sahara Pro X3 TurboDryer	239A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Office	Triad	002A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
		Triad	311A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9




**krzysztof Cebulak**  
**Claim #:**  
**SERVPRO® Job #:**

Equipment Type	Room	Equipment Model	Asset Number	Placed	Removed	Total Days*	Total Hours*
	Office cl	Triad	314A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Tlt	Triad	034A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Utl	Triad	350A	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	<b>Total</b>					<b>182.88</b>	<b>4,389.1</b>
Dehumidifier	Dining Room	Revolution	014D	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Linnen	R200 LGR	066D	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Lvr	Revolution	065D	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	Mbr	Revolution	009D	9/7/2017 10:05 AM	9/12/2017 12:05 PM	5.08	121.9
	<b>Total</b>					<b>20.32</b>	<b>487.7</b>
<b>Total</b>						<b>203.20</b>	<b>4,876.8</b>

\* Equipment Calculations are based on the difference between the "Removed Timestamp" and the "Placed Timestamp" for each piece of equipment. In the event that a piece of equipment has not yet been removed from the job, then the "Report Run Timestamp" will be used for calculations. Hours are calculated by multiplying the days by 24.

**Usage Chart**

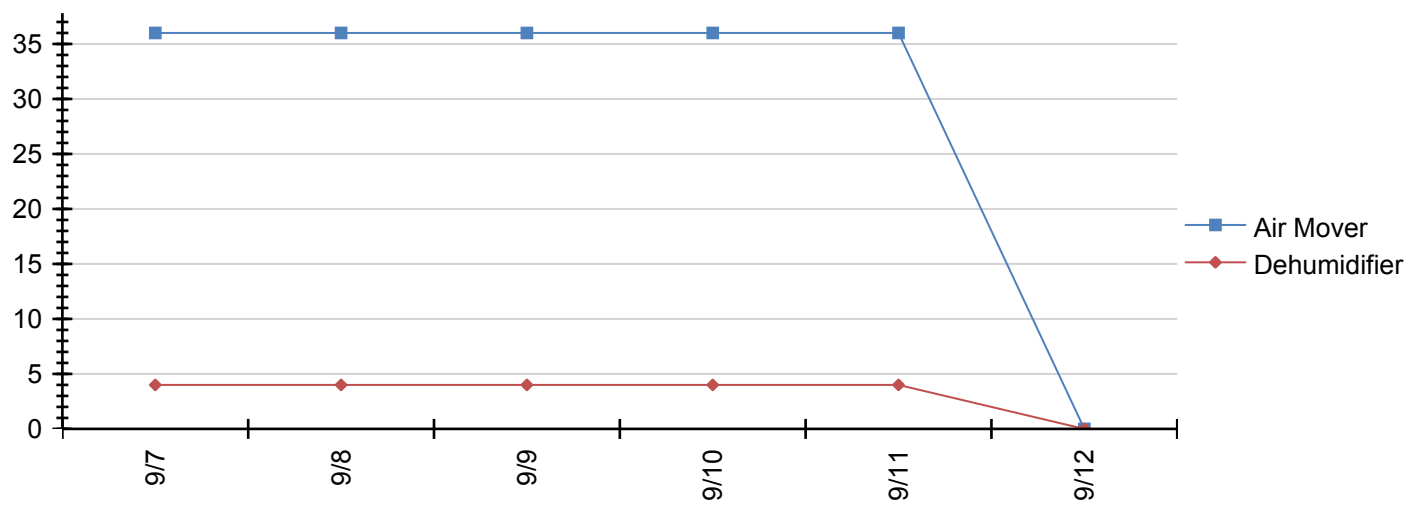



**krzysztof Cebulak**  
**Claim #:**  
**SERVPRO® Job #:**

## Diary Notes

Timestamp	Subject/Note
9/2/2017 11:19 AM (CDT)	<b>Customer Initial Contact</b> Walk the home with Mr. Cebulak agreed on cutting 2ft cuts throughout the house, spray and place drying equipment in the structure. Agreed on nte scope of \$12500.
9/2/2017 11:20 AM (CDT)	<b>Initial Call</b>
9/2/2017 11:20 AM (CDT)	<b>Loss Notes</b>
9/7/2017 11:07 AM (CDT)	<b>Equipment Validation Exception (Zone 1)</b>
9/7/2017 11:12 AM (CDT)	<b>Diary day 1</b> Placed 36 fans 4 dehus
9/7/2017 2:11 PM (CDT)	<b>HVAC turned off</b> HVAC turned off for Visit 1
9/8/2017 12:09 PM (CDT)	<b>HVAC turned off</b> HVAC turned off for Visit 2
9/8/2017 12:13 PM (CDT)	<b>Disry day 2</b> Monitored  Equip running  Structure still wet  Monitor tomorrow. Cw tc have key to home  Cw
9/9/2017 8:34 AM (CDT)	<b>HVAC turned off</b> HVAC turned off for Visit 3
9/9/2017 8:35 AM (CDT)	<b>Diary day 3</b> Monitored  Equip running  Structure wet  Cw
9/10/2017 8:56 AM (CDT)	<b>HVAC turned off</b> HVAC turned off for Visit 4
9/10/2017 8:56 AM (CDT)	<b>Diary day 4</b> Monitored  Equip running  Structure drying very well. Another day or two away from being dry  Cw
9/11/2017 8:31 AM (CDT)	<b>HVAC turned off</b> HVAC turned off for Visit 5



Paris

**krzysztof Cebulak**

**Claim #:**

**SERVPRO® Job #:**

<b>Timestamp</b>	<b>Subject/Note</b>
9/11/2017 8:33 AM (CDT)	<b>Diary day 5</b> Monitored  Equip running  Possible pickup tomorrow  Cw
9/12/2017 12:05 PM (CDT)	<b>HVAC turned off</b> HVAC turned off for Visit 6
9/12/2017 1:25 PM (CDT)	<b>Diary day 6</b> Monitored  Structure dry  Picked up equip  Customer not available for cos.  Cw
9/12/2017 1:31 PM (CDT)	<b>Equipment Validation Exception</b>



**krzysztof Cebulak**  
**Claim #:**  
**SERVPRO® Job #:**

# Zone Composition and Validation

## Zone 1

<b>Water Category:</b>	3	<b>Water Class:</b>	3
<b>Dehu Min Capacity Required:</b>	596 PPD	<b>Air Movers Requirement Method:</b>	Square Feet
<b>Dehu Actual Capacity Placed:</b>	365 PPD	<b>Air Movers Required:</b>	73 - 86
<b>Dehumidifiers Placed:</b>	4	<b>Air Movers Placed:</b>	36
<b>See Job Diary Notes</b>		<b>See Job Diary Notes</b>	

Room Name	% Floor Affected	Cubic Footage		Floor Square Footage			Floor Linear Footage		
		Total Room	Offsets Insets	Affected	Offsets Insets	Missing Spaces	Affected	Offsets Insets	Missing Spaces
Bed	100 %	1,446.46	0.00	144.65	0.00	0.00	48.33	0.00	0.00
Bed 2	100 %	1,370.25	0.00	152.25	0.00	0.00	50.00	0.00	0.00
Bed 2 cl	100 %	181.12	0.00	20.12	0.00	0.00	24.83	0.00	0.00
Bed cl	100 %	113.40	0.00	11.34	0.00	0.00	15.67	0.00	0.00
Dining Room	100 %	1,410.07	0.00	141.01	0.00	0.00	47.67	0.00	0.00
Entry	100 %	1,394.10	0.00	139.41	0.00	0.00	58.00	0.00	0.00
Garage	100 %	4,284.58	0.00	428.46	0.00	0.00	83.17	0.00	0.00
Hall	100 %	1,584.17	0.00	158.42	0.00	0.00	64.50	0.00	0.00
Hall 2	100 %	373.54	0.00	37.35	0.00	0.00	32.67	0.00	0.00
Hall Closet	100 %	58.33	0.00	5.83	0.00	0.00	10.17	0.00	0.00
Kitchen	100 %	2,042.92	0.00	255.35	0.00	0.00	46.00	0.00	0.00
Linnen	100 %	46.18	0.00	4.62	0.00	0.00	9.00	0.00	0.00
Lvr	100 %	2,903.33	0.00	290.33	0.00	0.00	68.17	0.00	0.00
Mbr	100 %	2,552.71	0.00	255.27	0.00	0.00	80.67	0.00	0.00
Mbr bth	100 %	843.06	0.00	105.38	0.00	0.00	36.50	0.00	0.00
Mbr cl	100 %	650.90	0.00	65.09	0.00	0.00	32.33	0.00	0.00
Mbr tlt	100 %	138.75	0.00	15.42	0.00	0.00	16.17	0.00	0.00
Office	100 %	1,246.67	0.00	124.67	0.00	0.00	44.67	0.00	0.00
Office cl	100 %	217.22	0.00	21.72	0.00	0.00	26.50	0.00	0.00
Pantry	100 %	56.67	0.00	5.67	0.00	0.00	9.67	0.00	0.00
Tlt	100 %	216.67	0.00	21.67	0.00	0.00	19.67	0.00	0.00
Utl	100 %	340.21	0.00	34.02	0.00	0.00	23.33	0.00	0.00
Vanity	100 %	359.72	0.00	35.97	0.00	0.00	26.50	0.00	0.00
<b>Total</b>		<b>23,831.03</b>	<b>0.00</b>	<b>2,474.02</b>	<b>0.00</b>	<b>0.00</b>	<b>874.19</b>	<b>0.00</b>	<b>0.00</b>



**krzysztof Cebulak**  
**Claim #:**  
**SERVPRO® Job #:**

# Drawings






**krzysztof Cebulak**  
 Claim #:  
 SERVPRO® Job #:

## Zone Equipment Usage

### Zone 1 Equipment Usage

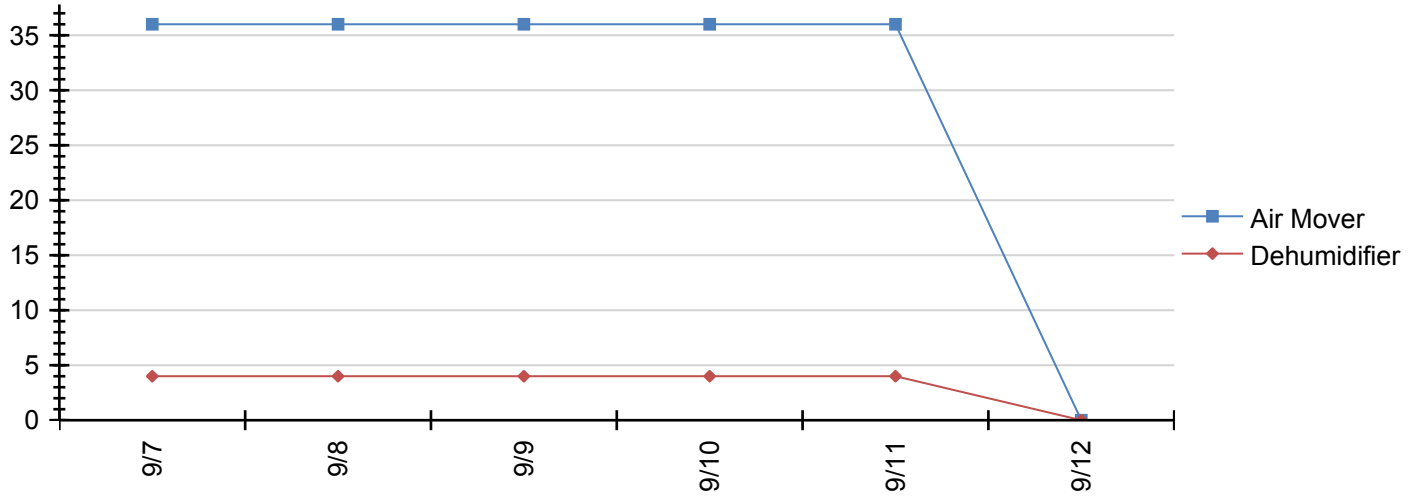

Date	Room	Air Mover Count	Dehu Model	Dehu Rating	Asset No	Dehu Hour Counter
9/7/2017 10:05 AM Tech: Cw	Bed	2				
	Bed 2	4				
	Dining Room	3	Revolution	80 PPD	014D	0
	Entry	1				
	Garage	2				
	Hall 2	1				
	Kitchen	3				
	Linnen	3	R200 LGR	125 PPD	066D	0
	Lvr	5	Revolution	80 PPD	065D	0
	Mbr	5	Revolution	80 PPD	009D	0
	Mbr cl	1				
	Mbr tlt	1				
	Office	2				
	Office cl	1				
	Tlt	1				
	Utl	1				
				<b>4</b>	<b>365 PPD</b>	



**krzysztof Cebulak**  
**Claim #:**  
**SERVPRO® Job #:**

Date	Room	Air Mover Count	Dehu Model	Dehu Rating	Asset No	Dehu Hour Counter
9/8/2017 12:08 PM Tech: Cw	Bed	2				
	Bed 2	4				
	Dining Room	3	Revolution	80 PPD	014D	24
	Entry	1				
	Garage	2				
	Hall 2	1				
	Kitchen	3				
	Linnen	3	R200 LGR	125 PPD	066D	24
	Lvr	5	Revolution	80 PPD	065D	25
	Mbr	5	Revolution	80 PPD	009D	24
	Mbr cl	1				
	Mbr tit	1				
	Office	2				
	Office cl	1				
	Tlt	1				
	Utl	1				
				<b>4</b>	<b>365 PPD</b>	
9/9/2017 8:30 AM Tech: Cw	Bed	2				
	Bed 2	4				
	Dining Room	3	Revolution	80 PPD	014D	44
	Entry	1				
	Garage	2				
	Hall 2	1				
	Kitchen	3				
	Linnen	3	R200 LGR	125 PPD	066D	44
	Lvr	5	Revolution	80 PPD	065D	45
	Mbr	5	Revolution	80 PPD	009D	45
	Mbr cl	1				
	Mbr tit	1				
	Office	2				
	Office cl	1				
	Tlt	1				
	Utl	1				
				<b>4</b>	<b>365 PPD</b>	



**krzysztof Cebulak**  
**Claim #:**  
**SERVPRO® Job #:**

Date	Room	Air Mover Count	Dehu Model	Dehu Rating	Asset No	Dehu Hour Counter
9/10/2017 8:50 AM Tech: Cw	Bed	2				
	Bed 2	4				
	Dining Room	3	Revolution	80 PPD	014D	69
	Entry	1				
	Garage	2				
	Hall 2	1				
	Kitchen	3				
	Linnen	3	R200 LGR	125 PPD	066D	69
	Lvr	5	Revolution	80 PPD	065D	69
	Mbr	5	Revolution	80 PPD	009D	69
	Mbr cl	1				
	Mbr tit	1				
	Office	2				
	Office cl	1				
	Tlt	1				
	Utl	1				
				<b>4</b>	<b>365 PPD</b>	
9/11/2017 8:24 AM Tech: Cw	Bed	2				
	Bed 2	4				
	Dining Room	3	Revolution	80 PPD	014D	92
	Entry	1				
	Garage	2				
	Hall 2	1				
	Kitchen	3				
	Linnen	3	R200 LGR	125 PPD	066D	92
	Lvr	5	Revolution	80 PPD	065D	92
	Mbr	5	Revolution	80 PPD	009D	92
	Mbr cl	1				
	Mbr tit	1				
	Office	2				
	Office cl	1				
	Tlt	1				
	Utl	1				
				<b>4</b>	<b>365 PPD</b>	



**krzysztof Cebulak**  
**Claim #:**  
**SERVPRO® Job #:**

# Monitoring

Key

<b>Blue</b>	= GPP Equal To OR Above 65 on Day 2
<b>Blue</b>	= RH Equal To OR Above 40 on Day 2
<b>Gray</b>	= GPP Not Making Progress(Not Decreasing Daily)
<b>Purple</b>	= Zone Temp Outside Optimal Range for Equip (68 to 90)
<b>Red</b>	= Negative Grains Depression
<b>Yellow</b>	= Low or Zero Grains Depression

## Atmospheric & Dehumidifier Readings

### Zone 1

Atmospheric Readings	Outside			Unaffected			HVAC			Zone 1		
	Temp	RH%	GPP	Temp	RH%	GPP	Temp	RH%	GPP	Temp	RH%	GPP
9/7/2017 10:05 AM Tech: Cw	80.0	55.0	84	75.0	30.0	38				75.0	50.0	64
9/8/2017 12:08 PM Tech: Cw	88.0	45.0	89	75.0	32.0	41				78.0	46.0	65
9/9/2017 8:30 AM Tech: Cw	64.0	54.0	47	75.0	32.0	41				80.0	44.0	67
9/10/2017 8:50 AM Tech: Cw	80.0	33.0	50	75.0	32.0	41				82.0	40.0	65
9/11/2017 8:24 AM Tech: Cw	72.0	40.0	46	75.0	30.0	38				83.0	38.0	63
9/12/2017 12:05 PM Tech: Cw	90.0	55.0	116	75.0	32.0	41				90.0	30.0	63

Dehumidifier Readings	Revolution 009D					Revolution 014D					R200 LGR 066D				
	Temp	RH%	GPP	GDEP	Hrs	Temp	RH%	GPP	GDEP	Hrs	Temp	RH%	GPP	GDEP	Hrs
9/7/2017 10:05 AM Tech: Cw	86.0	24.0	44	20	0	80.0	29.0	44	20	0	82.0	27.0	43	21	0
9/8/2017 12:08 PM Tech: Cw	82.0	30.0	48	17	24	82.0	29.0	47	18	24	83.0	29.0	48	17	24
9/9/2017 8:30 AM Tech: Cw	85.0	29.0	52	15	45	84.0	30.0	52	15	44	86.0	28.0	51	16	44
9/10/2017 8:50 AM Tech: Cw	89.0	26.0	52	13	69	87.0	28.0	53	12	69	88.0	27.0	53	12	69
9/11/2017 8:24 AM Tech: Cw	94.0	22.0	52	11	92	90.0	25.0	52	11	92	92.0	23.0	51	12	92
9/12/2017 12:05 PM Tech: Cw	99.0	20.0	55	8	120	100.0	20.0	57	6	120	102.0	20.0	60	3	120



**krzysztof Cebulak**  
**Claim #:**  
**SERVPRO® Job #:**

**Atmospheric & Dehumidifier Readings**

**Zone 1**

Dehumidifier Readings	Revolution 065D				
	Temp	RH%	GPP	GDEP	Hrs
9/7/2017 10:05 AM Tech: Cw	83.0	25.0	42	22	0
9/8/2017 12:08 PM Tech: Cw	84.0	28.0	48	17	25
9/9/2017 8:30 AM Tech: Cw	88.0	26.0	51	16	45
9/10/2017 8:50 AM Tech: Cw	91.0	24.0	52	13	69
9/11/2017 8:24 AM Tech: Cw	97.0	20.0	52	11	92
9/12/2017 12:05 PM Tech: Cw	107.0	18.0	63	0	120



**krzysztof Cebulak**  
**Claim #:**  
**SERVPRO® Job #:**

**Moisture Content Readings**

**Zone 1**

Room	Material	%/Pts	Goal	9/7 10:05a Cw	9/8 12:08p Cw	9/9 8:30a Cw	9/10 8:50a Cw	9/11 8:24a Cw	9/12 12:05p Cw
Bed	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Bed 2	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Bed 2 cl	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Bed cl	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Dining Room	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Entry	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Garage	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Hall	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Hall 2	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Hall Closet	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Kitchen	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Linnen	Wood - Framing/Stud	%	15	40	35	30	28	20	15
Lvr	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Mbr	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Mbr bth	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Mbr cl	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Mbr tlt	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Office	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Office cl	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Pantry	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Tlt	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Utl	Wood - Framing/Stud	%	15	40	35	30	25	20	15
Vanity	Wood - Framing/Stud	%	15	40	35	30	25	20	15

*Colin Nixon*  
 dotloop verified  
 03/02/18 9:39 AM CST  
 E9MM-NDXT-SZNE-THNR

*Rachel L. Tolari*  
 dotloop verified  
 03/02/18 10:26 AM CST  
 BC00-CKIZ-G0AO-YXAF